


✓ Truck Copy
Office Copy
RL File Copy

R12-1



CV8454307

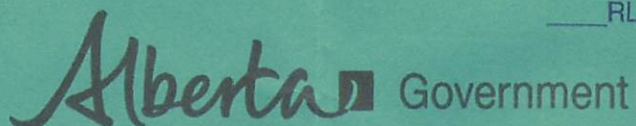

80087100008454307

CERTIFICATE NUMBER

**Commercial Vehicle Inspection Certificate
Traffic Safety Act**

**PART 1 - VEHICLE OWNER AND VEHICLE
IDENTIFICATION**

Vehicle Type:	Trailer	Seating Capacity:	
GVW:	kg	Brake Type:	Air
Owner Name:	west land livestock inc		
Address:	PO Box 238		
City:	acme	Province:	AB
		Postal Code:	T0M 0A0
Telephone Number:	(403) 546-2403		
Vehicle Identification Number:	2M512161991120898		
Make:	Manac	Model:	1Z253AZ0
Year:	2009	Unit Number:	CH3
Odometer:	KM	Licence Plate Number:	5BG906
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Red Line Truck & Trailer Services Ltd	10271
Inspection Technician Name:	Technician Number:
MacKenzie Tetz	D2577
Inspection Technician Signature:	
Inspection Date:	2025/11/28



Government

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle										Gross Vehicle Weight registered									
Trailer										kg									
Vehicle Information																			
VIN		2	M	5	1	2	1	6	1	9	9	1	1	2	0	8	9	8	
Unit Number				Year				Make				Model				Odometer			
CH3				2009				Manac				1Z253AZ0							
Registered Owner's Name															Plate Number				
west land livestock inc															5BG906				
Address										Postal Code					Phone Number				
PO Box 238										T0M 0A0					(403) 546-2403				

Drum Brakes:	A-Full Inspection with Drum Removed	Disc Brakes:
--------------	-------------------------------------	--------------

		LEFT	FRONT	RIGHT						
90 psi	90 psi	419.35 mm	Drums/Rotors	419.61 mm	90 psi	90 psi				
13 mm	13 mm	16 mm	Linings/Pads	17 mm	13 mm	13 mm				
		38.1 mm	Push Rod Travel	38.1 mm						
90 psi	90 psi	419.61 mm	Drums/Rotors	419.61 mm	90 psi	90 psi				
13 mm	8 mm	18 mm	Linings/Pads	16 mm	14 mm	15 mm				
		38.1 mm	Push Rod Travel	38.1 mm						
psi	psi	mm	Drums/Rotors	mm	psi	psi				
mm	mm	mm	Linings/Pads	mm	mm	mm				
		mm	Push Rod Travel	mm						
psi	psi	mm	Drums/Rotors	mm	psi	psi				
mm	mm	mm	Linings/Pads	mm	mm	mm				
		mm	Push Rod Travel	mm						
psi	psi	mm	Drums/Rotors	mm	psi	psi				
mm	mm	mm	Linings/Pads	mm	mm	mm				
		mm	Push Rod Travel	mm						
psi	psi	mm	Drums/Rotors	mm	psi	psi				
mm	mm	mm	Linings/Pads	mm	mm	mm				
		mm	Push Rod Travel	mm						
Park Brake Lining		Left	NA	mm	Right	NA	mm	Trans	NA	mm
Wheel Torque Checked		☒	Inner	500	ft lbs	Outer	500	ft lbs		

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

Section 1 - Power Train

Component	P	F	NA	Component	P	F	NA
1.2. Exhaust System			✓	1.12. Gasoline or Diesel Fuel System (LPG, CNG, & LNG) * SEE APPENDIX A*			✓

NOTES:

APPENDIX "A"

Component	P	F	NA	Component	P	F	NA
A.1. Liquefied Petroleum Gas (LPG or Propane) Fuel System			✓	A.3. Liquefied Natural Gas (LNG) Fuel System			✓
A.2. Compressed Natural Gas (CNG) Fuel System			✓				

NOTES:

Section 2 - Suspension

Component	P	F	NA	Component	P	F	NA
2.1. Suspension & Frame Attachments	✓			2.5. Air Suspension	✓		
2.2. Axle Attaching & Tracking Components	✓			2.6. Self-Steer & Controlled-Steer Axle			✓
2.3. Axle & Axle Assembly	✓			2.7. Shock Absorber/Strut Assembly	✓		
2.4. Spring & Spring Attachment	✓						

NOTES:

Section 3H - Hydraulic Brakes

Component	P	F	NA	Component	P	F	NA
3H.1. Hydraulic System Components			✓	3H.10. Electric Brake System			✓
3H.6. Air-Over-Hydraulic Brake System			✓	3H.12. Drum Brake System Components			✓
3H.7. Surge Brake Controller			✓	3H.13. Disc Brake System Components			✓
3H.8. Vacuum System			✓	3H.19. Brake Performance			✓
3H.9. Air-Boosted Trailer Brake System			✓				

NOTES:

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.3. Air System Leakage	✓			3A.16. S-Cam Drum Brake System	✓		
3A.4. Air Tank	✓			3A.17. Brake Shoe Travel (Wedge Brakes)			✓
3A.8. Brake Valves & Controls	✓			3A.18. Disc Brake System Components			✓
3A.12. Parking Brake & Emergency Application	✓			3A.20. Anti-Lock Brake System (ABS)	✓		
3A.13. Air System Components	✓			3A.22. Stability Control System (ESC) or (RSS)			✓
3A.14. Brake Chamber	✓			3A.23. Brake Performance			✓
3A.15. Drum Brake System Components	✓						

NOTES:

A4 S-Cam bushings worn out; replaced with new
A5 S-Cam bushings worn out; replaced with new

Section 4 - Steering

Component	P	F	NA	Component	P	F	NA
4.1. Steering Control & Linkage			✓	4.5. Self Steer & Controlled-Steer Axle			✓
4.4. Kingpin			✓				

NOTES:

SECTION 5 - COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

Section 5 - Instruments and Auxiliary Equipment

Component	P	F	NA	Component	P	F	NA
5.1. Fire Extinguisher	✓						

NOTES:

Section 6 - Lamps

Component	P	F	NA	Component	P	F	NA
6.1. Required Lamps	✓			6.3. Retro-Reflective Marking	✓		
6.2. Reflex Reflector	✓						

NOTES: The Vehicle for which this Record of Inspection is issued has PASSED (Certificate #55444307) the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 271/2008 and the applicable Inspection Manual.

Section 7 - Electrical System

Component	P	F	NA	Component	P	F	NA
7.1. Wiring	✓			7.3. Trailer Cord (output to towed vehicle)	✓		
7.2. Battery	✓						

NOTES: The initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.

Section 8 - Body

Component	P	F	NA	Component	P	F	NA
8.5. Cargo Body	✓			8.11. Refrigeration/Heater Unit Fuel System			✓
8.6. Frame Rails & Mounts	✓			8.21. Fender/Mud Flap	✓		
8.7. Unitized Body Elements	✓			8.22. Landing Gear on Trailer			✓
8.8. Cab or Cargo Door			✓	8.23. Sliding Axle Assembly (Sliding Bogie)			✓
8.9. Cargo Tank or Vessel			✓	8.24. Aerodynamic Device & Attachment			✓
8.10. Body, Device or Equipment Attached or Mounted to the Vehicle	✓			8.25. Rear Impact Guard (RIG)			✓

NOTES:

Locks for top sliding rails are bent: heated and straighter out
 Left ramps front ramps cracked: welded
 A4 Ramps are cracked: welded
 Hydraulic line leaking: replaced line
 hydraulic line leaking at front of trailer: replaced line
 rear folding ramps cracked: welded

Section 9 - Tires and Wheels

Component	P	F	NA	Component	P	F	NA
9.1. Tire Tread Depth	✓			9.7. Wheel/Rim	✓		
9.2. Tire Tread Condition	✓			9.8. Multi-Piece Wheel/Rim			✓
9.3. Tire Sidewall & Manufacturer Markings	✓			9.9. Spoke Wheel/Demountable Rim System			✓
9.4. Tire Inflation Pressure	✓			9.10. Disc Wheel System	✓		
9.5. Wheel Hub	✓			9.11. Wheel Fasteners (Nuts, Bolts, & Studs)	✓		
9.6. Wheel Bearing			✓				

NOTES:

A4 Tires showing cords: replaced with new
 A5-T3 flat repair: patched
 A5-T1 flat repair: patched
 A4-T4 wheel seal leaking: checked bearings and replaced seal

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

Section 10 - Couplers and Hitches							
Component	P	F	NA	Component	P	F	NA
10.1. Hitch Assembly, Structure & Attaching Components	✓			10.6. Automated Coupling Device			✓
10.2. Secondary Attachment (Safety Chain or Cable)			✓	10.7. Fifth Wheel Coupler	✓		
10.3. Pintle Hook, Pin Hitch, or Coupler Hitch			✓	10.8. Oscillating Fifth Wheel Coupler			✓
10.4. Ball Type Hitch			✓	10.9. Ball-Bearing Type Turntable on Trailer			✓
10.5. Roll-Coupling Hitch			✓				

NOTES:

Certification

The Vehicle for which this Record of Inspection is issued has **PASSED** (Certificate #8454307) the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

Date of Inspection 2025/11/28	Technician Number D2577	Facility Number 10271	Signature
Customer Acknowledgment			
I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.			Date (Year/Month/Day) 2025/11/28 Customer Signature