



CV8493846



80087100008493846

CERTIFICATE NUMBER

## Commercial Vehicle Inspection Certificate Traffic Safety Act

### PART 1 - VEHICLE OWNER AND VEHICLE IDENTIFICATION

|                                |                   |                       |        |
|--------------------------------|-------------------|-----------------------|--------|
| Vehicle Type:                  | Trailer           | Seating Capacity:     |        |
| GVW:                           | kg                | Brake Type:           | Air    |
| Owner Name:                    | AWG VENTURES LTD. |                       |        |
| Address:                       | P.O BOX 334       |                       |        |
| City:                          | SMITH             | Province:             | AB     |
|                                |                   | Postal Code:          | T0G2B0 |
| Telephone Number:              | (780) 516-1540    |                       |        |
| Vehicle Identification Number: | 2K9LG4484DL072096 |                       |        |
| Make:                          | Gerry's           | Model:                | Logger |
| Year:                          | 2013              | Unit Number:          |        |
| Odometer:                      | KM                | Licence Plate Number: | 6PB825 |
|                                |                   | Province:             | AB     |

**IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE**

### PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

|                                  |                    |
|----------------------------------|--------------------|
| Inspection Facility Name:        | Facility Number:   |
| JBS Mechanical Inc.              | 19147              |
| Inspection Technician Name:      | Technician Number: |
| Jeff Golden                      | B5600              |
| Inspection Technician Signature: |                    |
| Inspection Date:                 | 2026/08/20         |

# COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

## Section 5 - Instruments and Auxiliary Equipment

| Component              | P | F | NA | Component | P | F | NA |
|------------------------|---|---|----|-----------|---|---|----|
| 5.1. Fire Extinguisher |   |   | ✓  |           |   |   |    |

### NOTES:

## Section 6 - Lamps

| Component             | P | F | NA | Component                     | P | F | NA |
|-----------------------|---|---|----|-------------------------------|---|---|----|
| 6.1. Required Lamps   | ✓ |   |    | 6.3. Retro-Reflective Marking | ✓ |   |    |
| 6.2. Reflex Reflector | ✓ |   |    |                               |   |   |    |

### NOTES:

Rear RH light box needs repairs to hold light, Multiple lights out, Corner stakes need reflective tape, and reflective strips across mud flaps

## Section 7 - Electrical System

| Component    | P | F | NA | Component                                   | P | F | NA |
|--------------|---|---|----|---------------------------------------------|---|---|----|
| 7.1. Wiring  | ✓ |   |    | 7.3. Trailer Cord (output to towed vehicle) |   |   | ✓  |
| 7.2. Battery |   |   | ✓  |                                             |   |   |    |

### NOTES:

Rear junction box corroded out

## Section 8 - Body

| Component                                                          | P | F | NA | Component                                   | P | F | NA |
|--------------------------------------------------------------------|---|---|----|---------------------------------------------|---|---|----|
| 8.5. Cargo Body                                                    |   |   | ✓  | 8.11. Refrigeration/Heater Unit Fuel System |   |   | ✓  |
| 8.6. Frame Rails & Mounts                                          | ✓ |   |    | 8.21. Fender/Mud Flap                       | ✓ |   |    |
| 8.7. Unitized Body Elements                                        |   |   | ✓  | 8.22. Landing Gear on Trailer               | ✓ |   |    |
| 8.8. Cab or Cargo Door                                             |   |   | ✓  | 8.23. Sliding Axle Assembly (Sliding Bogie) |   |   | ✓  |
| 8.9. Cargo Tank or Vessel                                          |   |   | ✓  | 8.24. Aerodynamic Device & Attachment       |   |   | ✓  |
| 8.10. Body, Device or Equipment Attached or Mounted to the Vehicle | ✓ |   |    | 8.25. Rear Impact Guard (RIG)               | ✓ |   |    |

### NOTES:

Front fenders have loose bolts, Landing gear pin missing, 2nd front cross member has a crack, Bunk bolts loose

## Section 9 - Tires and Wheels

| Component                                  | P | F | NA | Component                                    | P | F | NA |
|--------------------------------------------|---|---|----|----------------------------------------------|---|---|----|
| 9.1. Tire Tread Depth                      | ✓ |   |    | 9.7. Wheel/Rim                               | ✓ |   |    |
| 9.2. Tire Tread Condition                  | ✓ |   |    | 9.8. Multi-Piece Wheel/Rim                   |   |   | ✓  |
| 9.3. Tire Sidewall & Manufacturer Markings | ✓ |   |    | 9.9. Spoke Wheel/Demountable Rim System      |   |   | ✓  |
| 9.4. Tire Inflation Pressure               | ✓ |   |    | 9.10. Disc Wheel System                      |   |   | ✓  |
| 9.5. Wheel Hub                             | ✓ |   |    | 9.11. Wheel Fasteners (Nuts, Bolts, & Studs) | ✓ |   |    |
| 9.6. Wheel Bearing                         | ✓ |   |    |                                              |   |   |    |

### NOTES:

Axle 3 RH wheel seal leaking

## Section 10 - Couplers and Hitches

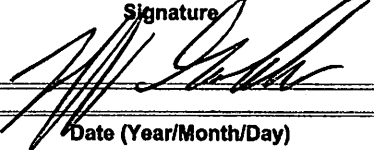
| Component                                              | P | F | NA | Component                                    | P | F | NA |
|--------------------------------------------------------|---|---|----|----------------------------------------------|---|---|----|
| 10.1. Hitch Assembly, Structure & Attaching Components | ✓ |   |    | 10.6. Automated Coupling Device              |   |   | ✓  |
| 10.2. Secondary Attachment (Safety Chain or Cable)     |   |   | ✓  | 10.7. Fifth Wheel Coupler                    |   |   | ✓  |
| 10.3. Pintle Hook, Pin Hitch, or Coupler Hitch         |   |   | ✓  | 10.8. Oscillating Fifth Wheel Coupler        |   |   | ✓  |
| 10.4. Ball Type Hitch                                  |   |   | ✓  | 10.9. Ball-Bearing Type Turntable on Trailer |   |   | ✓  |
| 10.5. Roll-Coupling Hitch                              |   |   | ✓  |                                              |   |   |    |

**COMMERCIAL VEHICLE RECORD OF INSPECTION  
TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY**

**NOTES:**

**Certification**

The Vehicle for which this Record of Inspection is issued has **PASSED (Certificate #8493846)** the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

| Date of Inspection | Technician Number | Facility Number | Signature                                                                           |
|--------------------|-------------------|-----------------|-------------------------------------------------------------------------------------|
| 2026/08/20         | B5600             | 19147           |  |

**Customer Acknowledgment**

I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.

Date (Year/Month/Day)

2026/08/20

Customer Signature