



CERTIFICATE NUMBER

Commercial Vehicle Inspection Certificate
Traffic Safety Act

PART 1 - VEHICLE OWNER AND VEHICLE
IDENTIFICATION

Vehicle Type:	Trailer	Seating Capacity:	
GVW:	kg	Brake Type:	Air
Owner Name:	Ronco Oilfield Hauling Ltd		
Address:	Box 338		
City:	Medicine Hat	Province:	AB
		Postal Code:	T1A-7G1
Telephone Number:	(403) 526-4873		
Vehicle Identification Number:	2L9FS03996H003475		
Make:	Gerry's	Model:	Tri Axle Float
Year:	2006	Unit Number:	230
Odometer:	247474 KM	Licence Plate Number:	V42635
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Ronco Oilfield Hauling Ltd.	12860
Inspection Technician Name:	Technician Number:
Douglas Kromrey	A1251
Inspection Technician Signature:	<i>Douglas Kromrey</i>
Inspection Date:	2026/02/11

SECRET
U.S. DEPARTMENT OF AGRICULTURE
OFFICE OF THE SECRETARY

OFFICE OF THE SECRETARY
U.S. DEPARTMENT OF AGRICULTURE

WASHINGTON, D.C.

Director, Federal Bureau of Investigation
U.S. Department of Justice

Dear Sir:

Reference is made to your letter of the 10th instant, in which you requested information regarding the activities of the "Black Legion" in the United States. The following information is being furnished to you for your information:

The "Black Legion" is a secret organization which is active in the United States. It is a combination of the Ku Klux Klan and the Black Panther Party. It is a very powerful organization and is active in many parts of the United States. It is a very dangerous organization and is a threat to the peace and stability of the United States.

The "Black Legion" is a very powerful organization and is active in many parts of the United States. It is a very dangerous organization and is a threat to the peace and stability of the United States.

The "Black Legion" is a very powerful organization and is active in many parts of the United States. It is a very dangerous organization and is a threat to the peace and stability of the United States.

Very truly yours,
Secretary

U.S. DEPARTMENT OF AGRICULTURE

Enclosed for you are two copies of a report on the activities of the "Black Legion" in the United States. This report was prepared by the Federal Bureau of Investigation and is being furnished to you for your information.

The report contains information regarding the activities of the "Black Legion" in the United States. It is a very powerful organization and is active in many parts of the United States. It is a very dangerous organization and is a threat to the peace and stability of the United States.

The report contains information regarding the activities of the "Black Legion" in the United States. It is a very powerful organization and is active in many parts of the United States. It is a very dangerous organization and is a threat to the peace and stability of the United States.

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle										Gross Vehicle Weight registered									
Trailer										kg									
Vehicle Information																			
VIN	2	L	9	F	S	0	3	9	9	6	H	0	0	3	4	7	5		
Unit Number 230				Year 2006				Make Gerry's				Model Tri Axle Float				Odometer 247,474			
Registered Owner's Name Ronco Oilfield Hauling Ltd															Plate Number V42635				
Address Box 338										Postal Code T1A-7G1					Phone Number (403) 526-4873				

Drum Brakes: B-Wheel-on Full Inspection

Disc Brakes:

		<u>LEFT</u>		<u>FRONT</u>		<u>RIGHT</u>			
110 psi	110 psi	16.536 in	Drums/Rotors	16.542 in		110 psi	110 psi		
1/4 in	1/4 in	5/8 in	Linings/Pads	5/8 in		5/16 in	5/16 in		
		1 1/2 in	Push Rod Travel	1 1/2 in					
110 psi	110 psi	16.543 in	Drums/Rotors	16.551 in		110 psi	110 psi		
5/16 in	3/8 in	9/16 in	Linings/Pads	9/16 in		5/16 in	7/16 in		
		1 1/2 in	Push Rod Travel	1 1/2 in					
110 psi	110 psi	16.545 in	Drums/Rotors	16.547 in		110 psi	110 psi		
5/16 in	7/16 in	9/16 in	Linings/Pads	5/8 in		7/16 in	7/16 in		
		1 1/2 in	Push Rod Travel	1 1/2 in					
psi	psi		Drums/Rotors			psi	psi		
in	in		Linings/Pads			in	in		
			Push Rod Travel						
psi	psi		Drums/Rotors			psi	psi		
in	in		Linings/Pads			in	in		
			Push Rod Travel						
psi	psi		Drums/Rotors			psi	psi		
in	in		Linings/Pads			in	ir		
			Push Rod Travel						

Park Brake Lining Left n/a in Right n/a in Trans n/a in

Wheel Torque Checked ☒ Inner 500 ft lbs Outer 500 ft lbs

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

Section 1 - Power Train								
Component	P	F	NA	Component	P	F	NA	
1.2. Exhaust System			✓	1.12. Gasoline or Diesel Fuel System (LPG, CNG, & LNG) * SEE APPENDIX A*			✓	

NOTES:

APPENDIX "A"								
Component	P	F	NA	Component	P	F	NA	
A.1. Liquefied Petroleum Gas (LPG or Propane) Fuel System			✓	A.3. Liquefied Natural Gas (LNG) Fuel System			✓	
A.2. Compressed Natural Gas (CNG) Fuel System			✓					

NOTES:

Section 2 - Suspension								
Component	P	F	NA	Component	P	F	NA	
2.1. Suspension & Frame Attachments	✓			2.5. Air Suspension	✓			
2.2. Axle Attaching & Tracking Components	✓			2.6. Self-Steer & Controlled-Steer Axle			✓	
2.3. Axle & Axle Assembly	✓			2.7. Shock Absorber/Strut Assembly	✓			
2.4. Spring & Spring Attachment			✓					

NOTES:

Section 3H - Hydraulic Brakes								
Component	P	F	NA	Component	P	F	NA	
3H.1. Hydraulic System Components			✓	3H.10. Electric Brake System			✓	
3H.6. Air-Over-Hydraulic Brake System			✓	3H.12. Drum Brake System Components			✓	
3H.7. Surge Brake Controller			✓	3H.13. Disc Brake System Components			✓	
3H.8. Vacuum System			✓	3H.19. Brake Performance			✓	
3H.9. Air-Boosted Trailer Brake System			✓					

NOTES:

Section 3A - Air Brakes								
Component	P	F	NA	Component	P	F	NA	
3A.3. Air System Leakage	✓			3A.16. S-Cam Drum Brake System	✓			
3A.4. Air Tank	✓			3A.17. Brake Shoe Travel (Wedge Brakes)			✓	
3A.8. Brake Valves & Controls	✓			3A.18. Disc Brake System Components			✓	
3A.12. Parking Brake & Emergency Application	✓			3A.20. Anti-Lock Brake System (ABS)	✓			
3A.13. Air System Components	✓			3A.22. Stability Control System (ESC) or (RSS)			✓	
3A.14. Brake Chamber	✓			3A.23. Brake Performance	✓			
3A.15. Drum Brake System Components	✓							

NOTES:

Section 4 - Steering								
Component	P	F	NA	Component	P	F	NA	
4.1. Steering Control & Linkage			✓	4.5. Self Steer & Controlled-Steer Axle			✓	
4.4. Kingpin			✓					

NOTES:

Page 10

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION


CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

CONFIDENTIAL - SECURITY INFORMATION

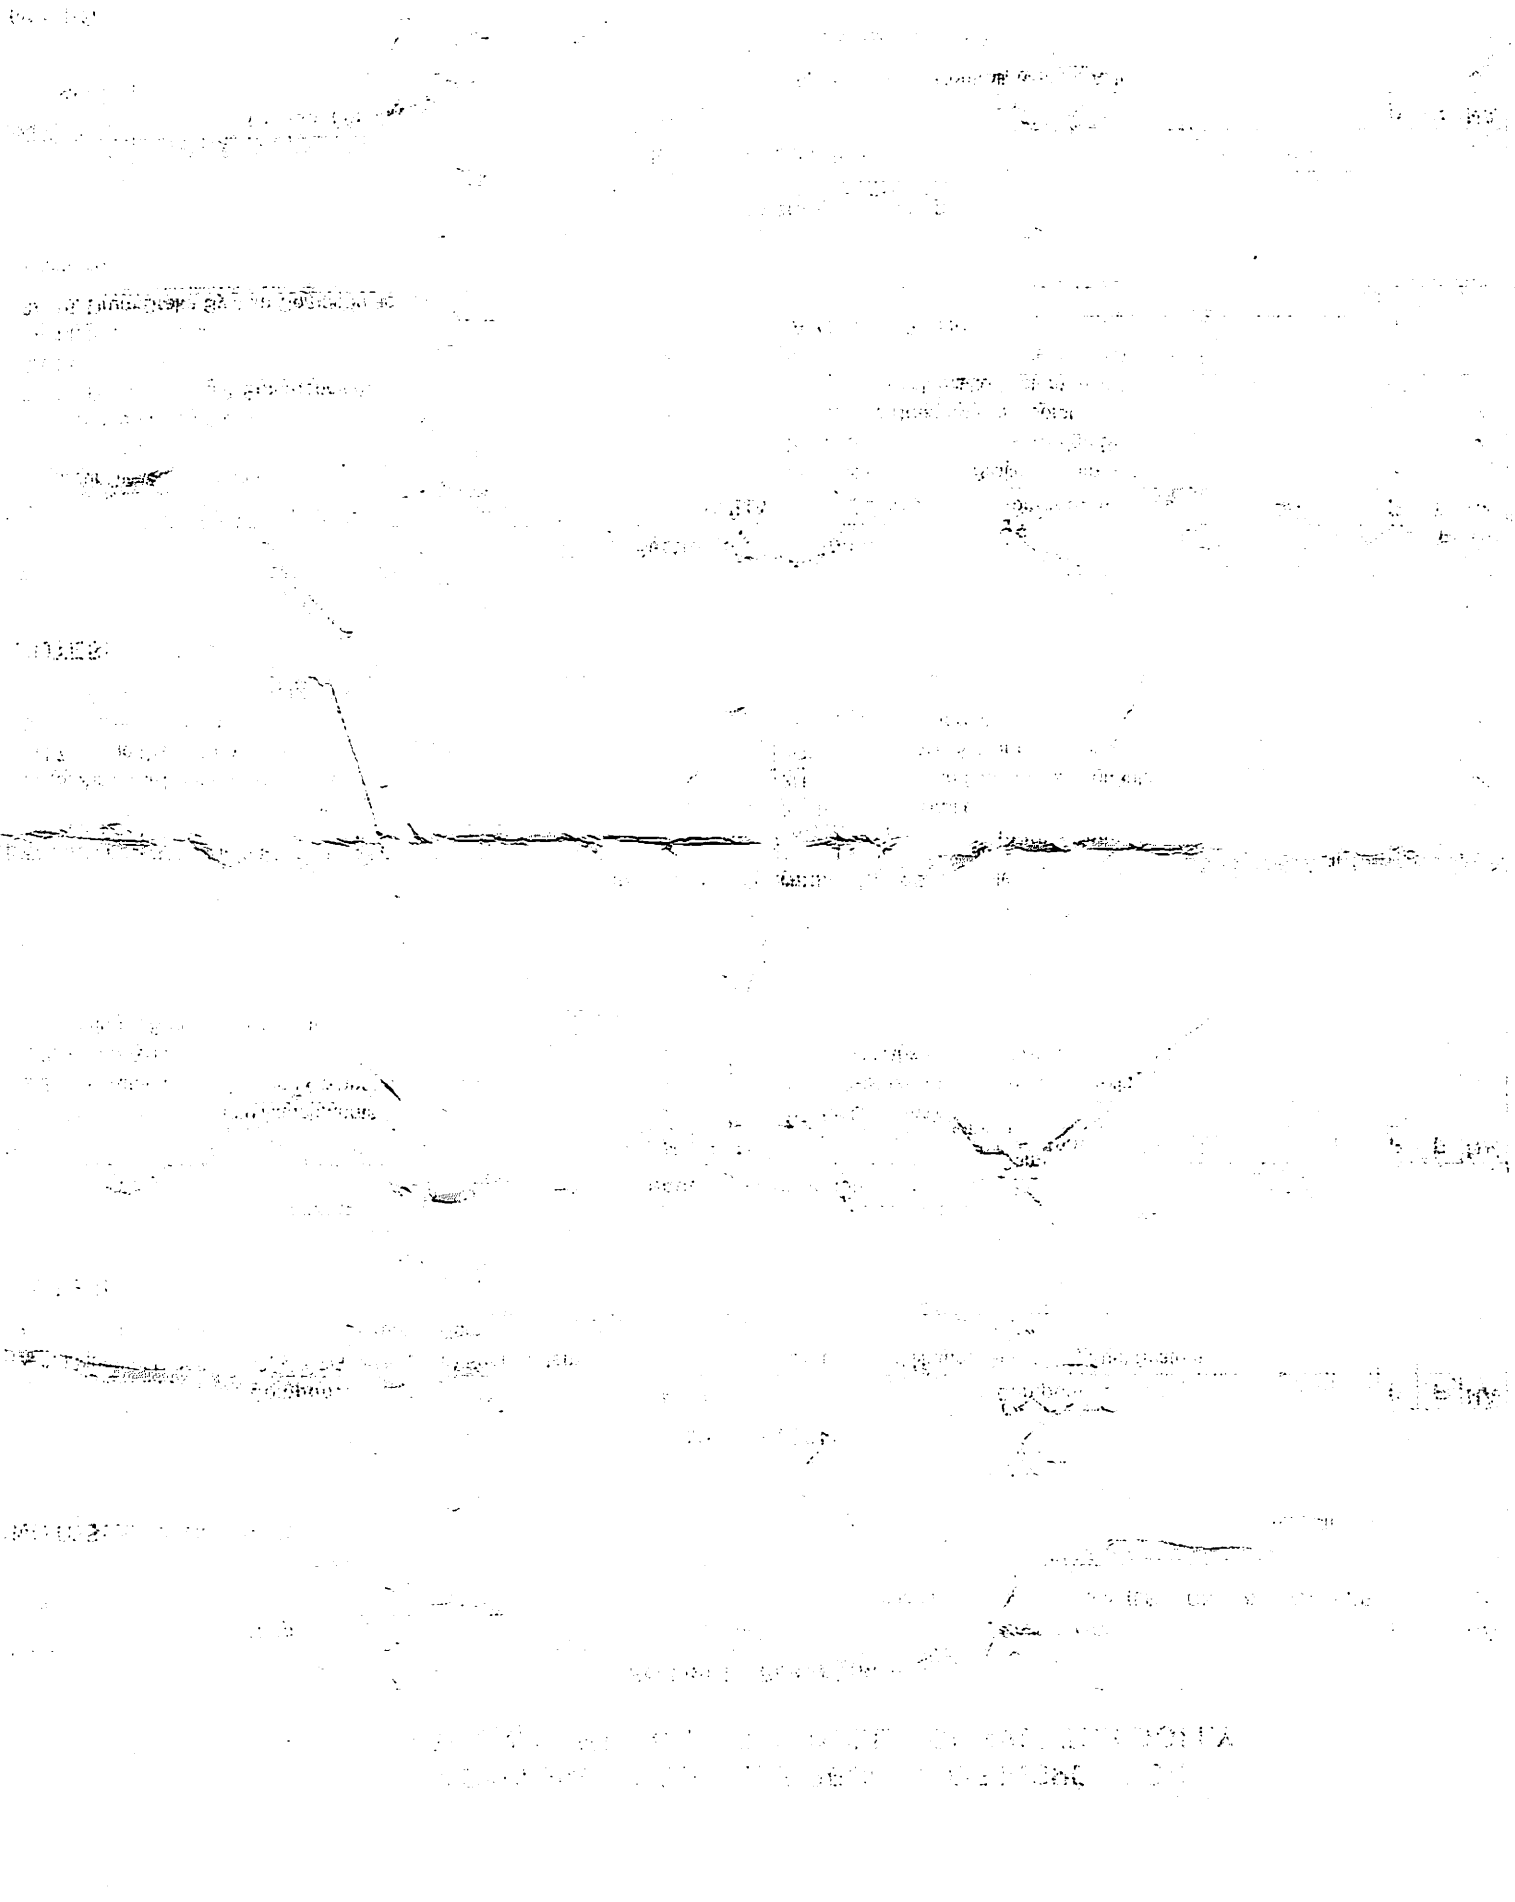

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

Section 5 - Instruments and Auxiliary Equipment

Component	P	F	NA	Component	P	F	NA
5.1. Fire Extinguisher			✓				

NOTES:

Section 6 - Lamps

Component	P	F	NA	Component	P	F	NA
6.1. Required Lamps	✓			6.3. Retro-Reflective Marking	✓		
6.2. Reflex Reflector			✓				

NOTES:

Section 7 - Electrical System

Component	P	F	NA	Component	P	F	NA
7.1. Wiring	✓			7.3. Trailer Cord (output to towed vehicle)	✓		
7.2. Battery			✓				

NOTES:

Section 8 - Body

Component	P	F	NA	Component	P	F	NA
8.5. Cargo Body			✓	8.11. Refrigeration/Heater Unit Fuel System			✓
8.6. Frame Rails & Mounts	✓			8.21. Fender/Mud Flap	✓		
8.7. Unitized Body Elements			✓	8.22. Landing Gear on Trailer	✓		
8.8. Cab or Cargo Door			✓	8.23. Sliding Axle Assembly (Sliding Bogie)			✓
8.9. Cargo Tank or Vessel			✓	8.24. Aerodynamic Device & Attachment			✓
8.10. Body, Device or Equipment Attached or Mounted to the Vehicle			✓	8.25. Rear Impact Guard (RIG)	✓		

NOTES:

Section 9 - Tires and Wheels

Component	P	F	NA	Component	P	F	NA
9.1. Tire Tread Depth	✓			9.7. Wheel/Rim	✓		
9.2. Tire Tread Condition	✓			9.8. Multi-Piece Wheel/Rim			✓
9.3. Tire Sidewall & Manufacturer Markings	✓			9.9. Spoke Wheel/Demountable Rim System			✓
9.4. Tire Inflation Pressure	✓			9.10. Disc Wheel System			✓
9.5. Wheel Hub	✓			9.11. Wheel Fasteners (Nuts, Bolts, & Studs)	✓		
9.6. Wheel Bearing	✓						

NOTES:

Section 10 - Couplers and Hitches

Component	P	F	NA	Component	P	F	NA
10.1. Hitch Assembly, Structure & Attaching Components			✓	10.6. Automated Coupling Device			✓
10.2. Secondary Attachment (Safety Chain or Cable)			✓	10.7. Fifth Wheel Coupler	✓		
10.3. Pintle Hook, Pin Hitch, or Coupler Hitch			✓	10.8. Oscillating Fifth Wheel Coupler			✓
10.4. Ball Type Hitch			✓	10.9. Ball-Bearing Type Turntable on Trailer			✓
10.5. Roll-Coupling Hitch			✓				

**COMMERCIAL VEHICLE RECORD OF INSPECTION
TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY**

NOTES:

Certification

The Vehicle for which this Record of Inspection is issued has **PASSED** (Certificate #8261396) the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

Date of Inspection 2026/02/11	Technician Number A1251	Facility Number 12860	Signature 
Customer Acknowledgment I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.			Date (Year/Month/Day) 2026/02/11 Customer Signature 

