



**Commercial Vehicle Inspection Certificate
Traffic Safety Act**

**PART 1 - VEHICLE OWNER AND VEHICLE
IDENTIFICATION**

Vehicle Type:	Truck	Seating Capacity:	
GVW:	32000 kg	Brake Type:	Air
Owner Name:	LANDVAC SERVICES LTD.		
Address:	4737 - 44 STREET		
City:	DRAYTON VALLEY	Province:	AB
Postal Code:	T7A 1H2		
Telephone Number:	(780) 514-0671		
Vehicle Identification Number:	3ALPGND10EDGA1436		
Make:	Freightliner	Model:	Conventional
Year:	2014	Unit Number:	580
Odometer:	351991 KM	Licence Plate Number:	K56716
Province:	AB		

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Western Star Trucks (North) Ltd.	10145
Inspection Technician Name:	Technician Number:
Vicky Melanson	C8109
Inspection Technician Signature:	
Inspection Date:	2026/02/27

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle										Gross Vehicle Weight registered											
Truck										32000 kg											
Vehicle Information																					
VIN	3	A	L	P	G	N	D	1	0	E	D	G	A	1	4	3	6				
Unit Number				Year				Make				Model				Odometer					
580				2014				Freightliner				Conventional				351,991					
Registered Owner's Name																Plate Number					
LANDVAC SERVICES LTD.																K56716					
Address												Postal Code				Phone Number					
4737 - 44 STREET												T7A 1H2				(780) 514-0671					

Drum Brakes:

Disc Brakes: D-Full Inspection Wheel Removed

		<u>LEFT</u>		<u>FRONT</u>		<u>RIGHT</u>			
105 psi 21/32 in		15.513 in	in	Drums/Rotors	16.521 in	in	105 psi 21/32 in		
		13/16 in	in	Linings/Pads	13/16 in	in			
		1 1/4 in	in	Push Rod Travel	1 1/4 in	in			
100 psi 16/32 in	100 psi 15/32 in	16.56 in	in	Drums/Rotors	16.58 in	in	100 psi 16/32 in	100 psi 16/32 in	
		3/4 in	in	Linings/Pads	3/4 in	in			
		1 1/4 in	in	Push Rod Travel	1 1/4 in	in			
100 psi 22/32 in	100 psi 22/32 in	16.59 in	in	Drums/Rotors	16.59 in	in	100 psi 19/32 in	100 psi 22/32 in	
		3/4 in	in	Linings/Pads	5/8 in	in			
		1 1/4 in	in	Push Rod Travel	1 1/4 in	in			
100 psi 17/32 in	100 psi 16/32 in	16.585 in	in	Drums/Rotors	16.600 in	in	100 psi 18/32 in	100 psi 19/32 in	
		3/4 in	in	Linings/Pads	3/4 in	in			
		1 1/4 in	in	Push Rod Travel	1 1/4 in	in			
__ psi __ in	__ psi __ in	__ in	in	Drums/Rotors	__ in	in	__ psi __ in	__ psi __ in	
		__ in	in	Linings/Pads	__ in	in			
		__ in	in	Push Rod Travel	__ in	in			
__ psi __ in	__ psi __ in	__ in	in	Drums/Rotors	__ in	in	__ psi __ in	__ psi __ in	
		__ in	in	Linings/Pads	__ in	in			
		__ in	in	Push Rod Travel	__ in	in			

Park Brake Lining Left N/A in Right N/A in Trans N/A in

Wheel Torque Checked ☒ Inner N/A ft lbs Outer 500 ft lbs

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 1 - Power Train

Component	P	F	NA	Component	P	F	NA
1.1. Accelerator Pedal/Throttle Actuator	✓			1.8. Engine Start Safety Feature	✓		
1.2. Exhaust System	✓			1.9. Gear Position Indicator	✓		
1.3. Emission Control Systems and Devices	✓			1.10. Engine or Accessory Drive Belt	✓		
1.4. Drive Shaft	✓			1.11. Hybrid Electric Vehicle & Electric Vehicle Power Train System			✓
1.5. Clutch and Clutch Pedal	✓			1.12. Gasoline or Diesel Fuel System	✓		
1.6. Engine/Transmission Mount	✓			1.13. Pressurized or Liquefied Fuel System (LPG, CNG, & LNG) * SEE APPENDIX A*			✓
1.7. Engine/Shut Down	✓						

NOTES:

TRANSMISSION OUTPUT U-JOINT WORN - REPAIRED
CLAMP FOR Y-PIPE TO FRAME BRACKET LOOSE - REPAIRED
CLUTCH ADJUSTMENT REQUIRED - REPAIRED

APPENDIX "A"

Component	P	F	NA	Component	P	F	NA
A.1. Liquefied Petroleum Gas (LPG or Propane) Fuel System			✓	A.3. Liquefied Natural Gas (LNG) Fuel System			✓
A.2. Compressed Natural Gas (CNG) Fuel System			✓				

NOTES:

Section 2 - Suspension

Component	P	F	NA	Component	P	F	NA
2.1. Suspension & Frame Attachments	✓			2.5. Air Suspension	✓		
2.2. Axle Attaching & Tracking Components	✓			2.6. Self-Steer and Controlled-Steer Axle			✓
2.3. Axle & Axle Assembly	✓			2.7. Shock Absorber/Strut Assembly	✓		
2.4. Spring & Spring Attachment	✓						

NOTES:

Section 3H - Hydraulic Brakes

Component	P	F	NA	Component	P	F	NA
3H.1. Hydraulic System Components			✓	3H.13. Disc Brake System Components			✓
3H.2. Brake Pedal/Actuator			✓	3H.14. Mechanical Parking Brake			✓
3H.3. Vacuum Assist (Boost) System			✓	3H.15. Spring-Applied Air-Released Parking Brake			✓
3H.4. Hydraulic Assist (Boost) System			✓	3H.16. Spring-Applied Hydraulic-Released Parking Brake			✓
3H.5. Air Assist (Boost) System			✓	3H.17. Anti-Lock Brake System (ABS)			✓
3H.6. Air-Over-Hydraulic Brake System			✓	3H.18. Stability Control System			✓
3H.11. Brake System Indicator Lamps			✓	3H.19. Brake Performance			✓
3H.12. Drum Brake System Components			✓				

NOTES:

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.1. Air Compressor	✓			3A.13. Air System Components	✓		
3A.2. Air Supply System	✓			3A.14. Brake Chamber	✓		
3A.4. Air Tank	✓			3A.15. Drum Brake System Components	✓		
3A.5. Air Tank Check Valves	✓			3A.16. S-Cam Drum Brake System	✓		
3A.6. Brake Pedal/Actuator	✓			3A.17. Brake Shoe Travel (Wedge Brakes)			✓
3A.7. Treadle Valve and Trailer Hand Valve	✓			3A.18. Disc Brake System Components			✓
3A.8. Brake Valves & Controls	✓			3A.19. Anti-Lock Brake System (ABS)	✓		
3A.9. Proportioning, Inversion or Modulation Valve	✓			3A.21. Stability Control System	✓		

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.10. Towing Vehicle (Tractor) Protection System	✓			3A.23. Brake Performance	✓		
3A.11. Parking Brake & Emergency Application	✓						

NOTES:

A2 LHS BRAKE CHAMBER PARK BRAKE SPRING BROKEN AND NOT ENGAGING BRAKES - REPAIRED
A4 RHS DRUM AND SHOES CONTAMINATED - REPAIRED
A4 RHS S-CAM TUBE SEAL NOT HOLDING GREASE - REPAIRED
A3 RHS BRAKE LINING SEPARATING FROM BACKING PLATE - REPAIRED

Section 4 - Steering

Component	P	F	NA	Component	P	F	NA
4.1. Steering Control and Linkage	✓			4.4. Kingpin	✓		
4.2. Power Steering System (Hydraulic and Electric)	✓			4.5. Self-Steer and Controlled-Steer Axle			✓
4.3. Steering Operation (Active Steer Axle)	✓						

NOTES:

Section 5 - Instruments and Auxiliary Equipment

Component	P	F	NA	Component	P	F	NA
5.1. Fire Extinguisher	✓			5.8. Heater & Windshield Defroster	✓		
5.2. Hazard Warning Kit	✓			5.9. Fuel-Burning Auxiliary Heater			✓
5.3. Horn	✓			5.10. Chain/"Headache" Rack			✓
5.5. Speedometer	✓			5.11. Auxiliary Controls and Devices			✓
5.6. Odometer	✓			5.12. Auxiliary Drive Controls			✓
5.7. Windshield Wiper/Washer	✓						

NOTES:

Section 6 - Lamps

Component	P	F	NA	Component	P	F	NA
6.1. Required Lamps	✓			6.4. Instrument Panel Lamps	✓		
6.2. Reflex Reflector	✓			6.5. Headlamp Aim	✓		
6.3. Retro-Reflective Marking	✓						

NOTES:

FRONT WORK LIGHTS NOT WORKING - REPAIRED

Section 7 - Electrical System

Component	P	F	NA	Component	P	F	NA
7.1. Wiring	✓			7.3. Trailer Cord (output to towed vehicle)			✓
7.2. Battery	✓						

NOTES:

Section 8 - Body

Component	P	F	NA	Component	P	F	NA
8.1. Hood or Engine Enclosure	✓			8.12. Bumper	✓		
8.2. Tilt Cab			✓	8.13. Windshield	✓		
8.3. Air-Suspended Cab	✓			8.14. Side Windows	✓		
8.4. Cab and Passenger-Vehicle Body	✓			8.15. Rear Window	✓		
8.5. Cargo Body	✓			8.16. Interior Sun Visor	✓		
8.6. Frame, Rails & Mounts	✓			8.17. Exterior Windshield Sun Visor	✓		
8.7. Unitized Body Elements	✓			8.18. Rear-View Mirror	✓		

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 8 - Body						
Component	P	F	NA	Component	P	F NA
8.8. Cab or Cargo Door	✓			8.19. Seat	✓	
8.9. Cargo Tank or Vessel	✓			8.20. Seat Belt/Occupant Restraint	✓	
8.10. Body, Device or Equipment Attached or Mounted to the Vehicle	✓			8.21. Fender/Mud Flap	✓	
8.11. Refrigeration/Heater Unit Fuel System (Reefer or Auxiliary Power Unit (APU))			✓	8.24. Aerodynamic Device & Attachment		✓

NOTES:

Section 9 - Tires and Wheels						
Component	P	F	NA	Component	P	F NA
9.1. Tire Tread Depth	✓			9.7. Wheel/Rim (Applies to all wheel types)	✓	
9.2. Tire Tread Condition	✓			9.8. Multi-Piece Wheel/Rim		✓
9.3. Tire Sidewall & Manufacturer Markings	✓			9.9. Spoke Wheel/Demountable Rim System		✓
9.4. Tire Inflation Pressure	✓			9.10. Disc Wheel System	✓	
9.5. Wheel Hub	✓			9.11. Wheel Fasteners (Nuts, Bolts and Studs)	✓	
9.6. Wheel Bearing	✓					

NOTES:

A1 LHS AND RHS HUB CAPS LEAKING - REPAIRED

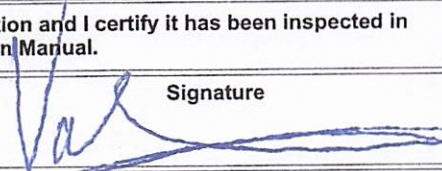
A2 LHS WHEEL SEAL LEAKING - REPAIRED

Section 10 - Couplers and Hitches						
Component	P	F	NA	Component	P	F NA
10.1. Hitch Assembly, Structure & Attaching Components			✓	10.5. Roll-Coupling Hitch		✓
10.2. Secondary Attachment (Safety Chain or Cable)			✓	10.6. Automated Coupling Device		✓
10.3. Pintle Hook, Pin Hitch, or Coupler Hitch			✓	10.7. Fifth Wheel Coupler		✓
10.4. Ball Type Hitch			✓	10.8. Oscillating Fifth Wheel Coupler		✓

NOTES:

Certification

The Vehicle for which this Record of Inspection is issued has **PASSED** (Certificate #8401262) the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

Date of Inspection	Technician Number	Facility Number	Signature
2026/02/27	C8109	10145	

Customer Acknowledgment

I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.

Date (Year/Month/Day)

2026/02/27

Customer Signature