

BRITISH
COLUMBIACommercial Vehicle
Inspection ReportDecal Number: GL11969
Decal Expiry Date: 2026-Jun-30
Inspection Number: 21604550Inspection Result:
PASS

A12-2

FACILITY:	Walkers Repair Centre / S20307	INSP. TYPE:	Complete	INSP. START:	2025-Dec-02 04:46 PM MST
INSPECTOR:	SCHAGER, ALBIN CARL / 106733	INSP. CLASS:	Class 2 - Heavy Vehicle with LGVW 5501 kg or more	INSP. COMPLETE:	2025-Dec-16 12:46 PM MST
WORK ORDER #:		INSP. REASON:	Semi-annual		
VEHICLE JUR:	British Columbia	REGI:	13338646	VIN:	1NPTL40X68D749617
PLATE #:	SY9530	UNIT/FLEET#:	130	OWNER/LESSEE NAME:	Columere Park , Developments LTD
LICENCED GVW(kg):	58000	BODY STYLE:	Dump Truck	ADDRESS:	4645 Beach Road
VEHICLE YEAR:	2008	ODOMETER:	793476 KM		Fairmont Hot Springs, British Columbia
MAKE:	PETERBILT	HUB ODOMETER:			V0B1L2, Canada
MODEL:		BRAKE TYPE:	Air		
		FUEL TYPE:			

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Passed
Section 2 - Suspension	Repaired (same day) Repair loose torsion bar
Section 3 - Brake System	Repaired (same day) 5 new brake pots and 6 slack adjusters, and various hoses
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Repaired (same day) New steering box
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Passed

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles	Type	Size	Slack Adj.	Left	Right	Tire Tread Depth (mm)				Steering
						Outer L	Inner L	Inner R	Outer R	
1	Clamp	24	Automatic	30	29	8			13	✓
2	Clamp	30	Automatic	36	34	21	21	11	16	
3	Clamp	30	Automatic	37	35	19	19	18	18	

Comment:

Comment:

Air Brake Camshaft Rotation (degrees)

Axles	Left	Right	Brake Lining/Pad (mm)		Rotor Thickness or Drum Inside Diameter (mm)			
			Lining/Pad		Left	Right	Rotor/Drum	Left
1	45	45	Lining (Shoe)		18	18	Drum	
2	45	45	Lining (Shoe)		18	18	Drum	
3	45	45	Lining (Shoe)		18	18	Drum	

Comment:

Comment:

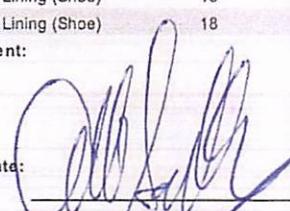

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

Inspection Comments:

Has this Vehicle been road tested? No

Road Test Date:

Inspector: SCHAGER, ALBIN CARL

Signature: Road Tester: 

This Inspection Report was submitted to CVSE on 2025-Dec-16 01:49 PM MST

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 26 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSCVIP at the Commercial Vehicle Safety Enforcement

CVSEB014

12/16/2025 1:49:48 PM MST