



BRITISH
COLUMBIA

Commercial Vehicle Inspection Report

Decal Number: GP56279
Decal Expiry Date: 2027-Oct-31
Inspection Number: 21966112

Inspection Result:
PASS

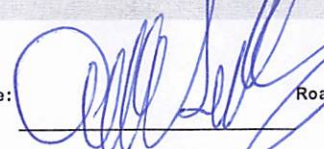
FACILITY:	Walkers Repair Centre / S20307	INSP. TYPE:	Complete	INSP. START:	2026-Oct-22 03:47 PM MDT
INSPECTOR:	SCHAGER, ALBIN CARL / 106733	INSP. CLASS:	Class 2 - Heavy Vehicle with LGVW 5501 kg or more	INSP. COMPLETE:	2026-Oct-24 11:47 AM MDT
WORK ORDER #:		INSP. REASON:	Annual	202-12	

VEHICLE JUR:	British Columbia	REGI:	10431237	VIN:	1FVDCXBS4CHBR6599
PLATE #:	VK0198	UNIT/FLEET#:	101	OWNER/LESSEE NAME:	Contracting LTD, CS McLean
LICENCED GVW(kg):	14968	BODY STYLE:	Utility Truck	ADDRESS:	PO Box 176, 4819 Crescentwood DR
VEHICLE YEAR:	2012	ODOMETER:	196078 KM		Edgewater, British Columbia
MAKE:	FREIGHTLIN	HUB ODOMETER:			V0A1E0, Canada
MODEL:		BRAKE TYPE:	Air		
		FUEL TYPE:			

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Repaired (same day) Replace front axle U joints
Section 2 - Suspension	Passed
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Passed
Section 5 - Instruments and Auxillary Equipment	Passed
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Repaired (same day) Repair cab leveling valve
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Not Applicable
Section 11 - Other Vehicle Components	Passed

Air Brake Chamber Type, Size and Push Rod Stroke (mm)						Tire Tread Depth (mm)				
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	24	Automatic	30	32	12			16	✓
2	Clamp	30	Automatic	34	35	12	12	16	18	
Comment:						Comment:				

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	60	60	Lining (Shoe)	15	15	Drum		
2	50	50	Lining (Shoe)	17	17	Drum		
Comment:			Comment:			Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.		

Inspection Comments:
Has this Vehicle been road tested? No
Inspector: SCHAGER, ALBIN CARL
Road Test Date: 
Signature: _____ Road Tester:

This Inspection Report was submitted to CVSE on 2026-Oct-24 11:49 AM MDT
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.