



Commercial Vehicle Inspection Report

Decal Number: GN59680
Decal Expiry Date: 2027-Jan-31
Inspection Number: 21850321

Inspection Result:

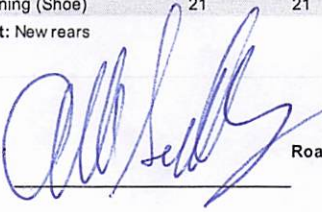
PASS

FACILITY:	Walkers Repair Centre / S20307	INSP. TYPE:	Complete	INSP. START:	2026-Jul-16 02:51 PM MDT
INSPECTOR:	SCHAGER, ALBIN CARL / 106733	INSP. CLASS:	Class 2 - Heavy Vehicle with LGVW 5501 kg or more	INSP. COMPLETE:	2026-Jul-22 12:51 PM MDT
WORK ORDER #:		INSP. REASON:	Semi-annual		
VEHICLE JUR:	British Columbia	REGI:	13934366	VIN:	1XKYDP9X2NJ992499
PLATE #:	79149P	UNIT/FLEET#:	305	OWNER/LESSEE NAME:	Columbia, Valley Freight LTD
LICENCED GVW(kg):	46500	BODY STYLE:	Truck Tractor	ADDRESS:	226 Westridge DR Invermere, British Columbia
VEHICLE YEAR:	2022	ODOMETER:	723261 KM		V0A1K4, Canada
MAKE:	KENWORTH	HUB ODOMETER:			
MODEL:		BRAKE TYPE:	Air		
		FUEL TYPE:			

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Repaired (same day) Reseal #2 diff
Section 2 - Suspension	Repaired (same day) 6 new shocks, New air bags #2left, #3 right, new leveling valve
Section 3 - Brake System	Repaired (same day) 4 new brakes and drums
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Passed
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Repaired (same day) License plate light, new right rear taillight, signal
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Repaired (same day) New windshield
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Passed

Air Brake Chamber Type, Size and Push Rod Stroke (mm)						Tire Tread Depth (mm)				
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	24	Automatic	33	34	9			9	✓
2	Clamp	30L	Automatic	36	39	10	9	11	8	
3	Clamp	30L	Automatic	37	38	8	9	8	8	
Comment:						Comment:				

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	45	45	Lining (Shoe)	18	18	Drum	0.00	0.00
2	30	30	Lining (Shoe)	21	21	Drum	419.00	419.00
3	30	30	Lining (Shoe)	21	21	Drum	419.00	419.00
Comment:			Comment: New rears			Comment: New rears		

Inspection Comments:
Has this Vehicle been road tested? No
Inspector: SCHAGER, ALBIN CARL
Road Test Date: 
Signature: _____ Road Tester:

This Inspection Report was submitted to CVSE on 2026-Jul-22 12:53 PM MDT
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSCVP at the Commercial Vehicle Safety Enforcement

CVSE0014

7/22/2026 12:53:21 PM MDT