

Commercial Vehicle Inspection Report

Decal Number: **GN05536**
 Decal Expiry Date: **2027-Apr-30**
 Inspection Number: **21956587**

Inspection Result:

PASS

FACILITY: IRON HORSE DIESEL AND AUTO REPAIR LIMITED / S20484
INSPECTOR: RODGERSON, CHRISTOPHER / 301384
WORK ORDER #:

INSP. TYPE: Complete
INSP. CLASS: Class 2 - Heavy Vehicle with LGVW 5501 kg or more
INSP. REASON: Semi-annual

INSP. START: 2026-Oct-15 08:00 AM PDT
INSP. COMPLETE: 2026-Oct-16 10:55 AM PDT

VEHICLE JUR: British Columbia
PLATE #: VP1602
PERMITTED GVW(kg): 46500

REGI: 03317232
UNIT/FLEET#: 921
BODY STYLE: Truck Tractor

VIN: 1NKWL40X26R987435
OWNER/LESSEE NAME: Macgregor, Neil
ADDRESS: Box 731 Grand Forks, Box 731 Grand Forks
 Grand Forks, British Columbia
 V0H 1H0, Canada

VEHICLE YEAR: 2006
MAKE: KENWORTH
MODEL:

ODOMETER: 141709 KM
HUB ODOMETER:
BRAKE TYPE: Air
FUEL TYPE:

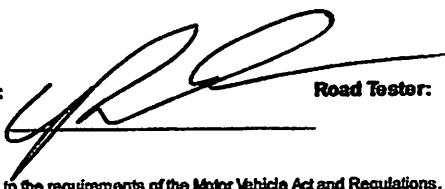
Vehicle Identification (VIN)	Passed	
Section 1 - Power Train	Repaired (same day)	Tighten up the yoke at the steady bearing, Repair loose exhaust stack on the left
Section 2 - Suspension	Passed	
Section 3 - Brake System	Repaired (same day)	Replace the brake shoes and wheel seal on #2 RHS
Section 3A - Air Brakes	Passed	
Section 3H - Hydraulic Brakes	Not Applicable	
Section 4 - Steering	Passed	
Section 5 - Instruments and Auxiliary Equipment	Passed	
Section 6 - Lamps	Repaired (same day)	Replaced the licence plate light, Both low beam headlights, Mirror lamps and mirror mounted backup lights
Section 7 - Electrical System	Repaired (same day)	Replace the battery hold down bracket
Section 8 - Frame and Body	Passed	
Section 9A - Tires	Passed	
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Passed	
Section 11 - Other Vehicle Components	Passed	

Air Brake Chamber Type, Size and Push Rod Stroke (mm)				Tire Tread Depth (mm)						
Axles	Type	Size	Stack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	24	Automatic	28	28	10			11	✓
2	Clamp	30	Automatic	36	36	11	9	8	9	
3	Clamp	30	Automatic	36	36	18	17	18	18	
Comment:				Comment:						

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)		Rotor Thickness or Drum Inside Diameter (mm)				
Axles	Left	Right	Lining/Pad		Left	Right	Rotor/Drum	Left	Right
1	65	50	Lining (Shoe)		17	17	Drum		
2	87	23	Lining (Shoe)		13	22	Drum		
3	62	65	Lining (Shoe)		11	11	Drum		
Comment:			Comment:		Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.				

Inspection Comments:

Has this Vehicle been road tested? **No** Road Test Date: **2026-Oct-16 12:10 PM PDT** Road Tester: **RODGERSON, CHRISTOPHER**

Inspector: RODGERSON, CHRISTOPHER **Signature:** 

This Inspection Report was submitted to CVSE on 2026-Oct-16 12:10 PM PDT
 The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.