



Commercial Vehicle Inspection Report

Decal Number: GN05538
Decal Expiry Date: 2027-Apr-30
Inspection Number: 21958766

1035-2 Inspection Result:
PASS

FACILITY: IRON HORSE DIESEL AND AUTO REPAIR LIMITED / S20484
INSPECTOR: RODGERSON, CHRISTOPHER / 301384
WORK ORDER #:

INSP. TYPE: Complete
INSP. CLASS: Class 2 - Heavy Vehicle with LGVW 5501 kg or more
INSP. REASON: Semi-annual

INSP. START: 2026-Oct-19 07:00 AM PDT
INSP. COMPLETE: 2026-Oct-19 11:02 AM PDT

VEHICLE JUR: British Columbia
PLATE #:
LICENCED GVW(kg): 57100

VEHICLE YEAR: 2006
MAKE: KENWORTH
MODEL:

REGI: 13694566
UNIT/FLEET#: 57
BODY STYLE: Dump Truck

VIN: 1NKDXBEX06R985828
OWNER/LESSEE NAME: Macgregor, Niel
ADDRESS: Box 731 Grand Forks, Box 731 Grand Forks
Grand Forks, British Columbia
V0H 1H0, Canada

ODOMETER: 40077 KM
HUB ODOMETER:
BRAKE TYPE: Air
FUEL TYPE:

Vehicle Identification (VIN)	Passed	
Section 1 - Power Train	Repaired (same day)	Repair PTO leak
Section 2 - Suspension	Passed	
Section 3 - Brake System	Repaired (same day)	Replace the #3 & #4 LHS Brake shoes and drums Replace the #3 & #4 ABS sensors
Section 3A - Air Brakes	Passed	
Section 3H - Hydraulic Brakes	Not Applicable	
Section 4 - Steering	Passed	
Section 5 - Instruments and Auxillary Equipment	Passed	
Section 6 - Lamps	Repaired (same day)	Repair LF Signal wiring Replace 9 Box Marker Lights
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Passed	
Section 9A - Tires	Passed	
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Passed	
Section 11 - Other Vehicle Components	Repaired (same day)	Repair the wiper motor transmission

Air Brake Chamber Type, Size and Push Rod Stroke (mm)					Tire Tread Depth (mm)					
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	24	Automatic	28	28	13			13	✓
2	Clamp	30	Automatic	36	36	14	13	16	18	
3	Clamp	30	Automatic	36	36	14	14	16	17	
4	Clamp	30	Automatic	36	36	16	16	17	16	
Comment:					Comment:					



Commercial Vehicle Inspection Report

Decal Number: GN05538
Decal Expiry Date: 2027-Apr-30
Inspection Number: 21958766

Inspection Result:
PASS

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	50	78	Lining (Shoe)	15	11	Drum	421.13	421.13
2	107	70	Lining (Shoe)	10	13	Drum	421.01	421.26
3	20	100	Lining (Shoe)	21	12	Drum	419.10	421.13
4	20	110	Lining (Shoe)	21	11	Drum	419.10	355.60
Comment:			Comment:			Comment:		


Inspection Comments:

Has this Vehicle been road tested? No

Road Test Date:

Inspector: RODGERSON, CHRISTOPHER

Signature:

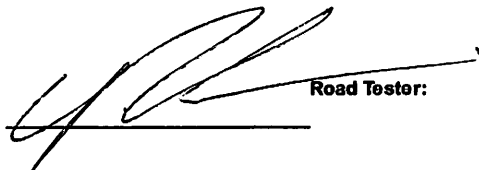

Road Tester:

This Inspection Report was submitted to CVSE on 2026-Oct-19 11:03 AMPDT
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.