



# Commercial Vehicle Inspection Report

Decal Number: GN05537  
Decal Expiry Date: 2027-Apr-30  
Inspection Number: 21956886

Inspection Result:  
**PASS**

1353

**FACILITY:** IRON HORSE DIESEL AND AUTO REPAIR LIMITED / S20484  
**INSPECTOR:** RODGERSON, CHRISTOPHER / 301384  
**WORK ORDER #:**

**INSP. TYPE:** Complete  
**INSP. CLASS:** Class 3 - Trailer and Semi-Trailer  
**INSP. REASON:** Semi-annual

**INSP. START:** 2026-Oct-16 12:00 PM PDT  
**INSP. COMPLETE:** 2026-Oct-16 02:10 PM PDT

**VEHICLE JUR:** British Columbia  
**PLATE #:**  
**PERMITTED GVW(kg): 0**

**REGI:** 13694486  
**UNIT/FLEET#:**  
**BODY STYLE:** Pup Trailer

**VIN:** 2S9NE369681020596  
**OWNER/LESSEE NAME:** Macgregor, Neil  
**ADDRESS:** Box 731 Grand Forks, Box 731 Grand Forks  
Grand Forks, British Columbia  
V0H 1H0, Canada

**VEHICLE YEAR:** 2008  
**MAKE:** RENN  
**MODEL:** TRIDE

**ODOMETER:**  
**HUB ODOMETER:**  
**BRAKE TYPE:** Air  
**FUEL TYPE:**

|                                                 |                                                                                                      |
|-------------------------------------------------|------------------------------------------------------------------------------------------------------|
| Vehicle Identification (VIN)                    | Passed                                                                                               |
| Section 1 - Power Train                         | Not Applicable                                                                                       |
| Section 2 - Suspension                          | Passed                                                                                               |
| Section 3 - Brake System                        | Repaired (same day) Replaced the brake shoes on axle#3 LHS, Replaced both ABS sensors on the #1 axle |
| Section 3A - Air Brakes                         | Passed                                                                                               |
| Section 3H - Hydraulic Brakes                   | Not Applicable                                                                                       |
| Section 4 - Steering                            | Not Applicable                                                                                       |
| Section 5 - Instruments and Auxiliary Equipment | Passed                                                                                               |
| Section 6 - Lamps                               | Passed                                                                                               |
| Section 7 - Electrical System                   | Passed                                                                                               |
| Section 8 - Frame and Body                      | Repaired (same day) Replaced both safety chains                                                      |
| Section 9A - Tires                              | Passed                                                                                               |
| Section 9B - Wheels                             | Passed                                                                                               |
| Section 10 - Coupling Devices                   | Passed                                                                                               |
| Section 11 - Other Vehicle Components           | Passed                                                                                               |

| Air Brake Chamber Type, Size and Push Rod Stroke (mm) |       |      |            |      |       | Tire Tread Depth (mm) |         |         |         |          |
|-------------------------------------------------------|-------|------|------------|------|-------|-----------------------|---------|---------|---------|----------|
| Axles                                                 | Type  | Size | Slack Adj. | Left | Right | Outer L               | Inner L | Inner R | Outer R | Steering |
| 1                                                     | Clamp | 30   | Automatic  | 36   | 36    | 6                     | 6       | 5       | 8       |          |
| 2                                                     | Clamp | 30   | Automatic  | 36   | 36    | 12                    | 12      | 12      | 12      |          |
| 3                                                     | Clamp | 30   | Automatic  | 36   | 36    | 10                    | 6       | 8       | 6       |          |

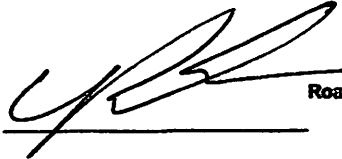
Comment:

| Air Brake Camshaft Rotation (degrees) |      |       | Brake Lining/Pad (mm) |      | Rotor Thickness or Drum Inside Diameter (mm) |            |      |       |
|---------------------------------------|------|-------|-----------------------|------|----------------------------------------------|------------|------|-------|
| Axles                                 | Left | Right | Lining/Pad            | Left | Right                                        | Rotor/Drum | Left | Right |
| 1                                     | 45   | 40    | Lining (Shoe)         | 18   | 18                                           | Drum       |      |       |
| 2                                     | 40   | 48    | Lining (Shoe)         | 16   | 16                                           | Drum       |      |       |
| 3                                     | 43   | 60    | Lining (Shoe)         | 20   | 13                                           | Drum       |      |       |

Comment:

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

**Inspection Comments:**

Has this Vehicle been road tested? No  
**Inspector:** RODGERSON, CHRISTOPHER  
**Road Test Date:**  
**Signature:**   
**Road Tester:**

This Inspection Report was submitted to CVSE on 2026-Oct-16 02:11 PM PDT  
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.