



Commercial Vehicle Inspection Report

Decal Number: GM07262
Decal Expiry Date: 2026-May-31
Inspection Number: 21577390

LOT 68
Inspection Result:
PASS

Facility: ARSARA DIESEL TRUCK / S5708	Insp. Type: Complete	Insp. Start: 2025-Nov-20 06:16 PM PST
Inspector: Bhachu, Sukhjinder Singh / 201670	Insp. Class: Class 2 - Heavy Vehicle with LGVW 5501 kg or more	Insp. Complete: 2025-Nov-22 11:38 AM PST
Work Order #:	Insp. Reason: Semi-annual	
Vehicle Jurisdiction: British Columbia	Reg. No.: 01847760	VIN: 1FUYSSSEBXYLG35249
Plate #: KD5244	Unit/Fleet #: Truck Tractor	Owner/Lessee Name: TAKHAR BALRAJ SINGH, .
Licenced GVW(kg): 46000	Body Style: Truck Tractor	Address: 11028 146 ST, 11028 146 ST
Vehicle Year: 2000	Odometer: 247346 KM	Surrey, British Columbia
Make: FREIGHTLIN	Hub Odometer:	V3R 3V1, Canada
Model:	Brake Type: Air	Fuel Type:

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Repaired (same day) 2XL INPUT U JOINT PLAY
Section 2 - Suspension	Passed
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Repaired (same day) 1XL L/S BRAKE, 2XL L/S MAXI LINES TIE UP
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Passed
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Repaired (same day) CAB TOP MARKER LIGHT
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Passed
Section 9B - Wheels	Repaired (same day) 1XL R/S SEAL
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Not Applicable

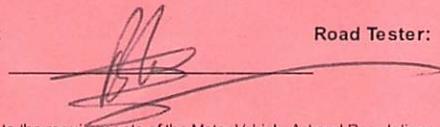
Axles	Type	Size	Slack Adj.	Tire Tread Depth (mm)							
				Left	Right	Outer L	Inner L	Inner R	Outer R	Steering	
1	Clamp	24	Automatic	25	25	12			14		✓
2	Clamp	30L	Automatic	30	35	8	8	8	8		
3	Clamp	30L	Automatic	35	30	12	12	12	12		

Comment: Comment:

Axles	Air Brake Camshaft Rotation (degrees)		Brake Lining/Pad (mm)		Rotor Thickness or Drum Inside Diameter (mm)			
	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	65	35	Lining (Shoe)	15	17	Drum		
2	70	35	Lining (Shoe)	14	17	Drum		
3	65	65	Lining (Shoe)	15	15	Drum		

Comment: Comment: Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

Inspection Comments:

Has this Vehicle been road tested? No Road Test Date: 
Inspector: Bhachu, Sukhjinder Singh Signature: Road Tester:

This Inspection Report was submitted to CVSE on 2025-Nov-22 11:39 AM PST
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/VIP at the Commercial Vehicle Safety Enforcement

CVSE0014

1/22/2025 11:39:24 AM PST