



Commercial Vehicle Inspection Report

Decal Number: FS80960
Decal Expiry Date: 2022-Dec-31
Inspection Number: 20154616

Inspection Result:
PASS

Facility: OKEOVER SERVICES LTD / S10390
Inspector: Depape, Gene Raymond / 200023
Work Order Number: 2022-0960

Inspection Type: Complete
Inspection Class: Class 2 - Heavy Vehicle with LGW 5501 kg or more
Inspection Reason: Semi-annual

Inspection Start Date/Time: 2022-Jun-23 06:00 AM
Inspection Complete Date/Time: 2022-Jun-23 08:30 AM

Vehicle Jurisdiction: British Columbia
Registration Number: 03330304
VIN: 4V2SCBME5NR511804
Plate Number: RP4452
Licenced GVW (kg): 26100
Vehicle Year: 1992
Make: GMC

Brake Type: Air
Fuel Type: Diesel
Odometer: 256022 KM
Hub Odometer:
Body Style: Cement Mixer
Model:
Unit/Fleet Number: M11

Owner/Lessee Name: ADAMS CONCRETE LTD, ADAMS
Address: 7095 DUNCAN AVE
City: Powell River
Province/State: British Columbia
Postal Code/ZIP: V8A0G2
Country: Canada

Vehicle Identification (VIN)	Result	Comment
Section 1 - Power Train	Passed	
Section 2 - Suspension	Passed	
Section 3 - Brake System	Passed	
Section 3A - Air Brakes	Repaired (same day)	REPLACED #3 RELAY VALVE
Section 3H - Hydraulic Brakes	Not Applicable	
Section 4 - Steering	Passed	
Section 5 - Instruments and Auxiliary Equipment	Passed with Caution	TACH NOT ACCURATE
Section 6 - Lamps	Passed	REPAIRED TOP I.D. LIGHTS
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Passed	
Section 9A - Tires	Passed	
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Not Applicable	
Section 11 - Other Vehicle Components	Passed	

Air Brake Chamber Type, Size and Push Rod Stroke Measurements (mm)

Axles (front)	Type	Size	Slack Adj.	Left	Right
1	Clamp	24	Automatic	32	41
2	Clamp	30	Automatic	36	44
3	Clamp	30	Automatic	37	35

Comment:

Tire Tread Depth (mm)

Axles (front)	Outer Left	Inner Left	Inner Right	Outer Right	Steering Axle?
1	17			17	✓
2	21	20	19	19	
3	20	21	21	18	

Comment:

Air Brake Camshaft Rotation Measurement (degrees)

Axles (front)	Left (degrees)	Right (degrees)
1	70	85
2	35	35
3	70	75

Comment:

Brake Lining/Pad Measurement (mm)

Axles (front)	Lining/Pad	Left	Right
1	Lining (Shoe)	14	13
2	Lining (Shoe)	16	16
3	Lining (Shoe)	12	11

Comment:

Rotor Thickness or Drum Inside Diameter Measurement (mm)

Axles (front)	Rotor/Drum	Left	Right
1	Drum	0.00	0.00
2	Drum	0.00	0.00
3	Drum	0.00	0.00

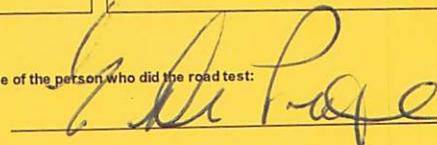
Comment: DID NOT REMOVE DRUMS

Inspection Comments:

Has this Vehicle been road tested? No When?

Name of the person who did the road test:

Inspector Name: Depape, Gene Raymond

Signature: 

This Inspection Report was submitted to CVSE on 2022-Jun-23 10:14 AM

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/MP at the Commercial Vehicle Safety Enforcement.

CVSE0014

6/23/2022 10:14:59 AM