

J08-1



# Commercial Vehicle Inspection Report

Decal Number: GK76331  
Decal Expiry Date: 2026-Mar-31  
Inspection Number: 21494302

Inspection Result:  
**PASS**

<b>FACILITY:</b> Inland Truck & Equipment Ltd / S20211	<b>INSP. TYPE:</b> Complete	<b>INSP. START:</b> 2025-Sep-11 08:47 AM MDT
<b>INSPECTOR:</b> JANZEN, EVAN CHAD / 200684	<b>INSP. CLASS:</b> Class 2 - Heavy Vehicle with LGVW 5501 kg or more	<b>INSP. COMPLETE:</b> 2025-Sep-12 08:47 AM MDT
<b>WORK ORDER #:</b> RO 21641CBS	<b>INSP. REASON:</b> Semi-annual	

<b>VEHICLE JUR:</b> British Columbia	<b>REGI:</b> 02142756	<b>VIN:</b> 1NKDL09X48R937691
<b>PLATE #:</b> MJ2431	<b>UNIT/FLEET#:</b>	<b>OWNER/LESSEE NAME:</b> CASTLE FUELS (2008) INC., CASTLE FUELS
<b>LICENCED GVW(kg):</b> 60100	<b>BODY STYLE:</b> Tank	<b>ADDRESS:</b> 300 150 VICTORIA STREET
<b>VEHICLE YEAR:</b> 2008	<b>ODOMETER:</b> 707983 KM	Kamloops, British Columbia
<b>MAKE:</b> KENWORTH	<b>HUB ODOMETER:</b>	V2C 1Z7, Canada
<b>MODEL:</b>	<b>BRAKE TYPE:</b> Air	
	<b>FUEL TYPE:</b>	

<b>Vehicle Identification (VIN)</b>	Passed
<b>Section 1 - Power Train</b>	Passed
<b>Section 2 - Suspension</b>	Passed
<b>Section 3 - Brake System</b>	Not Applicable
<b>Section 3A - Air Brakes</b>	Repaired (same day) AXLE 3 S-CAM R/S STICKING, REPAIRED.
<b>Section 3H - Hydraulic Brakes</b>	Not Applicable
<b>Section 4 - Steering</b>	Repaired (same day) LEAKING HUB CAPS REPAIRED.
<b>Section 5 - Instruments and Auxiliary Equipment</b>	Passed
<b>Section 6 - Lamps</b>	Repaired (same day) LIGHTS REPAIRED
<b>Section 7 - Electrical System</b>	Passed
<b>Section 8 - Frame and Body</b>	Repaired (same day) R/S STEP SECURED.
<b>Section 9A - Tires</b>	Passed
<b>Section 9B - Wheels</b>	Passed
<b>Section 10 - Coupling Devices</b>	Passed
<b>Section 11 - Other Vehicle Components</b>	Not Applicable

Air Brake Chamber Type, Size and Push Rod Stroke (mm)				Tire Tread Depth (mm)						
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	24	Automatic	25	25	18			18	✓
2	Clamp	30	Automatic	35	35	10	10	18	10	
3	Clamp	30	Automatic	35	35	18	18	19	19	

Comment:

Comment:

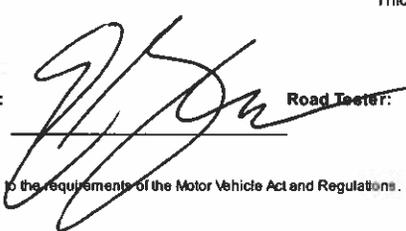
Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	30	30	Lining (Shoe)	19	19	Drum		
2	50	50	Lining (Shoe)	17	17	Drum		
3	60	60	Lining (Shoe)	15	15	Drum		

Comment:

Comment:

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

**Inspection Comments:**

Has this Vehicle been road tested? No      Road Test Date: \_\_\_\_\_      Road Tester: \_\_\_\_\_  
 Inspector: JANZEN, EVAN CHAD      Signature: 

This inspection Report was submitted to CVSE on 2025-Sep-12 08:48 AM MDT  
 The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.