

# Commercial Vehicle Inspection Report

 Decal Number: GH13287  
 Decal Expiry Date: 2026-Jan-31  
 Inspection Number: 21198086

Inspection Result:

## PASS

<b>FACILITY:</b>	BRIGHT QUALITY ENTERPRISES LTD / S15780	<b>INSP. TYPE:</b>	Complete	<b>INSP. START:</b>	2025-Jan-07 09:30 AM PST
<b>INSPECTOR:</b>	KAILA, JOBAN SINGH / 202325	<b>INSP. CLASS:</b>	Class 3 - Trailer and Semi-Trailer	<b>INSP. COMPLETE:</b>	2025-Jan-07 11:30 AM PST
<b>WORK ORDER #:</b>		<b>INSP. REASON:</b>	Annual		

<b>VEHICLE JUR:</b>	British Columbia	<b>REGI:</b>	12048838	<b>VIN:</b>	5V8VC5322FM503258
<b>PLATE #:</b>	09889L	<b>UNIT/FLEET#:</b>		<b>OWNER/LESSEE NAME:</b>	TWENTY FIVE EIGHT LOGISTICS, TWENTY FIVE EIGHT LOGISTICS
<b>PERMITTED GVW(kg):</b>	999999	<b>BODY STYLE:</b>	Van Trailer	<b>ADDRESS:</b>	PO BOX 98036 RPO SINSHINE VILLA Delta, British Columbia V4E3M9, Canada
<b>VEHICLE YEAR:</b>	2015	<b>ODOMETER:</b>			
<b>MAKE:</b>	VANGUARD	<b>HUB ODOMETER:</b>			
<b>MODEL:</b>		<b>BRAKE TYPE:</b>	Air		
		<b>FUEL TYPE:</b>			

<b>Vehicle Identification (VIN)</b>	Passed
<b>Section 1 - Power Train</b>	Not Applicable
<b>Section 2 - Suspension</b>	Passed
<b>Section 3 - Brake System</b>	Passed
<b>Section 3A - Air Brakes</b>	Passed
<b>Section 3H - Hydraulic Brakes</b>	Not Applicable
<b>Section 4 - Steering</b>	Not Applicable
<b>Section 5 - Instruments and Auxiliary Equipment</b>	Passed
<b>Section 6 - Lamps</b>	Passed
<b>Section 7 - Electrical System</b>	Passed
<b>Section 8 - Frame and Body</b>	Passed
<b>Section 9A - Tires</b>	Passed
<b>Section 9B - Wheels</b>	Passed
<b>Section 10 - Coupling Devices</b>	Passed
<b>Section 11 - Other Vehicle Components</b>	Not Applicable

Axles	Type	Size	Slack Adj.	Brake Chamber Type, Size and Push Rod Stroke (mm)		Tire Tread Depth (mm)				
				Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	30	Automatic	33	32	10	10	9	9	
2	Clamp	30	Automatic	35	34	11	11	10	10	

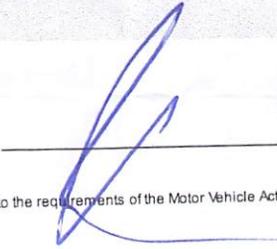
Comment: Comment:

Axles	Brake Camshaft Rotation (degrees)		Brake Lining/Pad (mm)		Rotor Thickness or Drum Inside Diameter (mm)			
	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	65	60	Lining (Shoe)	18	17	Drum		
2	65	65	Lining (Shoe)	17	17	Drum		

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

**Inspection Comments:**

Has this Vehicle been road tested?  No **Road Test Date:** \_\_\_\_\_ **Road Tester:** \_\_\_\_\_

**Inspector:** KAILA, JOBAN SINGH **Signature:** 

This Inspection Report was submitted to CVSE on 2025-Jan-07 06:01 PM PST  
 The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.