

Commercial Vehicle Inspection Report

Decal Number: GK11309
Decal Expiry Date: 2026-Jun-30
Inspection Number: 21387781

Inspection Result:

PASS

W03-2

FACILITY:	BOB LAWRENCE TRUCK & EQUIPMENT / S6131	INSP. TYPE:	Complete	INSP. START:	2025-Jun-11 10:01 AM PDT
INSPECTOR:	Badgley, James Scott / 108870	INSP. CLASS:	Class 3 - Trailer and Semi-Trailer	INSP. COMPLETE:	2025-Jun-12 08:44 AM PDT
WORK ORDER #:	33421	INSP. REASON:	Annual		

VEHICLE JUR:	Alberta	REGI:		VIN:	2M5921617G1158131
PLATE #:	5RE480	UNIT/FLEET#:	53H004	OWNER/LESSEE NAME:	OVERLAND WEST, FREIGHT LINES LTD.
LICENCED GVW(kg):	0	BODY STYLE:	Trailer	ADDRESS:	15811 112 AVE NW
VEHICLE YEAR:	2016	ODOMETER:			EDMONTON, Alberta
MAKE:	MANAC 53	HUB ODOMETER:			T5M2V9, Canada
MODEL:	DRY VAN	BRAKE TYPE:	Air		
		FUEL TYPE:	Not Applicable		

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Not Applicable
Section 2 - Suspension	Passed
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Repaired (same day)
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Not Applicable
Section 5 - Instruments and Auxiliary Equipment	Not Applicable
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Not Applicable

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles	Type	Size	Slack Adj.	Left	Right	Tire Tread Depth (mm)				Steering
						Outer L	Inner L	Inner R	Outer R	
1	Clamp	30	Automatic	32	32	8	7	7	8	
2	Clamp	30	Automatic	32	32	7	7	7	8	

Comment:

Comment:

Air Brake Camshaft Rotation (degrees)

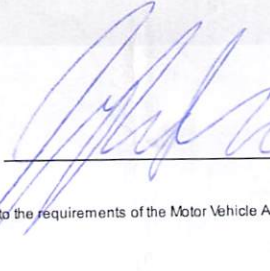
Axles	Left	Right	Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
			Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	58	40	Lining (Shoe)	16	18	Drum	420.17	420.07
2	55	56	Lining (Shoe)	16	16	Drum	420.22	420.27

Comment:

Comment:

Comment:

Inspection Comments:

Has this Vehicle been road tested? No
Inspector: Badgley, James Scott
Road Test Date:  Road Tester:

This Inspection Report was submitted to CVSE on 2025-Jun-12 08:45 AM PDT
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSQVP at the Commercial Vehicle Safety Enforcement

CVSE0014

6/12/2025 8:46:06 AM PDT