

Commercial Vehicle Inspection Report

Decal Number: GF01356
 Decal Expiry Date: 2025-Nov-30
 Inspection Number: 21157880

207-1
 Inspection Result:
PASS

Facility:	True North Forklifts Ltd / S20179	INSP. TYPE:	Complete	INSP. START:	2024-Nov-27 10:16 AM PST
Inspector:	Barrett, Daniel David / 203233	INSP. CLASS:	Class 3 - Trailer and Semi-Trailer	INSP. COMPLETE:	2024-Nov-27 12:16 PM PST
Work Order #:		INSP. REASON:	Annual		

Vehicle Jurisdiction:	British Columbia	REGI:	09514025	VIN:	1GRAA0625AB704443
Plate #:	39023J	UNIT/FLEET#:	5332	OWNER/LESSEE NAME:	ARGUS, CARRIERS LTD, ARGUS
Permitted GVW(kg):	999999	BODY STYLE:	Van Trailer	ADDRESS:	3839 MYRTLE STREET, 3839 MYRTLE STREET
Vehicle Year:	2010	ODOMETER:			Burnaby, British Columbia
Make:	GREAT DANE	HUB ODOMETER:	546074 KM		V5C4G1, Canada
Model:		BRAKE TYPE:	Air		
		FUEL TYPE:			

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Not Applicable
Section 2 - Suspension	Repaired (same day) #1 AXLE L/S AIR BAG CRACKING REPLACED TO NEW #2 AXLE BOTH SIDE AIR BAG CRACKING REPLACED TO NEW
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Repaired (same day) REPLACED #2 AXLE L/S BRAKE POT BROKEN SPRING REPLACED #2 AXLE BOTH SIDES BRAKE LINING CRACKED
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Not Applicable
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Repaired (same day) REPLACE WORN DOCK BUMPERS BOTH SIDES
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Not Applicable
Section 11 - Other Vehicle Components	Passed

Brake Chamber Type, Size and Push Rod Stroke (mm)						Tire Tread Depth (mm)				
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	30	Automatic	38	38	9	9	8	9	
2	Clamp	30	Automatic	38	38	10	10	13	13	

Comment:

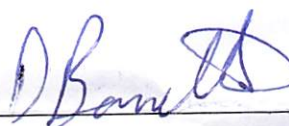

Comment:

Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)			
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right	
1	45	50	Lining (Shoe)	16	16	Drum			
2	60	60	Lining (Shoe)	13	13	Drum			

Comment:

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

Inspection Comments:

Has this Vehicle been road tested? No
 Inspector: Barrett, Daniel David
 Road Test Date: 
 Signature:  Road Tester:

Inspection Report was submitted to CVSE on 2024-Nov-27 12:17 PMPST
 Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

