



Repair Jobcard - 1322 - EMM Group Echuca - Heavy



| | | | | | | |
|--|-------------------|-----------------|--|-------------------------|-------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 28/02/2024 | |
| Registration | XV90BD | Model | T909 | Kilometres Open | | |
| Fault Number | 386 | VIN | 6F500000JA463313 | Hours Open | | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | | |
| Location | | Engine | 80075154 | PO # | | |
| Description | | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-1322 | 386 | | 28/02/2024 | Beau Triffett / | | |
| Assigned to | | Priority | Date Scheduled | | | |
| Patrick Turner | | Normal | | | | |
| Repair Type: ride height valve | | | Repairer: Internal Workshop | | | |
| Repair Description: Worn. . Both Dolly and trailer ride height valves worn and not sitting correctly | | | Cause / Notes <i>Replaced ride height valves</i> | | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED



Repair Jobcard - 1166 - EMM Group Echuca - Heavy



| | | | | | |
|--|------------------------------|-----------------|---|-------------------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 16/01/2024 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 344, 363, 367, 366, 365, 364 | VIN | 6F5000000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |
| Description | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | |
| R-1166 | 344, 363, 367, 366, 365, 364 | | 16/01/2024 | Beau Triffett / | |
| Assigned to | | Priority | | Date Scheduled | |
| Patrick Turner | | Normal | | | |
| Repair Type: Lights | | | Repairer: Internal Workshop | | |
| Repair Description: Not Working. . Both back up lights blown | | | Cause / Notes <i>R/R Back up lights</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED



Repair Jobcard - 1166 - EMM Group Echuca - Heavy



| | | | | | |
|---|------------------------------|-----------------|--|-------------------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 16/01/2024 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 344, 363, 367, 366, 365, 364 | VIN | 6F5000000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |
| Description | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | |
| R-1166 | 344, 363, 367, 366, 365, 364 | | 16/01/2024 | Beau Triffett / | |
| Assigned to | | Priority | | Date Scheduled | |
| Patrick Turner | | Normal | | | |
| Repair Type: Ride hieght valve | | | Repairer: Internal Workshop | | |
| Repair Description: Worn. . Dolly and trailer ride height valve | | | Cause / Notes <i>Replaced Ride height valves</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts

No Repair Required

Defer To: _/ _/ _

Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| Notes |
|-------|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |



Repair Jobcard - 1166 - EMM Group Echuca - Heavy



| | | | | | |
|---------------|------------------------------|------------|------------------|-----------------|------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 16/01/2024 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 344, 363, 367, 366, 365, 364 | VIN | 6F500000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |

| Description | | | | | Done | Comments/Info |
|-------------|------------------------------|----------|---------------|------------------|------|---------------|
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-1166 | 344, 363, 367, 366, 365, 364 | | 16/01/2024 | Beau Triffett / | | |

| Assigned to | Priority | Date Scheduled |
|----------------|----------|----------------|
| Patrick Turner | Normal | |

| | |
|---|--|
| Repair Type: Exhaust | Repairer: Internal Workshop |
| Repair Description: Worn. . Hole in exhaust elbow | Cause / Notes <i>R/R Exhaust Elbow</i> |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notes

| |
|--|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| | | |
|--|--|--|
| | | |
| | | |

| | | | |
|--|--|--|--|
| | | | |
| | | | |


Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |
| | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | | | 1 | | | | |

| | | | |
|------------------------------|----------------------------------|------------------|------------------------------|
| Service Persons Name: Pat | Signature: <i>Pat</i> | Date: 18/3/24 | Kilometres/Hours: 746,330 |
| Managers Name: JOSH | Signature: <i>[Signature]</i> | Date: 20/3/24 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 241



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|-------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 12/03/2024 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 744012 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 744012 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|---|----------------|---------------------|----------|---------------|---------------|
| Description | | | | Done | Comments/Info |
| Engine | | | | | |
| Check Engine oil level. | | | | ✓ | |
| Check Coolant level | | | | ✓ | |
| Check Cooling System condition, pressure test & record | | | | ✓ | |
| Tarp | | | | | |
| Check tarp condition and function | | | | ✓ | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | | ✓ | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | | ✓ | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | | ✓ | |
| Inspect all belts and adjust as required | | | | ✓ | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | | ✓ | |
| Check & replace any nipples not taking grease | | | | ✓ | |
| Check all uni joints | | | | ✓ | |
| Check for any cracks/wear in chassis or body | | | | ✓ | |
| Inspect centre bearing | | | | ✓ | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | | ✓ | |
| Ensure wheels have been removed to visually inspect pads. | | | | ✓ | |
| Steer: L: 60 % R: 60 % Drives: Front Axle L: 60 % R: 60 % Rear Axle: L: 60 % R: 60 % | | | | ✓ | |
| Check Air tanks for oil or water | | | | ✓ | |
| Inspect suspension for condition | | | | ✓ | |
| Check steering oil level & any leaks | | | | ✓ | |
| Check battery level & terminals, ensure battery box is clean. | | | | ✓ | |
| Check tyres for uneven wear & tread depth | | | | ✓ | |
| Clean A/C Filter. | | | | ✓ | |
| Check all lights and repair as required | | | | ✓ | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | | ✓ | |
| Check all reflectors and replace as required | | | | ✓ | |
| Check wheel nut indicators are in place. | | | | ✓ | |
| Check reverse buzzers and reverse lights are in good working condtion | | | | ✓ | |
| Check flashing light is in good working condition. | | | | ✓ | |

ENTERED

| Description | Done | Comments/Info |
|---|------|---------------|
| Check NHVAS Label/s | ✓ | |
| Check wiper condition & washer bottle level | ✓ | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | ✓ | |
| Transmission | | |
| Check oil & inspect for leaks | ✓ | |
| Differential | | |
| Check oil & inspect for leaks | ✓ | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | | | | | |
|-----------------------|-------|--------|-------|-------------------------|-------|--------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |
| Wheels Removed | | | | Date Retightened | | | |
| Date | | Signed | | Date | | Signed | |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|---|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Axle | | Internal Workshop | 15/11/2023 |
| Repair Description: | | | Cause | | |
| Worn. . Right hand front spring hanger on trailer (3rd axle) needs replacing | | | <i>Defect to office awaiting decision</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|---------------------------------------|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Body | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Excessive movement in trailer tipping pin & bushes | | | Cause <i>awaiting parts</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|---|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Lights | | Internal Workshop | 16/01/2024 |
| Repair Description: Not Working. . Both back up lights blown | | | Cause <i>R/R Back up lights</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------|---|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | ABS | | Internal Workshop | 16/01/2024 |
| Repair Description: Not Working. . Truck abs light on | | | Cause <i>awaiting computer scan for fault codes</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------------|--|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Ride height valve | | Internal Workshop | 16/01/2024 |
| Repair Description: Worn. . Dolly and trailer ride height valve | | | Cause <i>Previous repair</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|-----------------------------------|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Exhaust | | Internal Workshop | 16/01/2024 |
| Repair Description: Worn. . Hole in exhaust elbow | | | Cause <i>R/R Exhaust Elbow</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|--|-------------------|---------------|
| R-1323 | 385 | Drawbar | | Internal Workshop | 28/02/2024 |
| Repair Description: Worn. . Drawbar bushes worn | | | Cause <i>awaiting parts and stand down Time</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|---------------------------------|----------|---------------|
| R-1324 | 384 | Windscreen | | NOVUS | 28/02/2024 |
| Repair Description: Cracked. . Both front windscreens | | | Cause <i>previous repair</i> | | |


TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|--------------------------------|-------------------|---------------|
| R-1321 | 387 | Guards | | Internal Workshop | 28/02/2024 |
| Repair Description: Damaged. . Both rear guard brackets damaged L/h dolly guard brackets also damaged and need replacing | | | Cause <i>awaiting parts</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed



Service Jobcard - 228



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|-------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 16/02/2024 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 732030 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 732030 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | Done | Comments/Info | |
| Engine | | | | | |
| Check Engine oil level. | | | ✓ | | |
| Check Coolant level | | | ✓ | | |
| Check Cooling System condition, pressure test & record | | | ✓ | | |
| Tarp | | | | | |
| Check tarp condition and function | | | ✓ | | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | ✓ | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | ✓ | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | ✓ | | |
| Inspect all belts and adjust as required | | | ✓ | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | ✓ | | |
| Check & replace any nipples not taking grease | | | ✓ | | |
| Check all uni joints | | | ✓ | | |
| Check for any cracks/wear in chassis or body | | | ✓ | | |
| Inspect centre bearing | | | ✓ | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | ✓ | | |
| Ensure wheels have been removed to visually inspect pads. | | | ✓ | | |
| Steer: L: <u>60</u> % R: <u>60</u> % Drives: Front Axle L: <u>60</u> % R: <u>60</u> % Rear Axle: L: <u>60</u> % R: <u>60</u> % | | | ✓ | | |
| Check Air tanks for oil or water | | | ✓ | | |
| Inspect suspension for condition | | | ✓ | | |
| Check steering oil level & any leaks | | | ✓ | | |
| Check battery level & terminals, ensure battery box is clean. | | | ✓ | | |
| Check tyres for uneven wear & tread depth | | | ✓ | | |
| Clean A/C Filter. | | | ✓ | | |
| Check all lights and repair as required | | | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | ✓ | | |
| Check all reflectors and replace as required | | | ✓ | | |
| Check wheel nut indicators are in place. | | | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condtion | | | ✓ | | |
| Check flashing light is in good working condition. | | | ✓ | | |

ENTERED

| Description | Done | Comments/Info | |
|---|-------------------------------------|---------------|-----------|
| Check NHVAS Label/s | <input checked="" type="checkbox"/> | | |
| Check wiper condition & washer bottle level | <input checked="" type="checkbox"/> | | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | <input checked="" type="checkbox"/> | | |
| Transmission | | | |
| Check oil & inspect for leaks | <input checked="" type="checkbox"/> | | |
| Differential | | | |
| Check oil & inspect for leaks | <input checked="" type="checkbox"/> | | |
| Part Number | Description | QTY Used | Parts Bin |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1
 Axle2
 Axle3
 Axle4
 Axle5
 Axle6
 Axle7
 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|----------|------------------------------|-------------|----------------|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Axle | | Internal Workshop | 15/11/2023 |

| | |
|--|---------------------------------------|
| Repair Description: Worn. . Right hand front spring hanger on trailer (3rd axle) needs replacing | Cause <i>awaiting parts</i> |
|--|---------------------------------------|

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|---------------------------------------|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Body | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Excessive movement in trailer tipping pin & bushes | | | Cause <i>awaiting parts</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|---------------------------------------|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Lights | | Internal Workshop | 16/01/2024 |
| Repair Description: Not Working. . Both back up lights blown | | | Cause <i>awaiting parts</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------|---|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | ABS | | Internal Workshop | 16/01/2024 |
| Repair Description: Not Working. . Truck abs light on | | | Cause <i>awaiting computer to calibrate</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------------|---------------------------------------|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Ride hieght valve | | Internal Workshop | 16/01/2024 |
| Repair Description: Worn. . Dolly and trailer ride height valve | | | Cause <i>awaiting parts</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------|--|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Exhaust | | Internal Workshop | 16/01/2024 |
| Repair Description: Worn. . Hole in exhaust elbow | | | Cause <i>awaiting Discom</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------|---|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Fuel System | | Internal Workshop | 16/01/2024 |
| Repair Description: Not Working. . Fuel water separator sensor fault. | | | Cause <i>Fault previously fixed</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|--------------|---|-------------------|---------------|
| R-1166 | 344, 363, 367, 366, 365, 364 | Coolant Leak | | Internal Workshop | 16/01/2024 |
| Repair Description: Leak. . Coolant leak on the side of the block r/h rear | | | Cause <i>Fault previously Fixed</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|---------|---------------|---|-------------------|---------------|
| R-1254 | 371 | Adblue system | | Internal Workshop | 12/02/2024 |
| Repair Description: Other. . Nox outlet sensor failure After treat light on and de rated | | | Cause <i>Fault previously Fixed</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|--------------|---|-------------------|---------------|
| R-1257 | 372 | Coolant Leak | | Internal Workshop | 13/02/2024 |
| Repair Description: Leak. Have you checked the engine oil, hydraulic oil and coolant? Coolant leak right hand rear of block. 9ltrs of coolant | | | Cause <i>Fault previously Fixed</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts

No Repair Required

Defer To: _/_/_

Fault Fixed

| Notes |
|-------|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------------|-------------|-------------|-----------|------|-------|--------|-------|
| <i>Pat</i> | <i>4:00</i> | <i>4:30</i> | <i>.5</i> | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|-------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>[Signature]</i> | Date: <i>19/2/24</i> | Kilometres/Hours: <i>734,012</i> |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>21/2/24</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 1257 - EMM Group Echuca - Heavy



| | | | | | |
|---------------|-------------------|------------|-------------------|-----------------|------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 13/02/2024 |
| Registration | XV90BD | Model | T909 | Kilometres Open | 731030 |
| Fault Number | 372 | VIN | 6F5000000JA463313 | Hours Open | 0 |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |

| | | |
|--------------------|-------------|----------------------|
| Description | Done | Comments/Info |
|--------------------|-------------|----------------------|

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|---------|----------|---------------|------------------|
| R-1257 | 372 | | 13/02/2024 | Beau Triffett / |

| Assigned to | Priority | Date Scheduled |
|-------------|----------|----------------|
| | | |

| | |
|--|---|
| Repair Type: | Repairer: |
| Repair Description: Leak. Have you checked the engine oil, hydraulic oil and coolant?. Coolant leak right hand rear of block. 9ltrs of coolant | Cause / Notes <i>R/R worn O ring seal</i> |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED



| Notes | | | |
|-------|--|--|--|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 10:00 | 12:50 | 2.5 | | | | |

| | | | |
|------------------------------|---|------------------|------------------------------|
| Service Persons Name: Pat | Signature:  | Date: 16/2/24 | Kilometres/Hours: 733,741 |
| Managers Name: JOSH | Signature:  | Date: 19/2/24 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 1254 - EMM Group Echuca - Heavy



| | | | | | |
|---|-------------------|-----------------|--|-------------------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 12/02/2024 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 371 | VIN | 6F5000000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |
| Description | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | |
| R-1254 | 371 | | 12/02/2024 | Beau Triffett / | |
| Assigned to | | Priority | Date Scheduled | | |
| Repair Type: | | | Repairer: | | |
| Repair Description: Other. . Nox outlet sensor failure After treat light on and de rated | | | Cause / Notes <i>Replaced NOX sensor</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

Notes

| | | |
|--|--|--|
| | | |
| | | |


| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 2:30 | 3:00 | -5 | | | | |

| | | | |
|-------------------------------------|----------------------------------|------------------|-------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>[Signature]</i> | Date: 12/2/24 | Kilometres/Hours: 731,030 |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: 19/2/24 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 219



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|-------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 01/02/2024 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 722030 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 722030 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | Done | Comments/Info | | | |
| Engine | | | | | |
| Check Engine oil level. | ✓ | | | | |
| Check Coolant level | ✓ | | | | |
| Check Cooling System condition, pressure test & record | ✓ | | | | |
| Tarp | | | | | |
| Check tarp condition and function | ✗ | | | | |
| Engine | | | | | |
| Inspect engine for oil leaks | ✓ | | | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | ✓ | | | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | ✓ | | | | |
| Inspect all belts and adjust as required | ✓ | | | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | ✓ | | | | |
| Check & replace any nipples not taking grease | ✓ | | | | |
| Check all uni joints | ✓ | | | | |
| Check for any cracks/wear in chassis or body | ✓ | | | | |
| Inspect centre bearing | ✓ | | | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | ✓ | | | | |
| Ensure wheels have been removed to visually inspect pads. | ✓ | | | | |
| Steer: L: <u>60</u> % R: <u>60</u> % Drives: Front Axle L: <u>60</u> % R: <u>60</u> % Rear Axle: L: <u>60</u> % R: <u>60</u> % | ✓ | | | | |
| Check Air tanks for oil or water | ✓ | | | | |
| Inspect suspension for condition | ✓ | | | | |
| Check steering oil level & any leaks | ✓ | | | | |
| Check battery level & terminals, ensure battery box is clean. | ✓ | | | | |
| Check tyres for uneven wear & tread depth | ✓ | | | | |
| Clean A/C Filter. | ✓ | | | | |
| Check all lights and repair as required | ✓ | | | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | ✓ | | | | |
| Check all reflectors and replace as required | ✓ | | | | |
| Check wheel nut indicators are in place. | ✓ | | | | |
| Check reverse buzzers and reverse lights are in good working condtion | ✓ | | | | |
| Check flashing light is in good working condition. | ✓ | | | | |

ENTERED

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|----------------|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Axle | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Right hand front spring hanger on trailer (3rd axle) needs replacing | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|----------------|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Body | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Excessive movement in trailer tipping pin & bushes | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|----------------|-------------------|---------------|
| R-1166 | 344 | Lights | | Internal Workshop | 16/01/2024 |
| Repair Description: Not Working. . Both back up lights blown | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|----------------------------|---------|-------------|----------------|-------------------|---------------|
| R-1088 | | GPS | | Internal Workshop | 15/12/2023 |
| Repair Description: | | | Cause | | |



TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed


| Notes |
|----------------------------------|
| Track Tarp motor solenoid v/s |
| SOLANOID ORDERED FOR REPLACEMENT |

| Notes | | | | | | | |
|-------|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 4:00 | 4:45 | 75 | | | | |
| | | | | | | | |

| | | | |
|------------------------------|---|-----------------|-----------------------------|
| Service Persons Name: Pat | Signature:  | Date: 6/2/24 | Kilometres/Hours: 727842 |
| Managers Name: JOJA | Signature:  | Date: 7/2/24 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 198



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|-----------------------|-------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | B-Service | | B |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 22/12/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 712030 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: | 712030 | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | | | |
| Engine | | | | | |
| Change Engine Oil | | | | | ✓ |
| Change Oil Filters | | | | | ✓ |
| Change Fuel & Separator Filters | | | | | ✓ |
| Check Cooling System condition, pressure test & record | | | | | ✓ |
| Tarp | | | | | |
| Check tarp condition and function | | | | | ✓ |
| Engine | | | | | |
| Inspect engine for oil leaks | | | | | ✓ |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | | | ✓ |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | | | ✓ |
| Change Air Cleaner Elements (610's every B) | | | | | ✓ |
| Inspect all belts and adjust as required | | | | | ✓ |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | | | ✓ |
| Check & replace any nipples not taking grease | | | | | ✓ |
| Check all uni joints | | | | | ✓ |
| Check for any cracks/wear in chassis or body | | | | | ✓ |
| Inspect centre bearing | | | | | ✓ |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | | | ✓ |
| Ensure wheels have been removed to visually inspect pads. | | | | | ✓ |
| Steer: L: <u>60</u> % R: <u>60</u> % Drives: Front Axle L: <u>70</u> % R: <u>70</u> % Rear Axle: L: <u>70</u> % R: <u>70</u> % | | | | | ✓ |
| Check Air tanks for oil or water | | | | | ✓ |
| Inspect suspension for condition | | | | | X |
| Inspect over unit for abnormalities | | | | | X |
| Check if any free-play in steering and steering components | | | | | ✓ |
| Check condition of King Pin & Ball joints | | | | | ✓ |
| Check steering oil level & any leaks | | | | | ✓ |
| Check battery level & terminals, ensure battery box is clean. | | | | | ✓ |
| Check tyres for uneven wear & tread depth | | | | | X |
| Check all wheel bearings for movement | | | | | X |
| Check for fault codes, report and clear as required | | | | | ✓ |

ENTERED

| Description | Done | Comments/Info | |
|---|-------------|---------------|-----------|
| Check pitman arm, drag links & tie rod ends | ✓ | | |
| Check clutch operation and adjust as required | ✓ | | |
| Check door operation, hinges & striker plates. | ✓ | | |
| Clean A/C Filter. | ✓ | | |
| Check all lights and repair as required | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | ✓ | | |
| Check all reflectors and replace as required | ✓ | | |
| Check wheel nut indicators are in place. | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condtion | ✓ | | |
| Check flashing light is in good working condition. | ✓ | | |
| Check NHVAS Label/s | ✓ | | |
| Check wiper condition & washer bottle level | ✓ | | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | ✓ | | |
| Transmission | | | |
| Check oil & inspect for leaks | ✓ | | |
| Differential | | | |
| Check oil & inspect for leaks | X | | |
| Part Number | Description | QTY Used | Parts Bin |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | |
|--|--|--|--|
| | | | |
| | | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------|--|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Suspension | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Steer springs worn and moving | | | Cause <i>Awaiting confirmation</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts No Repair Required Defer To: _/ _/ _ Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|------------------------------|-------------|---|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | shockers | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Rear axle shock absorbers u/s | | | Cause <i>Replaced drive shockers x4</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts No Repair Required Defer To: _/ _/ _ Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|---|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Exhaust | | Internal Workshop | 15/11/2023 |
| Repair Description: Cracked. . Y piece on exhaust behind cab cracked | | | Cause <i>welded up crack Found new hole in bottom</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts No Repair Required Defer To: _/ _/ _ Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|--|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Axle | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Right hand front spring hanger on trailer (3rd axle) needs replacing | | | Cause <i>Awaiting confirmation</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts No Repair Required Defer To: _/ _/ _ Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|------------------------------|-------------|--------------------------------------|-------------------|---------------|
| R-966 | 295, 294, 310, 309, 308, 307 | Body | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn . Excessive movement in trailer tipping pin & bushes | | | Cause <i>awaiting conformator</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts No Repair Required Defer To: _/_/_ Fault Fixed


| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---------------------|---------|-------------|---|-------------------|---------------|
| R-1088 | | GPS | | Internal Workshop | 15/12/2023 |
| Repair Description: | | | Cause <i>checked power supply checks over unit Refer to supplier</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts No Repair Required Defer To: _/_/_ Fault Fixed

| Notes | | | | | | | |
|--|-------------|----------------------------------|-------------|--------------------------|-------|-------------------------------------|-------|
| <i>Suspension - Driveline Shockers U/S U/S, Steer axle Springs U/S, Replaced Shockers</i> | | | | | | | |
| <i>Exhaust Y bracket cracked, hole in bottom exhaust elbow - welded</i> | | | | | | | |
| <i>Steer tyres left hand side wearing out side edge</i> | | | | | | | |
| <i>RH Steer has excessive wheel bending movement</i> | | | | | | | |
| <i>Power Divider seals have worn causing oil to pump out when together</i> | | | | | | | |
| Name | Start | Finish | Total | Name | Start | Finish | Total |
| <i>Pat</i> | <i>7:15</i> | <i>1:30</i> | <i>6:25</i> | | | | |
| Service Persons Name: <i>Pat</i> | | Signature: <i>Pat</i> | | Date: <i>27/12/23</i> | | Kilometres/Hours: <i>713,537</i> | |
| Managers Name: <i>JOSH</i> | | Signature: <i>[Signature]</i> | | Date: <i>8/1/24</i> | | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 181



ENTERED

EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F500000JA463313 | Date Open | 27/11/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 702030 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 702030 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|-------------|----------------------|----------|
| Description | | | Done | Comments/Info | |
| Engine | | | | | |
| Check Engine oil level. | | | ✓ | | |
| Check Coolant level | | | ✓ | | |
| Check Cooling System condition, pressure test & record | | | ✓ | | |
| Tarp | | | | | |
| Check tarp condition and function | | | ✓ | | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | ✓ | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | ✓ | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | ✓ | | |
| Inspect all belts and adjust as required | | | ✓ | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | ✓ | | |
| Check & replace any nipples not taking grease | | | ✓ | | |
| Check all uni joints | | | ✓ | | |
| Check for any cracks/wear in chassis or body | | | ✓ | | |
| Inspect centre bearing | | | ✓ | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | ✓ | | |
| Ensure wheels have been removed to visually inspect pads. | | | ✓ | | |
| Steer: L: <u>50</u> % R: <u>50</u> % Drives: Front Axle L: <u>60</u> % R: <u>60</u> % Rear Axle: L: <u>60</u> % R: <u>60</u> % | | | ✓ | | |
| Check Air tanks for oil or water | | | ✓ | | |
| Inspect suspension for condition | | | ✓ | | |
| Check steering oil level & any leaks | | | ✓ | | |
| Check battery level & terminals, ensure battery box is clean. | | | ✓ | | |
| Check tyres for uneven wear & tread depth | | | ✓ | | |
| Clean A/C Filter. | | | ✓ | | |
| Check all lights and repair as required | | | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | ✓ | | |
| Check all reflectors and replace as required | | | ✓ | | |
| Check wheel nut indicators are in place. | | | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condition | | | ✓ | | |
| Check flashing light is in good working condition. | | | ✓ | | |

| Description | Done | Comments/Info |
|---|------|---------------|
| Check NHVAS Label/s | ✓ | |
| Check wiper condition & washer bottle level | ✓ | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | ✓ | |
| Transmission | | |
| Check oil & inspect for leaks | ✓ | |
| Differential | | |
| Check oil & inspect for leaks | ✓ | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|----------|----------|-------------|----------------|-------------------|---------------|
| R-966 | 295, 294 | Body | | Internal Workshop | 15/11/2023 |

| | |
|--|------------------|
| Repair Description: Worn. Tailgate pins and bosses on trailer. Steep pins worn through plastic bushes and have started to wear out the bosses on the tailgate and bin. | Cause |
|--|------------------|

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|----------|-------------|----------------|-------------------|---------------|
| R-966 | 295, 294 | Body | | Internal Workshop | 15/11/2023 |
| Repair Description: Worn. . Excessive movement in trailer tipping pin & bushes | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _ / _ / _
 Fault Fixed

| Notes | | | | | | | |
|-------|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|--------------|--------------|-------|------|-------|--------|-------|
| PAT | 3:45 4:00 | 4:30 4:45 | -75 | | | | |
| | | | | | | | |

| | | | |
|------------------------------|----------------------------------|-------------------|------------------------------|
| Service Persons Name: PAT | Signature: <i>[Signature]</i> | Date: 28/11/23 | Kilometres/Hours: 702,963 |
| Managers Name: JOSH | Signature: <i>[Signature]</i> | Date: 29/11/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 931 - EMM Group Echuca - Heavy



| | | | | | |
|--|-------------------|-----------------|--|-------------------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 01/11/2023 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 284 | VIN | 6F5000000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |
| Description | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | |
| R-931 | 284 | | 01/11/2023 | Steve Vetusi / | |
| Assigned to | | Priority | Date Scheduled | | |
| Repair Type: | | | Repairer: | | |
| Repair Description: Worn. . Lift up axle, bolts loose, axle moving | | | Cause / Notes <i>Tightened up Bolt/nut</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

| Notes | |
|-------|--|
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |


| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 3:45 | 4:00 | -25 | | | | |

| | | | |
|-------------------------------------|----------------------------------|--------------------------|-------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>Pat</i> | Date: <i>8/11/23</i> | Kilometres/Hours: |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>14/11/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 155

ENTERED



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|-------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 18/10/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 692030 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 692030 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | | | |
| Engine | | | | | |
| Check Engine oil level. | | | | / | |
| Check Coolant level | | | | / | |
| Check Cooling System condition, pressure test & record | | | | | |
| Tarp | | | | | |
| Check tarp condition and function | | | | / | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | | / | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | | / | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | | / | |
| Inspect all belts and adjust as required | | | | / | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | | / | |
| Check & replace any nipples not taking grease | | | | / | |
| Check all uni joints | | | | / | |
| Check for any cracks/wear in chassis or body | | | | / | |
| Inspect centre bearing | | | | / | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | | / | |
| Ensure wheels have been removed to visually inspect pads. | | | | | |
| Steer: L: <u>70</u> % R: <u>70</u> % Drives: Front Axle L: <u>70</u> % R: <u>70</u> % Rear Axle: L: <u>70</u> % R: <u>70</u> % | | | | / | |
| Check Air tanks for oil or water | | | | / | |
| Inspect suspension for condition | | | | / | |
| Check steering oil level & any leaks | | | | / | |
| Check battery level & terminals, ensure battery box is clean. | | | | / | |
| Check tyres for uneven wear & tread depth | | | | / | |
| Clean A/C Filter. | | | | / | |
| Check all lights and repair as required | | | | / | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | | / | |
| Check all reflectors and replace as required | | | | / | |
| Check wheel nut indicators are in place. | | | | / | |
| Check reverse buzzers and reverse lights are in good working condition | | | | / | |
| Check flashing light is in good working condition. | | | | / | |

| Description | Done | Comments/Info |
|---|------|---------------|
| Check NHVAS Label/s | ✓ | |
| Check wiper condition & washer bottle level | ✓ | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | ✓ | |
| Transmission | | |
| Check oil & inspect for leaks | ✓ | |
| Differential | | |
| Check oil & inspect for leaks | ✓ | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |
|----------------|--------|-------|-------|------------------|--------|-------|-------|
| Wheels Removed | | | | Date Retightened | | | |
| Date | Signed | | | Date | Signed | | |

| Notes |
|----------------------------------|
| windscreen damaged - LHS cracked |
| - RHS chipped and fractured |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|----------------------------|-------|--------|-------|------------------------|----------------|---------------------------|-------|
| Pat | 7:30 | 8:15 | .75 | | | | |
| Service Persons Name: Pat | | | | Signature: [Signature] | Date: 30/10/23 | Kilometres/Hours: 688,467 | |
| Managers Name: [Signature] | | | | Signature: [Signature] | Date: 3/11/23 | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 856 - EMM Group Echuca - Heavy



| | | | | | | |
|---|-------------------|-----------------|---|-------------------------|-------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 20/10/2023 | |
| Registration | XV90BD | Model | T909 | Kilometres Open | | |
| Fault Number | 267, 266 | VIN | 6F5000000JA463313 | Hours Open | | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | | |
| Location | | Engine | 80075154 | PO # | | |
| Description | | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-856 | 267, 266 | | 20/10/2023 | Josh Taylor / | | |
| Assigned to | | Priority | Date Scheduled | | | |
| Patrick Turner | | Normal | | | | |
| Repair Type: air bag | | | Repairer: Internal Workshop | | | |
| Repair Description: Damage. . Air bag blown | | | Cause / Notes <i>Replaced air Bag</i> | | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notes

Notes section containing multiple empty lines for text entry.

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | | | | | | |
|-----------------------|-------|--------|-------|-------------------------|-------|--------|-------|--|
| | | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 | |
| Wheels Removed | | | | Date Retightened | | | | |
| Date | | Signed | | Date | | Signed | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 1:00 | 1:30 | .5 | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------|-------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>Pat</i> | Date: 25/10/23 | Kilometres/Hours: Pat |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: 26/10/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 856 - EMM Group Echuca - Heavy



| | | | | | |
|---|-------------------|-----------------|---|-------------------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 20/10/2023 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 267 | VIN | 6F500000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |
| Description | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | |
| R-856 | 267 | | 20/10/2023 | Josh Taylor / | |
| Assigned to | | Priority | Date Scheduled | | |
| Patrick Turner | | Normal | | | |
| Repair Type: air bag | | | Repairer: Internal Workshop | | |
| Repair Description: Damage. . Air bag blown | | | Cause / Notes <i>Replaced left axle Air Bag</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

Notes


| | | | | | | | | | |
|--|--|--|--|--|--|--|--|--|--|
| | | | | | | | | | |
| | | | | | | | | | |
| | | | | | | | | | |
| | | | | | | | | | |

| | | | | | | | |
|-----------------------|--------|--|------|-------------------------|--|--|--|
| Wheels Removed | | | | Date Retightened | | | |
| Date | Signed | | Date | Signed | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| PAT | 3:00 | 4:00 | A | | | | |

| | | | |
|-------------------------------------|----------------------------------|--------------------------|-------------------------------------|
| Service Persons Name: <i>PAT</i> | Signature: <i>[Signature]</i> | Date: <i>26/10/23</i> | Kilometres/Hours: <i>685,637</i> |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>23/10/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.





Service Jobcard - 137




EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|--|-------------------|-----------------------|------------------|-------------------------|---------------|---------------|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F500000JA463313 | Date Open | 26/09/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 682030 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: | 682030 | Scheduled Hours: 0 | | |
| Reminder | | | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval |
| Description | | | Done | | Comments/Info | |
| Engine | | | | | | |
| Check Engine oil level. | | | | ✓ | | |
| Check Coolant level | | | | ✓ | | |
| Check Cooling System condition, pressure test & record | | | | ✓ | | |
| Tarp | | | | | | |
| Check tarp condition and function | | | | ✓ | | |
| Engine | | | | | | |
| Inspect engine for oil leaks | | | | X | | |
| Road Test | | | | | | |
| Road Test vehicle and inspect for any leaks | | | | ✓ | | |
| Engine | | | | | | |
| Inspect & clean air cleaner element. | | | | ✓ | | |
| Inspect all belts and adjust as required | | | | ✓ | | |
| Chassis & General | | | | | | |
| Grease Unit & turntable, top up auto greaser | | | | ✓ | | |
| Check & replace any nipples not taking grease | | | | ✓ | | |
| Check all uni joints | | | | X | | |
| Check for any cracks/wear in chassis or body | | | | ✓ | | |
| Inspect centre bearing | | | | ✓ | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | | ✓ | | |
| Ensure wheels have been removed to visually inspect pads. | | | | ✓ | | |
| Steer: L: <u>70</u> % R: <u>70</u> % Drives: Front Axle L: <u>60</u> % R: <u>60</u> % Rear Axle: L: <u>60</u> % R: <u>60</u> % | | | | ✓ | | |
| Check Air tanks for oil or water | | | | ✓ | | |
| Inspect suspension for condition | | | | ✓ | | |
| Check steering oil level & any leaks | | | | ✓ | | |
| Check battery level & terminals, ensure battery box is clean. | | | | ✓ | | |
| Check tyres for uneven wear & tread depth | | | | X | | |
| Clean A/C Filter. | | | | ✓ | | |
| Check all lights and repair as required | | | | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | | ✓ | | |
| Check all reflectors and replace as required | | | | ✓ | | |
| Check wheel nut indicators are in place. | | | | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condtion | | | | ✓ | | |
| Check flashing light is in good working condition. | | | | ✓ | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------------------------------|-------|--------|-------|---|------------------|------------------------------|-------|
| Pat | 7:45 | 9:13 | 1.5 | | | | |
| Service Persons Name: Pat | | | | Signature:  | Date: 5/10/23 | Kilometres/Hours: 679,173 | |
| Managers Name: JOSH | | | | Signature:  | Date: 5/10/23 | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 106



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|------------------|-------------------------|------------|----------|
| Fleet # | HV02 | Make | Kenworth | B-Service | | B |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F500000JA463313 | Date Open | 04/09/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 670000 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 670000 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | Done | Comments/Info | | | |
| Engine | | | | | |
| Change Engine Oil | ✓ | | | | |
| Change Oil Filters | ✓ | | | | |
| Change Fuel & Separator Filters | ✓ | | | | |
| Check Cooling System condition, pressure test & record | | | | | |
| Tarp | | | | | |
| Check tarp condition and function | ✓ | | | | |
| Engine | | | | | |
| Inspect engine for oil leaks | ✓ | | | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | ✓ | | | | |
| Change Air Cleaner Elements (610's every B) | ✓ | | | | |
| Inspect all belts and adjust as required | ✓ | | | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | ✓ | | | | |
| Check & replace any nipples not taking grease | ✓ | | | | |
| Check all uni joints | ✓ | | | | |
| Check for any cracks/wear in chassis or body | ✓ | | | | |
| Inspect centre bearing | ✓ | | | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | ✓ | | | | |
| Ensure wheels have been removed to visually inspect pads. | | | | | |
| Steer: L: <u>60</u> % R: <u>60</u> % Drives: Front Axle L: <u>70</u> % R: <u>70</u> % Rear Axle: L: <u>70</u> % R: <u>70</u> % | ✓ | | | | |
| Check Air tanks for oil or water | ✓ | | | | |
| Inspect suspension for condition | ✓ | | | | |
| Inspect over unit for abnormalities | X | | | | |
| Check if any free-play in steering and steering components | ✓ | | | | |
| Check condition of King Pin & Ball joints | ✓ | | | | |
| Check steering oil level & any leaks | ✓ | | | | |
| Check battery level & terminals, ensure battery box is clean. | ✓ | | | | |
| Check tyres for uneven wear & tread depth | ✓ | | | | |
| Check all wheel bearings for movement | ✓ | | | | |
| Check for fault codes, report and clear as required | ✓ | | | | |

| Description | Done | Comments/Info |
|---|------|---------------|
| Check pitman arm, drag links & tie rod ends | / | |
| Check clutch operation and adjust as required | / | |
| Check door operation, hinges & striker plates. | / | |
| Clean A/C Filter. | / | |
| Check all lights and repair as required | / | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | / | |
| Check all reflectors and replace as required | / | |
| Check wheel nut indicators are in place. | ✓ | |
| Check reverse buzzers and reverse lights are in good working condition | ✓ | |
| Check flashing light is in good working condition. | / | |
| Check NHVAS Label/s | / | |
| Check wiper condition & washer bottle level | ✓ | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | / | |
| Transmission | | |
| Check oil & inspect for leaks | / | |
| Differential | | |
| Check oil & inspect for leaks | / | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | | | | | |
|-----------------------|-------|--------|-------|-------------------------|-------|--------|-------|
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |
| Wheels Removed | | | | Date Retightened | | | |
| Date | | Signed | | Date | | Signed | |

Notes

windscreen LHS 3/4 of way cracked
RHS chips and cracks forming

Notes

Track HOIST seals starting To weep

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 9:30 | 12:00 | 2.5 | | | | |

Service Persons Name:

Pat

Signature:

[Signature]

Date:

8/9/23

Kilometres/Hours:

672,030

Managers Name:

JOSH

Signature:

[Signature]

Date:

8/9/23

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 107



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | | |
|-----------------------------|--------------|-------------------------|--------------------|-------------------------|--|-----------------|------------|
| Fleet # | TR02 | Make | BTE | B | | | |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | | | Date Open | 04/09/2023 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | | | Kilometres Open | 0 |
| Repairer: Internal Workshop | | Engine | | | | Hours Open | 0 |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|-------------|----------------------|----------|
| Description | | | Done | Comments/Info | |
| Brake System | | | | | |
| Check & adjust brakes | | | | / | |
| Check all brake components Report on break pad % | | | | / | |
| *Front Axle Group* Front Axle L: <u>80</u> % R: <u>80</u> % Rear Axle: L: <u>80</u> % R: <u>80</u> % | | | | | |
| *Rear Axle Group* Fr Axle L: <u>80</u> % R: <u>80</u> % Mid Axle: L: <u>80</u> % R: <u>80</u> % Rear Axle: L: <u>80</u> % R: <u>80</u> % | | | | | |
| Check park break & breakaway protection | | | | | |
| Check brake boosters | | | | ✓ | |
| Chassis & General | | | | | |
| Grease all grease points | | | | / | |
| Replace any nipples not taking grease | | | | / | |
| Check for air or oil leaks | | | | X | |
| Check Air lines & connections | | | | / | |
| Check air hose & electrical connectors | | | | / | |
| Check cross member rails for cracks/damage | | | | / | |
| Check Full Chassis for cracks | | | | / | |
| Check combing railles for craking or damage | | | | / | |
| Check all wheel bearings for free play | | | | / | |
| Check for overall structural damage and cracking | | | | / | |
| Check load restraint equipment | | | | / | |
| Check all tyres for condition, tread depth & pressure | | | | / | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | / | |
| Check all wheel nuts & nut indicators. | | | | / | |
| Check hoist & hydraulic connections | | | | X | |
| Coupling | | | | | |
| Check drawbar bushes & tow eye | | | | / | |
| Check turntable & jaws | | | | | |
| Check & measure king pin wear | | | | | |
| Check ringfeeder/turntable condition | | | | / | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | / | |
| Check Air bags for damage | | | | / | |
| Check shock absorbers & straps/guides | | | | / | |
| Check shocker mounts/rubbers | | | | / | |
| Check U-Bolts for torque | | | | / | |

| Description | Done | Comments/Info |
|---|------|---------------|
| Check Torque, Radius or Tracking Bushes | ✓ | |
| Lights & Reflectors | | |
| Check stick on & flip up signs | ✓ | |
| Check all lights & reflectors | ✓ | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |



| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |


Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Notes |
|---|
| HOSIF seal let go oil leaking from fan stages |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|---------------------------|-------|--------|-------|--|-------|----------------|-------|
| Pat | 2:30 | 3:15 | -75 | | | | |
| | | | | | | | |
| Service Persons Name: Pat | | | | Signature:  | | Date: 8/9/23 | |
| Managers Name: Josh | | | | Signature:  | | Date: 18/09/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 95



EMM Group Echuca - Heavy Vehicles

| | | | | | | |
|-----------------|-------------------|------------------------------|-------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | D-Service | | D |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 07/08/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 200000 | |
| Repairer: | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 200000 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|----------|----------------|---------------------|----------|---------------|----------|
|----------|----------------|---------------------|----------|---------------|----------|

| Description | Done | Comments/Info |
|---|------|---------------|
| Brakes | | |
| Replace trailer brake pads, inspect rotors for condition. | ✓ | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

| | | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|--|
| | | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 | |

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |


| |
|--------------|
| Notes |
| |
| |

| Notes | | | | | | | |
|-------|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 7:00 | 10:00 | 3HRS | | | | |
| | | | | | | | |

| | | | |
|------------------------------|---|------------------|-------------------|
| Service Persons Name: Pat | Signature:  | Date: 31/7/23 | Kilometres/Hours: |
| Managers Name: JOSA | Signature:  | Date: | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 83



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|-----------------------|------------------|-------------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F500000JA463313 | Date Open | 24/07/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 661333 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: | 661333 | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|-------------|----------------------|----------|
| Description | | | Done | Comments/Info | |
| Engine | | | | | |
| Check Engine oil level. | | | ✓ | | |
| Check Coolant level | | | ✓ | | |
| Check Cooling System condition, pressure test & record | | | | | |
| Tarp | | | | | |
| Check tarp condition and function | | | ✓ | | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | ✓ | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | ✓ | | |
| Inspect all belts and adjust as required | | | ✓ | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | ✓ | | |
| Check & replace any nipples not taking grease | | | ✓ | | |
| Check all uni joints | | | ✓ | | |
| Check for any cracks/wear in chassis or body | | | ✓ | | |
| Inspect centre bearing | | | ✓ | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | ✓ | | |
| Ensure wheels have been removed to visually inspect pads. | | | | | |
| Steer: L: <u>60</u> % R: <u>60</u> % Drives: Front Axle L: <u>70</u> % R: <u>70</u> % Rear Axle: L: <u>70</u> % R: <u>70</u> % | | | ✓ | | |
| Check Air tanks for oil or water | | | ✓ | | |
| Inspect suspension for condition | | | ✓ | | |
| Check steering oil level & any leaks | | | ✓ | | |
| Check battery level & terminals, ensure battery box is clean. | | | ✓ | | |
| Check tyres for uneven wear & tread depth | | | ✓ | | |
| Clean A/C Filter. | | | ✓ | | |
| Check all lights and repair as required | | | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | ✓ | | |
| Check all reflectors and replace as required | | | ✓ | | |
| Check wheel nut indicators are in place. | | | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condtion | | | ✓ | | |
| Check flashing light is in good working condition. | | | ✓ | | |

ENTERED

| Description | Done | Comments/Info |
|---|------|---------------|
| Check NHVAS Label/s | ✓ | |
| Check wiper condition & washer bottle level | ✓ | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | | |
| Transmission | | |
| Check oil & inspect for leaks | ✓ | |
| Differential | | |
| Check oil & inspect for leaks | ✓ | |



| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | | | |
|--|--|--|--|--|
| | | | | |
| | | | | |

| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Notes |
|-------|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|---------------------------|-------|--------|--------|--|------------------|--|-------|
| Pat | 10:45 | 11:30 | .75 HR | | | | |
| Service Persons Name: Pat | | | | Signature:  | Date: 25/7/23 | Kilometres/ Hours : 661,552 | |
| Managers Name: JOSH | | | | Signature:  | Date: 28/07/2023 | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 375 - EMM Group Echuca - Heavy



| | | | | | |
|--|-------------------|-----------------|--|-------------------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 06/07/2023 |
| Registration | XV90BD | Model | T909 | Kilometres Open | |
| Fault Number | 189 | VIN | 6F5000000JA463313 | Hours Open | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |
| Description | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | |
| R-375 | 189 | | 06/07/2023 | Kevin Rowe / | |
| Assigned to | | Priority | Date Scheduled | | |
| Patrick Turner | | Normal | | | |
| Repair Type: EBS | | | Repairer: Internal Workshop | | |
| Repair Description: Not Working. . Trailer lazy axel not lifting | | | Cause / Notes <i>Air Brake Australia</i> <i>24/7/23</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

| Notes | | | |
|-------|--|--|--|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | | |
|--|--|--|--|
| | | | |
| | | | |

| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|-------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>[Signature]</i> | Date: <i>25/7/23</i> | Kilometres/Hours: |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>25/7/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 343 - EMM Group Echuca - Heavy



| | | | | | | |
|--|-------------------|-----------------|---|-------------------------|-------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 28/06/2023 | |
| Registration | XV90BD | Model | T909 | Kilometres Open | | |
| Fault Number | 173 | VIN | 6F5000000JA463313 | Hours Open | | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | | |
| Location | | Engine | 80075154 | PO # | | |
| Description | | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-343 | 173 | | 28/06/2023 | Yard Phone / | | |
| Assigned to | | Priority | Date Scheduled | | | |
| Patrick Turner | | Normal | | | | |
| Repair Type: Electrical | | | Repairer: Internal Workshop | | | |
| Repair Description: Not Working. . Fuse blowing for trailer indicators | | | Cause / Notes <i>need to order parts from Ignition Replaced plugs on lights</i> | | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |



Notes

| |
|--|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| | | | |
|--|--|--|--|
| | | | |
| | | | |

| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |


| | | | | | | | |
|-----------------------|--|--------|--|-------------------------|--|--------|--|
| Wheels Removed | | | | Date Retightened | | | |
| Date | | Signed | | Date | | Signed | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|---------------------------|-------|--------|--------|--|-------|--------------|---------|
| PAT | 4:45 | 5:00 | 0.25HR | PAT | 3:30 | 4:00 | - 0.5HR |
| Service Persons Name: PAT | | | | Signature:  | | Date: 5/7/23 | |
| Managers Name: JOBA | | | | Signature:  | | Date: 7/7/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 287 - EMM Group Echuca - Heavy



| | | | | | |
|---------------|-------------------|------------|-------------------|-----------------|------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 20/06/2023 |
| Registration | XV90BD | Model | T909 | Kilometres Open | 651534 |
| Fault Number | 160, 162 | VIN | 6F5000000JA463313 | Hours Open | 0 |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |

Description **Done** **Comments/Info**

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|----------|----------|---------------|------------------|
| R-287 | 160, 162 | | 20/06/2023 | Patrick Turner / |

| Assigned to | Priority | Date Scheduled |
|----------------|----------|----------------|
| Patrick Turner | Normal | |

Repair Type: coolant leak **Repairer:** Internal Workshop

| | |
|---|---|
| <p>Repair Description:</p> <p>Leak. Visually check for any leaks on Truck & Dog.. Cold coolant weep coming from bottom engine hose clamp</p> | <p>Cause / Notes</p> <p><i>monitor check level</i> <i>Daily to see if progressing</i> <i>Tightened up hose clamp</i></p> |
|---|---|

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

Notes

Empty grid for notes



Repair Jobcard - 287 - EMM Group Echuca - Heavy



| | | | | | |
|---------------|-------------------|------------|-------------------|-----------------|------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 20/06/2023 |
| Registration | XV90BD | Model | T909 | Kilometres Open | 651534 |
| Fault Number | 160, 162 | VIN | 6F5000000JA463313 | Hours Open | 0 |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |

| | | |
|--------------------|-------------|----------------------|
| Description | Done | Comments/Info |
|--------------------|-------------|----------------------|

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|---------|----------|---------------|------------------|
|----------|---------|----------|---------------|------------------|

| | | | | |
|-------|----------|--|------------|------------------|
| R-287 | 160, 162 | | 20/06/2023 | Patrick Turner / |
|-------|----------|--|------------|------------------|

| Assigned to | Priority | Date Scheduled |
|-------------|----------|----------------|
|-------------|----------|----------------|

| | | |
|----------------|--------|--|
| Patrick Turner | Normal | |
|----------------|--------|--|

| | |
|----------------------------|------------------------------------|
| Repair Type: Brakes | Repairer: Internal Workshop |
|----------------------------|------------------------------------|

| | |
|--|---|
| Repair Description: Not Working. . Brakes glazed failing to slow down or stop under load | Cause / Notes <i>R/R All Drive axle Brake Shoes / Drums Replaced All stack adjuster</i> |
|--|---|

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: ___/___/___
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notes

| | | |
|--|--|--|
| | | |
| | | |


| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |
| | | | |


| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|---------|------|-------|--------|-------|
| Pat | 11:30 | 4:00 | 4.5 HRS | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|-------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>Pat</i> | Date: <i>20/6/23</i> | Kilometres/Hours: <i>651 558</i> |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>22/6/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 57



ENTERED

EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|------------------|--------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F500000JA463313 | Date Open | 13/06/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 651000 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: Km, hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 651000 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|-------------|---------------|----------------------|
| Description | | | Done | | Comments/Info |
| Engine | | | | | |
| Check Engine oil level. | | | ✓ | | |
| Check Coolant level | | | ✓ | | |
| Check Cooling System condition, pressure test & record | | | | | |
| Tarp | | | | | |
| Check tarp condition and function | | | ✓ | | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | ✓ | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | ✓ | | |
| Inspect all belts and adjust as required | | | ✓ | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | ✓ | | |
| Check & replace any nipples not taking grease | | | ✓ | | |
| Check all uni joints | | | ✓ | | |
| Check for any cracks/wear in chassis or body | | | ✓ | | |
| Inspect centre bearing | | | ✓ | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | ✓ | | |
| Ensure wheels have been removed to visually inspect pads. | | | | | |
| Steer: L: <u>50</u> % R: <u>60</u> % Drives: Front Axle L: <u>50</u> % R: <u>50</u> % Rear Axle: L: <u>50</u> % R: <u>60</u> % | | | | | |
| Check Air tanks for oil or water | | | ✓ | | |
| Inspect suspension for condition | | | ✓ | | |
| Check steering oil level & any leaks | | | ✓ | | |
| Check battery level & terminals, ensure battery box is clean. | | | ✓ | | |
| Check tyres for uneven wear & tread depth | | | ✓ | | |
| Clean A/C Filter. | | | ✓ | | |
| Check all lights and repair as required | | | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | ✓ | | |
| Check all reflectors and replace as required | | | ✓ | | |
| Check wheel nut indicators are in place. | | | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condition | | | ✓ | | |
| Check flashing light is in good working condition. | | | ✓ | | |

| Description | Done | Comments/Info |
|---|------|---------------|
| Check NHVAS Label/s | ✓ | |
| Check wiper condition & washer bottle level | ✓ | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | | |
| Transmission | | |
| Check oil & inspect for leaks | ✓ | |
| Differential | | |
| Check oil & inspect for leaks | ✓ | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | | | | | | |
|-------|-------|-------|-------|-------|-------|-------|-------|
| | | | | | | | |
| Axle1 | Axle2 | Axle3 | Axle4 | Axle5 | Axle6 | Axle7 | Axle8 |

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|----------------|-------------------|---------------|
| R-42 | 36, 62 | Windscreen | | Internal Workshop | 10/05/2023 |
| Repair Description: Cracked left front windscreen, needs replacing | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|---------|-------------|----------------|-------------------|---------------|
| R-47 | 40 | Cab | | Internal Workshop | 11/05/2023 |
| Repair Description: Steering column loose, needs adjusting. | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

Notes

| |
|--|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 4:15 | 5:15 | 1hrs | | | | |

| | | | |
|---|------------------------------|-------------------------|-------------------------------------|
| Service Persons Name: <i>Patrick</i> | Signature: <i>Patrick</i> | Date: <i>15/6/23</i> | Kilometres/Hours: <i>651,333</i> |
| Managers Name: <i>JOSH</i> | Signature: <i>JOSH</i> | Date: <i>16/6/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 47 - EMM Group Echuca - Heavy



| | | | | | | |
|---|-------------------|-----------------|--|-------------------------|-------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 11/05/2023 | |
| Registration | XV90BD | Model | T909 | Kilometres Open | | |
| Fault Number | 40 | VIN | 6F500000JA463313 | Hours Open | | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | | |
| Location | | Engine | 80075154 | PO # | | |
| Description | | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-47 | 40 | | 11/05/2023 | Kevin Rowe / | | |
| Assigned to | | Priority | Date Scheduled | | | |
| | | Normal | | | | |
| Repair Type: Cab | | | Repairer: Internal Workshop | | | |
| Repair Description: Steering column loose, needs adjusting. | | | Cause / Notes ENTERED | | | |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _ / _ / _
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notes

Replaced steering column gas strut

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1

Axle2

Axle3

Axle4

Axle5

Axle6

Axle7

Axle8

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|----------------------------|-------|--------|-------------------------------|---------------|---------------------------|--------|-------|
| Pat | 4:00 | 4:30 | 0.5 HR | | | | |
| Service Persons Name: Pat | | | Signature: <i>Pat</i> | Date: 14/6/23 | Kilometres/Hours: 650,980 | | |
| Managers Name: <i>JOSH</i> | | | Signature: <i>[Signature]</i> | Date: 16/6/23 | | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 107 - EMM Group Echuca - Heavy



| | | | | | | |
|--|-------------------|-----------------|------------------------------------|-------------------------|-------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 19/05/2023 | |
| Registration | XV90BD | Model | T909 | Kilometres Open | | |
| Fault Number | 77 | VIN | 6F5000000JA463313 | Hours Open | | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | | |
| Location | | Engine | 80075154 | PO # | | |
| Description | | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-107 | 77 | | 19/05/2023 | Josh Taylor / | | |
| Assigned to | | Priority | Date Scheduled | | | |
| Patrick Turner | | Normal | 19/05/2023 | | | |
| Repair Type: Air leak | | | Repairer: Internal Workshop | | | |
| Repair Description: Leak. . Cab suspensions air leak | | | Cause / Notes | | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts

No Repair Required

Defer To: _ / _ / _

Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-----------------------|----------|-----------|
| | <i>Truck line INV</i> | | |
| | <i>K2 INV</i> | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

| Notes |
|-----------------------|
| Replaced cab Air Bags |
| Replaced cab shocker |
| Replaced Air Fittings |
| Replaced Air Dryer |
| |
| |
| |
| |
| |
| |
| |
| |

| | | | |
|--|--|--|--|
| | | | |
|--|--|--|--|

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
|--|--|--|--|--|--|--|--|

| Wheels Removed | Date Retightened |
|--|------------------|
| Date: Signed: Date: Signed: | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|----------------------------|-------|--------|-------|-------------------------------|-------|--|-------|
| Pat | 9:30 | 11:30 | 2HR | | | | |
| Service Persons Name: Pat | | | | Signature: <i>Pat</i> | | Date: 19/5/23 | |
| Managers Name: <i>Adam</i> | | | | Signature: <i>[Signature]</i> | | Kilometres/Hours: 640,347 643,060 | |
| | | | | | | Date: 19-5-23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 105 - EMM Group Echuca - Heavy



| | | | | | |
|---------------|-------------------|------------|-------------------|-----------------|------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 16/05/2023 |
| Registration | XV90BD | Model | T909 | Kilometres Open | 641591 |
| Fault Number | 62 | VIN | 6F5000000JA463313 | Hours Open | 11870 |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | |
| Location | | Engine | 80075154 | PO # | |

| | | |
|--------------------|-------------|----------------------|
| Description | Done | Comments/Info |
|--------------------|-------------|----------------------|

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|---------|----------|---------------|------------------|
| R-105 | 62 | | 16/05/2023 | Kevin Rowe / |

| Assigned to | Priority | Date Scheduled |
|-------------|----------|----------------|
| | | |

| | |
|---|----------------------|
| Repair Type: | Repairer: |
| Repair Description: Worn. Are all lights & indicators working?. Front guard indicator lenses are dirty on the inside and hard to see during the day | Cause / Notes |

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

Notes

RTR Removed leas and cleaned + RefIT

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------------|-------------|-------------|--------------|------|-------|--------|-------|
| <i>Pat</i> | <i>8:30</i> | <i>9:30</i> | <i>0.5HR</i> | | | | |

| | | | |
|-----------------------|--------------------|----------------|-------------------|
| Service Persons Name: | Signature: | Date: | Kilometres/Hours: |
| <i>Pat</i> | <i>Pat</i> | <i>19/5/23</i> | <i>643,060</i> |
| Managers Name: | Signature: | Date: | |
| <i>Adam</i> | <i>[Signature]</i> | <i>19-5-23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 106 - EMM Group Echuca - Heavy



| | | | | | | |
|--|-------------------|-----------------|------------------------------------|-------------------------|-------------|----------------------|
| Fleet # | HV02 | Make | Kenworth | Date Open | 19/05/2023 | |
| Registration | XV90BD | Model | T909 | Kilometres Open | | |
| Fault Number | 74 | VIN | 6F500000JA463313 | Hours Open | | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Offset | | |
| Location | | Engine | 80075154 | PO # | | |
| Description | | | | | Done | Comments/Info |
| Repair # | Fault # | Defect # | Reported Date | Reported by / to | | |
| R-106 | 74 | | 19/05/2023 | Adam Myers / | | |
| Assigned to | | Priority | Date Scheduled | | | |
| Patrick Turner | | Normal | 19/05/2023 | | | |
| Repair Type: Chassis | | | Repairer: Internal Workshop | | | |
| Repair Description: Worn. . Ring feeder worn | | | Cause / Notes | | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|---------------|----------|-----------|
| | Truckline INV | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notes

R/R Ring Feeder

| | | |
|--|--|--|
| | | |
| | | |


| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|---------------------------|-------|--------|------------------------|---------------|---------------------------|--------|-------|
| Pat | 8:00 | 9:00 | 1HR | | | | |
| Service Persons Name: Pat | | | Signature: [Signature] | Date: 19/5/23 | Kilometres/Hours: 643,060 | | |
| Managers Name: Adam | | | Signature: [Signature] | Date: 19.5/23 | | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 27

ENTERED



EMM Group Echuca - Heavy Vehicles

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|-------------------|------------------------------|-------------------|--------------------|------------|---|
| Fleet # | HV02 | Make | Kenworth | A-Service | | A |
| Registration | XV90BD | Model | T909 | | | |
| Fault Number | | VIN | 6F5000000JA463313 | Date Open | 10/05/2023 | |
| Service Group | Heavy Rigid Truck | Build Date | 08/2018 | Kilometres Open | 640000 | |
| Repairer: Internal Workshop | | Engine | 80075154 | Hours Open | 0 | |
| Location | | PO # | | Offset: Km, hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 640000 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | Done | Comments/Info | |
| Engine | | | | | |
| Check Engine oil level. | | | ✓ | | |
| Check Coolant level | | | ✓ | | |
| Check Cooling System condition, pressure test & record | | | N/A | | |
| Tarp | | | | | |
| Check tarp condition and function | | | ✓ | | |
| Engine | | | | | |
| Inspect engine for oil leaks | | | ✓ | | |
| Road Test | | | | | |
| Road Test vehicle and inspect for any leaks | | | ✓ | | |
| Engine | | | | | |
| Inspect & clean air cleaner element. | | | ✓ | | |
| Inspect all belts and adjust as required | | | ✓ | | |
| Chassis & General | | | | | |
| Grease Unit & turntable, top up auto greaser | | | ✓ | | |
| Check & replace any nipples not taking grease | | | ✓ | | |
| Check all uni joints | | | ✓ | | |
| Check for any cracks/wear in chassis or body | | | ✓ | | |
| Inspect centre bearing | | | ✓ | | |
| Inspect brake lining/pads, components & slack adjustment, adjust as req. Record brake pad % | | | ✓ | | |
| Ensure wheels have been removed to visually inspect pads. | | | | | |
| Steer: L: <u>60</u> % R: <u>60</u> % Drives: Front Axle L: <u>50</u> % R: <u>50</u> % Rear Axle: L: <u>50</u> % R: <u>50</u> % | | | ✓ | | |
| Check Air tanks for oil or water | | | ✓ | | |
| Inspect suspension for condition | | | ✓ | | |
| Check steering oil level & any leaks | | | ✓ | | |
| Check battery level & terminals, ensure battery box is clean. | | | ✓ | | |
| Check tyres for uneven wear & tread depth | | | ✓ | | |
| Clean A/C Filter. | | | ✓ | | |
| Check all lights and repair as required | | | ✓ | | |
| Check all Do not overtake, long vehicle, road train & stick on signs for condition. | | | ✓ | | |
| Check all reflectors and replace as required | | | ✓ | | |
| Check wheel nut indicators are in place. | | | ✓ | | |
| Check reverse buzzers and reverse lights are in good working condition | | | ✓ | | |
| Check flashing light is in good working condition. | | | ✓ | | |

| Description | Done | Comments/Info | |
|---|-------------|---------------|-----------|
| Check NHVAS Label/s | ✓ | | |
| Check wiper condition & washer bottle level | ✓ | | |
| Check Fire Extinguisher & First Aid kit are in date and not damaged | | | |
| Transmission | | | |
| Check oil & inspect for leaks | ✓ | | |
| Differential | | | |
| Check oil & inspect for leaks | ✓ | | |
| Part Number | Description | QTY Used | Parts Bin |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | |
|--|--|--|
| | | |
| | | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|----------|---------|-------------|----------------|-------------------|---------------|
| R-66 | 49 | Engine | | Internal Workshop | 12/05/2023 |

| | |
|---|--------------|
| Repair Description: Engine oil low, please top up at next A | Cause |
|---|--------------|

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|----------------|-------------------|---------------|
| R-41 | 35 | Cab | | Internal Workshop | 10/05/2023 |
| Repair Description: Cab airbags need replacing | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|----------------|-------------------|---------------|
| R-42 | 36 | Windscreen | | Internal Workshop | 10/05/2023 |
| Repair Description: Cracked left front windscreen, needs replacing | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|---|---------|-------------|----------------|-------------------|---------------|
| R-47 | 40 | Cab | | Internal Workshop | 11/05/2023 |
| Repair Description: Steering column loose, needs adjusting. | | | Cause | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|--|-------------------|---------------|
| R-51 | 39 | Dash | | Internal Workshop | 11/05/2023 |
| Repair Description: Trailer ABS light stays on | | | Cause <i>Rubbed through sensor wire Replaced sensor</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: *monitor* __/__/__
 Fault Fixed

| Notes |
|-------|
| |
| |
| |
| |

| Notes | | | | | | | |
|-------|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|--------|------|-------|--------|-------|
| Pat | 7:15 | 8:00 | :75 HR | | | | |
| | | | | | | | |

| | | | |
|---|----------------------------------|-------------------------|-------------------------------------|
| Service Persons Name: <i>Patrick</i> | Signature: <i>Patrick</i> | Date: <i>13/5/23</i> | Kilometres/Hours: <i>641,000</i> |
| Managers Name: <i>Adam</i> | Signature: <i>[Signature]</i> | Date: <i>13/5/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 242



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|--------------|-------------------------|--------------------|-------------------------|------------|----------|
| Fleet # | TR02 | Make | BTE | | | A |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 12/03/2024 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | 0 | |
| Repairer: Internal Workshop | | Engine | | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------------------|
| Description | | | | Done | Comments/Info |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | | ✓ | |
| *Front Axle Group* Front Axle L: 40% R: 40% Rear Axle: L: 40% R: 40% | | | | ✓ | |
| *Rear Axle Group* Fr Axle L: 50% R: 50% Mid Axle: L: 50% R: 50% Rear Axle: L: 80% R: 80% | | | | ✓ | |
| Check park break & breakaway protection | | | | ✓ | |
| Chassis & General | | | | | |
| Grease all grease points | | | | ✓ | |
| Replace any nipples not taking grease | | | | ✓ | |
| Check for air or oil leaks | | | | ✓ | |
| Check air hose & electrical connectors | | | | ✓ | |
| Check Full Chassis for cracks | | | | ✓ | |
| Check load restraint equipment | | | | ✓ | |
| Check all tyres for condition, tread depth & pressure | | | | ✓ | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | ✓ | |
| Check all wheel nuts & nut indicators. | | | | ✓ | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | | ✓ | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | ✓ | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | | ✓ | |
| Check all lights & reflectors | | | | ✓ | |

ENTERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

| | |
|--|--|
| | |
| | |



| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

| Notes |
|-------|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| PJT | 2:45 | 3:30 | -75 | | | | |
| | | | | | | | |

| | | | |
|------------------------------|---|------------------|-----------------------------|
| Service Persons Name: Pat | Signature:  | Date: 18/3/24 | Kilometres/Hours: NO odo |
| Managers Name: JOSH | Signature:  | Date: 20/3/24 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 229



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | | |
|-----------------------------|--------------|-----------------------|--------------------|-------------------------|--|-----------------|------------|
| Fleet # | TR02 | Make | BTE | A | | | |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | | | Date Open | 18/02/2024 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | | | Kilometres Open | |
| Repairer: Internal Workshop | | Engine | | | | Hours Open | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | | |
| Scheduled Date: | | Scheduled Kilometres: | | Scheduled Hours: | | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|-------------|----------------------|----------|
| Description | | | Done | Comments/Info | |
| Brake System | | | | | |
| Check & adjust brakes | | | ✓ | | |
| Check all brake components Report on break pad % | | | ✓ | | |
| *Front Axle Group* Front Axle L: <u>40</u> % R: <u>40</u> % Rear Axle: L: <u>40</u> % R: <u>40</u> % | | | ✓ | | |
| *Rear Axle Group* Fr Axle L: <u>50</u> % R: <u>50</u> % Mid Axle: L: <u>70</u> % R: <u>40</u> % Rear Axle: L: <u>80</u> % R: <u>30</u> % | | | ✓ | | |
| Check park break & breakaway protection | | | ✓ | | |
| Chassis & General | | | | | |
| Grease all grease points | | | ✓ | | |
| Replace any nipples not taking grease | | | ✓ | | |
| Check for air or oil leaks | | | ✓ | | |
| Check air hose & electrical connectors | | | ✓ | | |
| Check Full Chassis for cracks | | | ✓ | | |
| Check load restraint equipment | | | ✓ | | |
| Check all tyres for condition, tread depth & pressure | | | X | | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | ✓ | | |
| Check all wheel nuts & nut indicators. | | | ✓ | | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | ✓ | | |
| Suspension | | | | | |
| Check Suspension assemblies | | | ✓ | | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | ✓ | | |
| Check all lights & reflectors | | | ✓ | | |

ENTERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | | |
|--|--|--|--|
| | | | |
| | | | |

| | | | |
|-----|--|--|--|
| | | | |
| v/s | | | |
| v/s | | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

Notes

First axle LHS Bogie v/s

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 3:30 | 4:00 | .5 | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>[Signature]</i> | Date: <i>19/2/24</i> | Kilometres/Hours: <i>NO odo</i> |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>21/2/24</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 220



EMM Group Echuca - Bulk Freight Trailers

| | | | | | | |
|-----------------|--------------|-------------------------|--------------------|-------------------------|------------|---|
| Fleet # | TR02 | Make | BTE | | | A |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 01/02/2024 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | 0 | |
| Repairer: | | Engine | | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|---|----------------|---------------------|-------------|----------------------|----------|
| Description | | | Done | Comments/Info | |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | | ✓ | |
| *Front Axle Group* Front Axle L: 80% R: 80% Rear Axle: L: 80% R: 80% | | | | ✓ | |
| *Rear Axle Group* Fr Axle L: 80% R: 80% Mid Axle:L: 80% R: 80% Rear Axle: L: 80% R: 80% | | | | ✓ | |
| Check park break & breakaway protection | | | | ✓ | |
| Chassis & General | | | | | |
| Grease all grease points | | | | ✓ | |
| Replace any nipples not taking grease | | | | ✓ | |
| Check for air or oil leaks | | | | ✓ | |
| Check air hose & electrical connectors | | | | ✓ | |
| Check Full Chassis for cracks | | | | ✓ | |
| Check load restraint equipment | | | | ✓ | |
| Check all tyres for condition, tread depth & pressure | | | | ✓ | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | ✓ | |
| Check all wheel nuts & nut indicators. | | | | ✓ | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | | ✓ | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | ✓ | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | | ✓ | |
| Check all lights & reflectors | | | | ✓ | |

ENTERED

| | | | |
|--------------------------------------|----------------------------------|------------------------|------------------------------------|
| Service Persons Name: <i>Paul</i> | Signature: <i>Bertin</i> | Date: <i>6/2/24</i> | Kilometres/Hours: <i>no odo</i> |
| Managers Name: <i>JOSA</i> | Signature: <i>[Signature]</i> | Date: <i>7/2/24</i> | |

The signature above confirms that all items & tasks have been checked, and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 1065 - EMM Group Echuca - Bulk
 Freight Trailers

| | | | | | |
|---------------|--------------|------------|--------------------|-----------------|------------|
| Fleet # | TR02 | Make | BTE | Date Open | 11/12/2023 |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | Kilometres Open | 0 |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Hours Open | 0 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Offset | |
| Location | | Engine | | PO # | |

Description **Done** **Comments/Info**

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|---------|----------|---------------|------------------|
| R-1065 | | | 11/12/2023 | / |

| Assigned to | Priority | Date Scheduled |
|-------------|----------|----------------|
| | Normal | |

Repair Type: Axle **Repairer:** Internal Workshop

| | |
|---|---|
| <p>Repair Description: Bearing let go and damaged axle. replacement parts supplied under warranty</p> | <p>Cause / Notes <i>Removed / Replaced axle / LHS Hub/Rotor and caliper</i></p> |
|---|---|

TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: __/__/__
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|--------------|-------------------------|--------------------|-------------------------|------------|----------|
| Fleet # | TR02 | Make | BTE | | | B |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 22/12/2023 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | 0 | |
| Repairer: Internal Workshop | | Engine | | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | | | |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | X | ✓ | |
| *Front Axle Group* Front Axle L 50% R 50% Rear Axle: L 50% R 50% | | | | ✓ | |
| *Rear Axle Group* Fr Axle L 50% R 50% Mid Axle: L 60% R 50% Rear Axle: L 80% R 90% | | | | ✓ | |
| Check park break & breakaway protection | | | | — | |
| Check brake boosters | | | | ✓ | |
| Chassis & General | | | | | |
| Grease all grease points | | | | ✓ | |
| Replace any nipples not taking grease | | | | ✓ | |
| Check for air or oil leaks | | | | ✓ | |
| Check Air lines & connections | | | | ✓ | |
| Check air hose & electrical connectors | | | | ✓ | |
| Check cross member rails for cracks/damage | | | | ✓ | |
| Check Full Chassis for cracks | | | | ✓ | |
| Check combing rails for cracking or damage | | | | ✓ | |
| Check all wheel bearings for free play | | | | ✓ | |
| Check for overall structural damage and cracking | | | | ✓ | |
| Check load restraint equipment | | | | — | |
| Check all tyres for condition, tread depth & pressure | | | | X | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | ✓ | |
| Check all wheel nuts & nut indicators. | | | | ✓ | |
| Check hoist & hydraulic connections | | | | ✓ | |
| Coupling | | | | | |
| Check drawbar bushes & tow eye | | | | ✓ | |
| Check ringfeeder/turntable condition | | | | ✓ | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | ✓ | |
| Check Air bags for damage | | | | ✓ | |
| Check shock absorbers & straps/guides | | | | ✓ | |
| Check shocker mounts/rubbers | | | | ✓ | |
| Check U-Bolts for torque | | | | ✓ | |
| Check Torque, Radius or Tracking Bushes | | | | ✓ | |
| Lights & Reflectors | | | | | |

ENTERED

| Description | | Done | Comments/Info |
|--------------------------------|-------------|-------------------------------------|---------------|
| Check stick on & flip up signs | | <input checked="" type="checkbox"/> | |
| Check all lights & reflectors | | <input checked="" type="checkbox"/> | |
| Part Number | Description | QTY Used | Parts Bin |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|--------------------------------------|-------------------|---------------|
| R-1065 | | Axle | | Internal Workshop | 11/12/2023 |
| Repair Description: Bearing let go and damaged axle. replacement parts supplied under warranty | | | Cause <i>Replaced axle</i> | | |

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: ___/___/___
 Fault Fixed

| Notes |
|--|
| <i>Rear axle Tri left hand side incorrect caliper installation</i> |
| <i>Dolly left hand side logic V/S - First axle</i> |
| <i>Dolly left hand side inner needs flipping - First axle</i> |

| Notes | | | |
|-------|--|--|--|
| | | | |
| | | | |
| | | | |
| | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 2:00 | 3:05 | 1-26 | | | | |
| | | | | | | | |

| | | | |
|------------------------------|----------------------------------|------------------------------|---|
| Service Persons Name: Pat | Signature: <i>[Signature]</i> | Date: 27/12/23 | Kilometres/Hours: odo does not work |
| Managers Name: JOSH | Signature: <i>[Signature]</i> | Date: 8/1/24 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 182



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|--|--------------|-----------------------|-----------------------|----------------------------|-----------------|----------------------|
| Fleet # | TR02 | Make | BTE | | | A |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 27/11/2023 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | | |
| Repairer: Internal Workshop | | Engine | | Hours Open | | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: | | Scheduled Hours: | | |
| Reminder | | | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval |
| Description | | | | | Done | Comments/Info |
| Brake System | | | | | | |
| Check & adjust brakes | | | | | | ✓ |
| Check all brake components Report on break pad % | | | | | | ✓ |
| *Front Axle Group* Front Axle L: 50% R: 50% Rear Axle: L: 50% R: 50% | | | | | | ✓ |
| *Rear Axle Group* Fr Axle L: 50% R: 50% Mid Axle: L: 50% R: 50% Rear Axle: L: 50% R: 50% | | | | | | ✓ |
| Check park break & breakaway protection | | | | | | - |
| Chassis & General | | | | | | |
| Grease all grease points | | | | | | ✓ |
| Replace any nipples not taking grease | | | | | | ✓ |
| Check for air or oil leaks | | | | | | ✓ |
| Check air hose & electrical connectors | | | | | | ✓ |
| Check Full Chassis for cracks | | | | | | ✓ |
| Check load restraint equipment | | | | | | - |
| Check all tyres for condition, tread depth & pressure | | | | | | ✗ |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | | | ✓ |
| Check all wheel nuts & nut indicators. | | | | | | ✓ |
| Coupling | | | | | | |
| Check ringfeeder/turntable condition | | | | | | ✓ |
| Suspension | | | | | | |
| Check Suspension assemblies | | | | | | ✗ |
| Lights & Reflectors | | | | | | |
| Check stick on & flip up signs | | | | | | ✓ |
| Check all lights & reflectors | | | | | | ✓ |

ENTERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

| | |
|--|--|
| | |
| | |

| | | |
|-----|--|--|
| U/S | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

Notes

LIFT up AXLE LHS inner side wall Tears ALL THE way
 Round - Replaced
 Replaced dolly LHS Rear AXLE Air Bag

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------------------------|--------|-------|------|-------|--------|-------|
| PAT | 4:30 4:45 | 5:15 | .75 | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|--------------------------|-------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>[Signature]</i> | Date: <i>28/11/23</i> | Kilometres/Hours: |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>1/12/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



ENTERED



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | | |
|-----------------------------|--------------|-----------------------|--------------------|-------------------------|--|-----------------|------------|
| Fleet # | TR02 | Make | BTE | A | | | |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | | | Date Open | 23/10/2023 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | | | Kilometres Open | |
| Repairer: Internal Workshop | | Engine | | Hours Open | | | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | | |
| Scheduled Date: | | Scheduled Kilometres: | | Scheduled Hours: | | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | Done | Comments/Info | |
| Brake System | | | | | |
| Check & adjust brakes | | | ✓ | | |
| Check all brake components Report on break pad % | | | / | | |
| *Front Axle Group* Front Axle L: 60 % R: 60 % Rear Axle: L: 50 % R: 50 % | | | / | | |
| *Rear Axle Group* Fr Axle L: 60 % R: 60 % Mid Axle: L: 50 % R: 50 % Rear Axle: L: 50 % R: 50 % | | | / | | |
| Check park break & breakaway protection | | | — | | |
| Chassis & General | | | | | |
| Grease all grease points | | | / | | |
| Replace any nipples not taking grease | | | / | | |
| Check for air or oil leaks | | | / | | |
| Check air hose & electrical connectors | | | / | | |
| Check Full Chassis for cracks | | | / | | |
| Check load restraint equipment | | | — | | |
| Check all tyres for condition, tread depth & pressure | | | / | | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | / | | |
| Check all wheel nuts & nut indicators. | | | / | | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | / | | |
| Suspension | | | | | |
| Check Suspension assemblies | | | / | | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | / | | |
| Check all lights & reflectors | | | / | | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |
| | | | |

| Notes |
|-------|
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| PAT | 6:45 | 7:30 | .75 | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|--------------------------|------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>Pat</i> | Date: <i>30/10/23</i> | Kilometres/Hours: <i>NO odo</i> |
| Managers Name: <i>JO SA</i> | Signature: <i>[Signature]</i> | Date: <i>3/11/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 107



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|--------------|-------------------------|--------------------|-------------------------|------------|----------|
| Fleet # | TR02 | Make | BTE | | | B |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 04/09/2023 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | 0 | |
| Repairer: Internal Workshop | | Engine | | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------------------|
| Description | | | | Done | Comments/Info |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | | ✓ | |
| *Front Axle Group* Front Axle L: 80 % R: 80 % Rear Axle: L: 80 % R: 80 % | | | | ✓ | |
| *Rear Axle Group* Fr Axle L: 80 % R: 80 % Mid Axle: L: 70 % R: 70 % Rear Axle: L: 70 % R: 70 % | | | | ✓ | |
| Check park break & breakaway protection | | | | ✓ | |
| Check brake boosters | | | | ✓ | |
| Chassis & General | | | | | |
| Grease all grease points | | | | ✓ | |
| Replace any nipples not taking grease | | | | ✓ | |
| Check for air or oil leaks | | | | ✓ | |
| Check Air lines & connections | | | | ✓ | |
| Check air hose & electrical connectors | | | | ✓ | |
| Check cross member rails for cracks/damage | | | | ✓ | |
| Check Full Chassis for cracks | | | | ✓ | |
| Check combing railles for crakcing or damage | | | | ✓ | |
| Check all wheel bearings for free play | | | | ✓ | |
| Check for overall structural damage and cracking | | | | ✓ | |
| Check load restraint equipment | | | | ✓ | |
| Check all tyres for condition, tread depth & pressure | | | | ✓ | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | ✓ | |
| Check all wheel nuts & nut indicators. | | | | ✓ | |
| Check hoist & hydraulic connections | | | | ✓ | |
| Coupling | | | | | |
| Check drawbar bushes & tow eye | | | | ✓ | |
| Check ringfeeder/turtable condition | | | | ✓ | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | ✓ | |
| Check Air bags for damage | | | | ✓ | |
| Check shock absorbers & straps/guides | | | | ✓ | |
| Check shocker mounts/rubbers | | | | ✓ | |
| Check U-Bolts for torque | | | | ✓ | |
| Check Torque, Radius or Tracking Bushes | | | | ✓ | |
| Lights & Reflectors | | | | | |

| Description | | Done | Comments/Info |
|--------------------------------|-------------|----------|---------------|
| Check stick on & flip up signs | | ✓ | |
| Check all lights & reflectors | | ✓ | |
| Part Number | Description | QTY Used | Parts Bin |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | | |
|--|--|--|--|
| | | | |
| | | | |

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

Notes

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Paul | 12:30 | 1:45 | 0.75 | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|-------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>Pat</i> | Date: <i>4/10/23</i> | Kilometres/Hours: <i>208 770</i> |
| Managers Name: <i>JOSH</i> | Signature: <i>[Signature]</i> | Date: <i>4/10/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 145



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|--------------|-------------------------|--------------------|-------------------------|------------|----------|
| Fleet # | TR02 | Make | BTE | | | A |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 27/09/2023 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | 0 | |
| Repairer: Internal Workshop | | Engine | | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------------------|
| Description | | | | Done | Comments/Info |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | | ✓ | |
| *Front Axle Group* Front Axle L: 60 % R: 60 % Rear Axle: L: 60 % R: 60 % | | | | ✓ | |
| *Rear Axle Group* Fr Axle L: 60 % R: 60 % Mid Axle: L: 50 % R: 50 % Rear Axle: L: 50 % R: 50 % | | | | ✓ | |
| Check park break & breakaway protection | | | | | |
| Chassis & General | | | | | |
| Grease all grease points | | | | / | |
| Replace any nipples not taking grease | | | | / | |
| Check for air or oil leaks | | | | / | |
| Check air hose & electrical connectors | | | | / | |
| Check Full Chassis for cracks | | | | ✓ | |
| Check load restraint equipment | | | | N/A | |
| Check all tyres for condition, tread depth & pressure | | | | X | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | / | |
| Check all wheel nuts & nut indicators. | | | | ✓ | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | | / | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | X | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | | / | |
| Check all lights & reflectors | | | | / | |

TERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

Notes

RHS LEFT up axle pivot Bush bolt loose

TIGHTENED NOW MONITOR

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 7:00 | 7:45 | .75 | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|------------------------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>Pat</i> | Date: <i>5/10/23</i> | Kilometres/Hours: <i>No odo</i> |
| Managers Name: <i>Josa</i> | Signature: <i>[Signature]</i> | Date: <i>5/10/23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 484 - EMM Group Echuca - Bulk Freight



| | | | | | |
|---------------|--------------|------------|--------------------|-----------------|------------|
| Fleet # | TR02 | Make | BTE | Date Open | 31/07/2023 |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | Kilometres Open | 0 |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Hours Open | 0 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Offset | |
| Location | | Engine | | PO # | |

| | | | | | |
|-------------|--|--|--|------|---------------|
| Description | | | | Done | Comments/Info |
|-------------|--|--|--|------|---------------|

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|---------|----------|---------------|------------------|
| R-484 | | | 31/07/2023 | Josh Taylor / |

| Assigned to | Priority | Date Scheduled |
|----------------|----------|----------------|
| Patrick Turner | Normal | |

| | |
|---------------------|-----------------------------|
| Repair Type: Brakes | Repairer: Internal Workshop |
|---------------------|-----------------------------|

| | |
|--|--|
| Repair Description: Excessive wear to pads | Cause / Notes <i>Replaced All Brake pads</i> |
|--|--|

TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts

No Repair Required

Defer To: _ / _ / _

Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

ENTERED

Notes

TYRES TO Be replaced / Rotated
 wheel alignment required - Bolts to Be torqued

| | | | | | |
|------|--|--|--|--|--|
| Flip | | | | | |
| | | | | | |

| | | | | | | |
|--|--|------------------------------------|-----|--|----------------------|--|
| | | Replace/Rotate Replace cut in wall | | | Replace cuts in wall | |
| | | V/S | | | V/S | |
| | | V/S | V/S | | V/S | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|----------------|-------------------|------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date 31/7/23 | Signed <i>Pat</i> | Date | Signed |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|---------------------------|-------|-------------------------------|-------|---------------|-------|-----------------------------------|-------|
| Pat | 7:00 | 10:00 | 3HRS | | | | |
| Service Persons Name: Pat | | Signature: <i>Pat</i> | | Date: 31/7/23 | | Kilometres/Hours: 000 not working | |
| Managers Name: JOSH | | Signature: <i>[Signature]</i> | | Date: 31/7/23 | | | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 87



EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|--------------|-------------------------|--------------------|-------------------------|------------|---|
| Fleet # | TR02 | Make | BTE | | | A |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 24/07/2023 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | 0 | |
| Repairer: Internal Workshop | | Engine | | Hours Open | 0 | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: 0 | | Scheduled Hours: 0 | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|-------------|----------------------|----------|
| Description | | | Done | Comments/Info | |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | | ✓ | |
| *Front Axle Group* Front Axle L: <u>20</u> % R: <u>20</u> % Rear Axle: L: <u>20</u> % R: <u>20</u> % | | | | ✓ | |
| *Rear Axle Group* Fr Axle L: <u>40</u> % R: <u>40</u> % Mid Axle: L: <u>40</u> % R: <u>40</u> % Rear Axle: L: <u>40</u> % R: <u>40</u> % | | | | ✓ | |
| Check park break & breakaway protection | | | | | |
| Chassis & General | | | | | |
| Grease all grease points | | | | / | |
| Replace any nipples not taking grease | | | | / | |
| Check for air or oil leaks | | | | / | |
| Check air hose & electrical connectors | | | | / | |
| Check Full Chassis for cracks | | | | / | |
| Check load restraint equipment | | | | | |
| Check all tyres for condition, tread depth & pressure | | | | X | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | / | |
| Check all wheel nuts & nut indicators. | | | | | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | | ✓ | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | X | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | | ✓ | |
| Check all lights & reflectors | | | | / | |

ENTERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|-------------|-----|
| Cent Inwall | U/S |
| | U/S |

| | | |
|--------|--|--|
| Rotate | | |
| | | |

| | |
|-----|-----|
| U/S | U/S |
| U/S | U/S |

| | | |
|--|--------|--|
| | Rotate | |
| | Rotate | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| Wheels Removed | | Date Retightened | |
|----------------|--------|------------------|--------|
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|---|----------|---------------|
| R-204 | 111 | | | | 30/05/2023 |
| Repair Description: Not Working. . Lift axle not raising ABS trailer light illuminated | | | Cause Air Brake Australia 24/7/23 | | |



TICK THE BOX FOR THE ACTION TAKEN

Awaiting Parts
 No Repair Required
 Defer To: _/ _/ _
 Fault Fixed

| Notes |
|--|
| shockers Failed - Replace AS soon as possible |
| See Trailer TYRE Diagram TYRES TO replace / Rotate |
| |
| |
| |
| |

Notes

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 1006 | 10145 | -7542 | | | | |
| | | | | | | | |

| | | | |
|------------------------------|--|------------------|-------------------|
| Service Persons Name: Pat | Signature:  | Date: 25/7/23 | Kilometres/Hours: |
| Managers Name: Josa | Signature:  | Date: 25/7/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Service Jobcard - 58

ENTERED

EMM Group Echuca - Bulk Freight Trailers

Assigned to: Patrick Turner

| | | | | | | |
|-----------------------------|--------------|-----------------------|--------------------|-------------------------|------------|----------|
| Fleet # | TR02 | Make | BTE | | | A |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Date Open | 13/06/2023 | |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Kilometres Open | | |
| Repairer: Internal Workshop | | Engine | | Hours Open | | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | |
| Scheduled Date: | | Scheduled Kilometres: | | Scheduled Hours: | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|----------|
| Description | | | Done | Comments/Info | |
| Brake System | | | | | |
| Check & adjust brakes | | | | ✓ | |
| Check all brake components Report on break pad % | | | | ✓ | |
| *Front Axle Group* Front Axle L: <u>30</u> % R: <u>30</u> % Rear Axle: L: <u>40</u> % R: <u>40</u> % | | | | ✓ | |
| *Rear Axle Group* Fr Axle L: <u>50</u> % R: <u>50</u> % Mid Axle: L: <u>50</u> % R: <u>50</u> % Rear Axle: L: <u>50</u> % R: <u>50</u> % | | | | ✓ | |
| Check park break & breakaway protection | | | | | |
| Chassis & General | | | | | |
| Grease all grease points | | | | ✓ | |
| Replace any nipples not taking grease | | | | ✓ | |
| Check for air or oil leaks | | | | ✓ | |
| Check air hose & electrical connectors | | | | ✓ | |
| Check Full Chassis for cracks | | | | ✓ | |
| Check load restraint equipment | | | | | |
| Check all tyres for condition, tread depth & pressure | | | | X | |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | | ✓ | |
| Check all wheel nuts & nut indicators. | | | | ✓ | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | | ✓ | |
| Suspension | | | | | |
| Check Suspension assemblies | | | | X | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | | ✓ | |
| Check all lights & reflectors | | | | ✓ | |

PAT TO RING RE BRAKE PLUG IN

ENTERED

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
| | | | | | | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|----------------|--------|------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

| Repair # | Fault # | Repair Type | Reported to/by | Repairer | Date Reported |
|--|---------|-------------|----------------|----------|---------------|
| R-204 | 111 | | | | 30/05/2023 |
| Repair Description: | | | Cause | | |
| Not Working. . Lift axle not raising ABS trailer light illuminated | | | | | |

TICK THE BOX FOR THE ACTION TAKEN



- Awaiting Parts
 No Repair Required
 Defer To: / /
 Fault Fixed

Refer to note

| Notes |
|---|
| <i>ABS Fault Require computer to plug in - check Brake pressure</i> |
| <i>3rd AXLE For RHS Rear pivot plate and nut missing Bush worn</i> |
| <i>various axle pivot Bolts loose</i> |
| <i>TYRES marked on sheet for Replace / swap</i> |
| <i>various shockers u/s</i> |
| <i>odo not working need parts to replace</i> |

Notes

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| Pat | 3:15 | 4:15 | 1HR | | | | |
| | | | | | | | |

| | | | |
|------------------------------|---|------------------|-------------------|
| Service Persons Name: Pat | Signature:  | Date: 15/6/23 | Kilometres/Hours: |
| Managers Name: JOSH | Signature:  | Date: 12/7/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.



Repair Jobcard - 205 - EMM Group Echuca - Bulk Freight

| | | | | | |
|---------------|--------------|------------|--------------------|-----------------|------------|
| Fleet # | TR02 | Make | BTE | Date Open | 01/06/2023 |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | Kilometres Open | 0 |
| Fault Number | | VIN | 6T9T24V86J08KT114 | Hours Open | 0 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | Offset | |
| Location | | Engine | | PO # | 08053 |

| | | |
|--------------------|-------------|----------------------|
| Description | Done | Comments/Info |
|--------------------|-------------|----------------------|

| Repair # | Fault # | Defect # | Reported Date | Reported by / to |
|----------|---------|----------|---------------|------------------|
| R-205 | | | 01/06/2023 | / |

| Assigned to | Priority | Date Scheduled |
|-------------|----------|----------------|
| | Urgent | |

| | |
|--|----------------------------------|
| Repair Type: Tyres | Repairer: Mayes Tyrepower |
| Repair Description: Wire showing on dolly tyre | Cause / Notes |


TICK THE BOX FOR THE ACTION TAKEN

- Awaiting Parts
 No Repair Required
 Defer To: _/_/_
 Fault Fixed

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notes

SWAPPED WITH RUN OUT

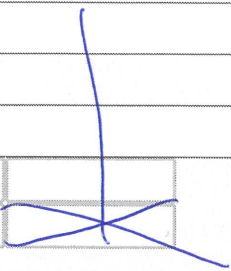

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
|--|--|--|--|--|--|--|--|

| | | | | | | | |
|--|--|--|--|--|--|--|--|
| | | | | | | | |
|--|--|--|--|--|--|--|--|

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | | | | | |
|-----------------------|--------|--|------|-------------------------|--|--|--|
| Wheels Removed | | | | Date Retightened | | | |
| Date | Signed | | Date | Signed | | | |

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|-------|------|-------|--------|-------|
| | | | | | | | |

| | | | |
|--|----------------|------------------------|-------------------|
| Service Persons Name: MAYES TYRE POWER | Signature: | Date: 2/6/23 | Kilometres/Hours: |
| Managers Name: JOSH | Signature: | Date: 2/6/23 | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.

ENTERED



Service Jobcard - 28

EMM Group Echuca - Bulk Freight Trailers

Assigned to: **Patrick Turner**

| | | | | | | | |
|-----------------------------|--------------|-----------------------|--------------------|-------------------------|--|-----------------|------------|
| Fleet # | TR02 | Make | BTE | A | | | |
| Registration | YV86BQ | Model | 5 Axle Dog Trailer | | | | |
| Fault Number | | VIN | 6T9T24V86J08KT114 | | | Date Open | 10/05/2023 |
| Service Group | Bulk Trailer | Build Date | 10/2018 | | | Kilometres Open | |
| Repairer: Internal Workshop | | Engine | | Hours Open | | | |
| Location | | PO # | | Offset: 0.0 Km, 0.0 hrs | | | |
| Scheduled Date: | | Scheduled Kilometres: | | Scheduled Hours: | | | |

| Reminder | Kilometres Due | Kilometres Interval | Hour Due | Hour Interval | Date Due |
|--|----------------|---------------------|----------|---------------|------------|
| Description | Done | Comments/Info | | | |
| Brake System | | | | | |
| Check & adjust brakes | | | ✓ | | |
| Check all brake components Report on break pad % | | | ✓ | | |
| *Front Axle Group* Front Axle L: 60 % R: 60 % Rear Axle: L: 60 % R: 60 % | | | ✓ | | |
| *Rear Axle Group* Fr Axle L: 60 % R: 60 % Mid Axle: L: 60 % R: 60 % Rear Axle: L: 60 % R: 60 % | | | ✓ | | |
| Check park break & breakaway protection | | | ✓ | | |
| Chassis & General | | | | | |
| Grease all grease points | | | ✓ | | |
| Replace any nipples not taking grease | | | ✓ | | |
| Check for air or oil leaks | | | ✓ | | |
| Check air hose & electrical connectors | | | ✓ | | |
| Check Full Chassis for cracks | | | ✓ | | |
| Check load restraint equipment | | | ✓ | | |
| Check all tyres for condition, tread depth & pressure | | | X | | TYRES worn |
| Check Wheel guards & mudflaps are suitably secured and suitable for use. | | | ✓ | | |
| Check all wheel nuts & nut indicators. | | | ✓ | | |
| Coupling | | | | | |
| Check ringfeeder/turntable condition | | | ✓ | | |
| Suspension | | | | | |
| Check Suspension assemblies | | | X | | |
| Lights & Reflectors | | | | | |
| Check stick on & flip up signs | | | | | |
| Check all lights & reflectors | | | ✓ | | |

| Part Number | Description | QTY Used | Parts Bin |
|-------------|-------------|----------|-----------|
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

| | |
|--|--|
| | |
| | |

| | | |
|--|--|--|
| | | |
| | | |

Axle1 Axle2 Axle3 Axle4 Axle5 Axle6 Axle7 Axle8

| | | | |
|-----------------------|--------|-------------------------|--------|
| Wheels Removed | | Date Retightened | |
| Date | Signed | Date | Signed |

Notes

Replaced middle axle RHS ABS sensor
 waiting on GX shockers for 3 AXLES on rear
 monitor TYRES on Dolly and middle AXLE LHS inner

| Name | Start | Finish | Total | Name | Start | Finish | Total |
|------|-------|--------|---------|------|-------|--------|-------|
| PaT | 8:00 | 8:45 | 0.75 HR | | | | |
| | | | | | | | |

| | | | |
|-------------------------------------|----------------------------------|-------------------------|-------------------|
| Service Persons Name: <i>Pat</i> | Signature: <i>[Signature]</i> | Date: <i>13/5/23</i> | Kilometres/Hours: |
| Managers Name: <i>Adam</i> | Signature: <i>[Signature]</i> | Date: <i>13.5.23</i> | |

The signature above confirms that all items & tasks have been checked and completed and authorises vehicle and equipment for return to service. Service Providers are to use these checklists when carrying out services/repairs on all units. Completed checklists are forwarded to the operator & filed for review/audit purposes.

EMMGROUP

TRAILER A SERVICE & INSPECTION

Date: 25-8-22 Rego: YV86BQ

Recommendations

- Check Tire Tread Depth & Condition _____
- Check Hub Fluid Levels _____
- Check Pins and Bushes _____
- Check for Air Leaks _____
- Check for Axle Seal Leaks _____
- Grease All Grease Fittings _____
- Check Suspension suspension bushes have little movement
- Steering and All Components _____

Check Brake Condition

| | | | | |
|------------------|--------------|----------------|----------------|----------------|
| Front One Axle - | RI _____ | , RO _____ | , LI _____ | , LO _____ |
| Front Two Axle - | RI <u>50</u> | , RO <u>50</u> | , LI <u>50</u> | , LO <u>50</u> |
| Back One Axle - | RI _____ | , RO _____ | , LI _____ | , LO _____ |
| Back Two Axle - | RI _____ | , RO _____ | , LI _____ | , LO _____ |

TECHNICIAN REMARKS

RHR Reverse light work

Tarp rear LH starting to tip

LH Axle Air ~~is~~ missing

Rear Axle tyer replaced ✓

Front RH Air bag leaking ✓

TRAILER WARRANTY CLAIM

Claim Number:



| | | | |
|---|---|---|--|
| Date: 19-11-20 | | Vehicle manufacturer: BTE | |
| REPAIRER | | VEHICLE OWNER | |
| Company EMM Group | | Company EMM Group | |
| Street Address 26-42 Old Aerodrome Rd | | Street Address 26-42 Old Aerodrome Rd | |
| Town EchUCA | | Town EchUCA | |
| State Victoria Postcode 3656 | | State Victoria Postcode 3654 | |
| Contact name Jamie | | Contact name adam | |
| Phone number 0431163837 Fax: 0354825088 | | Phone number 0428580026 Fax: 0354825088 | |
| Email: admin@emmgroup.com.au | | Email: admin@emmgroup.com.au | |
| Registration No: XV 86 BQ | Build date: (From VIN plate) 10-2018 | | |
| Chassis No/VIN: 6T9124V86J08K114 | KM in service (read out from HUBO) 306104 | | |

DETAILS OF WORK: Remove & Replace hub on Left front Axle of Dolly, has 5mm play in bearing & noisy

| Item | Part number | Description | QTY | Labor code | Labor Hours | Labor rate charged \$/hr | Replacement part to be issued (Y or N) |
|------|-------------|-------------|-----|------------|-------------|--------------------------|--|
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |
| | | | | | | \$ | |

| | | | |
|---|--|---|--|
| Axle type: <input checked="" type="checkbox"/> Disc <input type="checkbox"/> Drum Suspension: <input type="checkbox"/> Intra <input type="checkbox"/> Modul <input type="checkbox"/> Duratrac <input type="checkbox"/> Tec1 <input type="checkbox"/> MT75 <input type="checkbox"/> Tec2 <input type="checkbox"/> YTE/YTB90 <input type="checkbox"/> YTE115 Underslung <input type="checkbox"/> Overslung <input type="checkbox"/> EBS: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Tyre size: 11R 22.5 <input type="checkbox"/> Single <input checked="" type="checkbox"/> Dual | Vehicle Type <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Other | Body Type <input checked="" type="checkbox"/> Tipper <input type="checkbox"/> Special <input type="checkbox"/> Box/Curtain side <input type="checkbox"/> Flatbed <input type="checkbox"/> Concrete mixer <input type="checkbox"/> Tanker <input type="checkbox"/> Silo <input type="checkbox"/> Demountable <input type="checkbox"/> Low loader <input type="checkbox"/> Other | Operational Use <input checked="" type="checkbox"/> Normal (On-road) <input type="checkbox"/> Demanding (Some off road) <input type="checkbox"/> Server (Off Road) |
|---|--|---|--|

| AXLE DETAILS | | | | | | | | | | | |
|--------------|-----------|-------------|-------------------------------------|--------------------------|--------------------------|------|-----------|--|--------------------------|--------------------------|--------------------------|
| Axle | Serial No | | Position on vehicle | | | Axle | Serial No | | Position on vehicle | | |
| | | | Left | Right | Axle Lift | | | | Left | Right | Axle Lift |
| 1st | Old | 37001169 | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | 4th | Old | | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| | New | 7018-163841 | | | | | New | | | | |
| 2nd | Old | | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | 5th | Old | | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| | New | | | | | | New | | | | |
| 3rd | Old | | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | 6th | Old | | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| | New | | | | | | New | | | | |

Work done by:
 Print name:
 Sign: _____ Date of repairs:

EMMGROUP

TRAILER A SERVICE & INSPECTION

Date: 27-10-20 Rego: YV86 BQ

Recommendations

- Check Tire Tread Depth & Condition 2 Need charging / Rstated
- Check Hub Fluid Levels _____
- Check Pins and Bushes _____
- Check for Air Leaks _____
- Check for Axle Seal Leaks _____
- Grease All Grease Fittings _____
- Check Suspension _____
- Steering and All Components _____

Check Brake Condition

| | | | | | | | | |
|------------------|----|--------------|------|--------------|------|-----------|------|--------------|
| Front One Axle - | RI | <u>10</u> | , RO | <u>10</u> | , LI | <u>10</u> | , LO | <u>10</u> |
| Front Two Axle - | RI | <u>10-20</u> | , RO | <u>10-20</u> | , LI | <u>10</u> | , LO | <u>10-20</u> |
| Back One Axle - | RI | <u>10-20</u> | , RO | <u>10-20</u> | , LI | <u>10</u> | , LO | <u>10-20</u> |
| Back Two Axle - | RI | <u>0-5</u> | , RO | <u>x</u> | , LI | <u>20</u> | , LO | <u>20</u> |

TECHNICIAN REMARKS

RHC note v/s

Ring Feed Bush

2x White Reflectors v/s Replaced

1x orange reflector v/s

Rear mudflaps

Warp Belts starting to wear

* Full brake reline due soon *

EMMGROUP

TRAILER A SERVICE & INSPECTION

Date: 14-7-20 Rego: 244365 YV 86BQ

Recommendations

- Check Tire Tread Depth & Condition _____
- Check Hub Fluid Levels _____
- Check Pins and Bushes _____
- Check for Air Leaks _____
- Check for Axle Seal Leaks _____
- Grease All Grease Fittings _____
- Check Suspension _____
- Steering and All Components _____

Check Brake Condition

| | | | | |
|------------------|----------------|----------------|----------------|--------------|
| Front One Axle - | RI _____, | RO _____, | LI _____, | LO _____ |
| Front Two Axle - | RI <u>40</u> , | RO <u>40</u> , | LI <u>40</u> , | LO <u>40</u> |
| Back One Axle - | RI _____, | RO _____, | LI _____, | LO _____ |
| Back Two Axle - | RI <u>50</u> , | RO <u>50</u> , | LI <u>50</u> , | LO <u>50</u> |

TECHNICIAN REMARKS

ENTERED

XV9080 Hail

EMMGROUP

TRAILER A SERVICE & INSPECTION

Date: 17-1-20 Rego: _____

Recommendations

- Check Tire Tread Depth & Condition _____
- Check Hub Fluid Levels _____
- Check Pins and Bushes _____
- Check for Air Leaks _____
- Check for Axle Seal Leaks _____
- Grease All Grease Fittings _____
- Check Suspension _____
- Steering and All Components _____

Check Brake Condition

| | | | | |
|------------------|----------------|----------------|----------------|--------------|
| Front One Axle - | RI _____, | RO _____, | LI _____, | LO _____ |
| Front Two Axle - | RI <u>80</u> , | RO <u>80</u> , | LI <u>80</u> , | LO <u>80</u> |
| Back One Axle - | RI <u>80</u> , | RO <u>80</u> , | LI <u>80</u> , | LO <u>80</u> |
| Back Two Axle - | RI _____, | RO _____, | LI _____, | LO _____ |

TECHNICIAN REMARKS

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Trailer
Serial Number/ Rego: YV86BQ | truck xvgpbd
Model/ Make: BTE

Date: 25, 8, 22

Hours: _____

03919

Work carried out: carried out service AS Req

Replaced RH front Air bag AS it was leaking

Got Tyres on rear axle Replaced

PARTS USED

| Qty | Description | Notes |
|-----|-------------|------------------|
| | | <u>1 1/2 hrs</u> |
| | | <u>\$97.5</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 25, 8, 22

Signature:

EQUIPMENT MAINTENANCE LOG



Name of Equipment: _____

Serial Number/ Rego: XV90BD

Date: 3 / 12 / 2022

Model/ Make: BTE Trailer

Hours: _____

03935

Work carried out: _____ *Plan*

*Carried out warranty repairs on AXLE PIVOT
Bushes*

5 HRS

carried out A service

1.5 HR

ENTERED

PARTS USED

| Qty | Description | Notes |
|-----|-------------|----------------|
| | | <u>6-5 HRS</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: Pat

Date: 3 / 11 / 2022

Signature: _____

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tipper
Serial Number/ Rego: XV90BD
Model/ Make: Kenworth

Date: 13 / 5 / 22

Hours: 509080

02665

Work carried out: _____

Replaced Ah belts

PARTS USED

| Qty | Description | Notes |
|-----|----------------|----------------|
| | | <u>30 min</u> |
| | | <u>\$32.50</u> |
| | ENTERED | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 13 / 5 / 22

Signature: *[Signature]*

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tipper
Serial Number/ Rego: XV90BD
Model/ Make: Kenworth

Date: 23 / 5 / 22
Hours: 512800

02676

Work carried out: Found Truck had Derated
Took to kenworth got truck plugged into
found DPF sensor had failed. so replaced
& updated. then updated ECM & cleared
codes Road tested found ok.

ENTERED

PARTS USED

| Qty | Description | Notes |
|-----|-------------|-------|
| | | 4 hrs |
| | | \$280 |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 23 / 5 / 22

Signature: [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tipper

Serial Number/ Rego: XV90BD

Model/ Make: Kenworth

Date: 6 / 5 / 22

Hours: 509400

02652

Work carried out: _____

Removed & Replaced Treadle valve & Road
Tested found it still no good

TERED

PARTS USED


| Qty | Description | Notes |
|-----|-------------|-------|
| | | 5 hrs |
| | | \$325 |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 6 / 5 / 22

Signature: [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: TIPPER

Serial Number/ Rego: XV90BD

Model/ Make: Kenworth

Date: 4 / 4 / 22

Hours: 496883

02617

Work carried out: _____

carried out Grease & Adjust AS Req

PARTS USED

ENTERED


| Qty | Description | Notes |
|-----|-------------|------------|
| | | <u>1hr</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 4 / 4 / 22

Signature: [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Trailer

Serial Number/ Rego: YV86BQ

Model/ Make: BTE

Date: 31 / 1 / 22

Hours: _____

02120

Work carried out: _____

Removed & Replaced LHR Guards.

Re-wired Reverse Light

ENTERED

PARTS USED


| Qty | Description | Notes |
|-----|-------------|-------------|
| | | <u>1245</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 31 / 1 / 22

Signature: J. [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tipper

Serial Number/ Rego: XV 90 BD

Model/ Make: Kenworth

Date: 14/10/21

Hours: 435930

02253

Work carried out: _____

Grease & Adjust Brakes

PARTS USED

| Qty | Description | Notes |
|-----|-------------|--------|
| | | 45 min |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

ENTERED

Name: _____

Date: 14/10/21

Signature: *[Signature]*

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tippe

Serial Number/ Rego: XV90BD

Model/ Make: kenworth

Date: 30 / 9 / 21

Hours: 429799

02245

Work carried out: _____

Replaced wiper Blades

ENTERED

PARTS USED

| Qty | Description | Notes |
|-----|-------------|---------------|
| | | <u>10 min</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 30 / 9 / 21

Signature: [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tippu

Serial Number/ Rego: XV90BD

Model/ Make: Kenworth

Date: 21/9/21

Hours: 427012

02234

Work carried out: _____

Adjusted clutch

ENTERED

PARTS USED


| Qty | Description | Notes |
|-----|-------------|-------------|
| | | <u>20MB</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 21/9/21

Signature: [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Tipper

Serial Number/ Rego: XV90BD

Model/ Make: John Deere

Date: 30/8/21

Hours: 417192

02206

Work carried out: _____

Greased & adjusted Brakes

Replaced ring feeder tow eye bush

ENTERED

PARTS USED


| Qty | Description | Notes |
|-----|-------------|----------------|
| | | <u>1.5 hrs</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Signature: [Signature]

Date: 30/8/21

EQUIPMENT MAINTENANCE LOG



Name of Equipment: VV86BD

Serial Number/ Rego: _____

Model/ Make: BTE Trailer

Date: 4/16/21

Hours: 381368

02018

Work carried out: _____

Fitted New Reverse lights & Replaced blown
fuse in dash for reverse lights

PARTS USED

| Qty | Description | Notes |
|-----|-------------|-------------|
| | | <u>7 hr</u> |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

Name: _____

Date: 4/16/21

Signature: [Signature]

EQUIPMENT MAINTENANCE LOG



Name of Equipment: Trailer

Serial Number/ Rego: XV86BQ

Model/ Make: BTe

Date: 4 15 12

Hours: 367633

02582

Work carried out: _____

Refit horse hair to LH rear of trailer

PARTS USED

| Qty | Description | Notes |
|-----|-------------|--------|
| | | 30 min |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

ENTERED

Name: _____

Date: 4 15 12

Signature: Shane