



CERTIFICATE NUMBER

**Commercial Vehicle Inspection Certificate
Traffic Safety Act**

H01-56

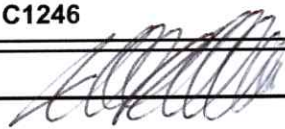
**PART 1 - VEHICLE OWNER AND VEHICLE
IDENTIFICATION**

Vehicle Type:	Truck	Seating Capacity:	
GVW:	63500 kg	Brake Type:	Air
Owner Name:	Kropp Contracting Ltd.		
Address:	Box 237		
City:	Slave Lake	Province:	AB
Postal Code:	T0G2A0		
Telephone Number:	(780) 849-6229		
Vehicle Identification Number:	1NKDX4EX5LR963954		
Make:	Kenworth	Model:	Construct
Year:	2020	Unit Number:	280
Odometer:	749915 KM	Licence Plate Number:	U00888
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Kropp Contracting Ltd.	18733
Inspection Technician Name:	Technician Number:
Westley Nadeau	C1246
Inspection Technician Signature:	
Inspection Date:	2026/06/05

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle		Gross Vehicle Weight registered	
		kg	
Vehicle Information			
VIN	1 N K D X 4 E X 5 L R 9 6 3 9 5 4		
Unit Number	Year	Make	Model
280	2020	Kenworth	T800
Registered Owner's Name			Odometer
Kropp Contracting			749915
Address			Plate Number
Box 237			U-00888
Postal Code		Phone Number	
T0G 2A0			

LEFT		FRONT		RIGHT	
100 psi 17 mm	16.543 mm 11/16 mm 1.5 mm 60°	Drums/Rotors Linings/Pads Push Rod Travel Cam Rotation	16.540 mm 11/16 mm 1.5 mm 65°	100 psi 19 mm	
100 psi 32 mm	new mm new mm 1.5 mm	Drums/Rotors Linings/Pads Push Rod Travel Cam Rotation	new mm new mm 1.5 mm	100 psi 32 mm	100 psi 32 mm
100 psi 32 mm	16.534 mm 3/4 mm 1.5 mm	Drums/Rotors Linings/Pads Push Rod Travel Cam Rotation	new mm 3/4 mm 1.5 mm	100 psi 32 mm	100 psi 32 mm
100 psi 32 mm	new mm new mm 1.5 mm	Drums/Rotors Linings/Pads Push Rod Travel Cam Rotation	new mm new mm 1.5 mm	100 psi 32 mm	100 psi 32 mm
psi mm	mm Drums/Rotors mm Linings/Pads mm Push Rod Travel mm Cam Rotation		mm Drums/Rotors mm Linings/Pads mm Push Rod Travel mm Cam Rotation	psi mm	psi mm
Park Brake Lining Left mm Right mm Trans mm Wheel Torque Checked ☒ Inner ft lbs Outer 500 ft lbs					

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 1 - Power Train						
Component	P	F	NA	Component	P	F NA
1.1. Accelerator Pedal/Throttle Actuator	✓			1.8. Engine Start Safety Feature	✓	
1.2. Exhaust System	✓			1.9. Gear Position Indicator	✓	
1.3. Emission Control Systems and Devices	✓			1.10. Engine or Accessory Drive Belt		
1.4. Drive Shaft	✓			1.11. Hybrid Electric Vehicle & Electric Vehicle Power Train System		✓
1.5. Clutch and Clutch Pedal	✓			1.12. Gasoline or Diesel Fuel System	✓	
1.6. Engine/Transmission Mount	✓			1.13. Pressurized or Liquefied Fuel System (LPG, CNG, & LNG)		✓
1.7. Engine/Shut Down	✓			* SEE APPENDIX A*		

NOTES:

APPENDIX "A"						
Component	P	F	NA	Component	P	F NA
A.1. Liquefied Petroleum Gas (LPG or Propane) Fuel System			✓	A.3. Liquefied Natural Gas (LNG) Fuel System		✓
A.2. Compressed Natural Gas (CNG) Fuel System						

NOTES:

Section 2 - Suspension						
Component	P	F	NA	Component	P	F NA
2.1. Suspension & Frame Attachments	✓			2.5. Air Suspension	✓	
2.2. Axle Attaching & Tracking Components	✓			2.6. Self-Steer and Controlled-Steer Axle	✓	
2.3. Axle & Axle Assembly	✓			2.7. Shock Absorber/Strut Assembly		
2.4. Spring & Spring Attachment	✓					

NOTES:

Section 3H - Hydraulic Brakes						
Component	P	F	NA	Component	P	F NA
3H.1. Hydraulic System Components				3H.13. Disc Brake System Components		
3H.2. Brake Pedal/Actuator				3H.14. Mechanical Parking Brake		
3H.3. Vacuum Assist (Boost) System				3H.15. Spring-Applied Air-Released Parking Brake		
3H.4. Hydraulic Assist (Boost) System				3H.16. Spring-Applied Hydraulic-Released Parking Brake		
3H.5. Air Assist (Boost) System				3H.17. Anti-Lock Brake System (ABS)		
3H.6. Air-Over-Hydraulic Brake System				3H.18. Stability Control System		
3H.11. Brake System Indicator Lamps				3H.19. Brake Performance		
3H.12. Drum Brake System Components						

NOTES:

Section 3A - Air Brakes						
Component	P	F	NA	Component	P	F NA
3A.1. Air Compressor	✓			3A.13. Air System Components	✓	
3A.2. Air Supply System	✓			3A.14. Brake Chamber	✓	
3A.4. Air Tank	✓			3A.15. Drum Brake System Components	✓	
3A.5. Air Tank Check Valves	✓			3A.16. S-Cam Drum Brake System	✓	
3A.6. Brake Pedal/Actuator	✓			3A.17. Brake Shoe Travel (Wedge Brakes)		
3A.7. Treadle Valve and Trailer Hand Valve	✓			3A.18. Disc Brake System Components		✓
3A.8. Brake Valves & Controls	✓			3A.19. Anti-Lock Brake System (ABS)	✓	
3A.9. Proportioning, Inversion or Modulation Valve	✓			3A.21. Stability Control System	✓	
3A.10. Towing Vehicle (Tractor) Protection System	✓			3A.23. Brake Performance		
3A.11. Parking Brake & Emergency Application	✓					

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

NOTES:

Section 4 - Steering						
Component	P	F	NA	Component	P	F NA
4.1. Steering Control and Linkage	☒			4.4. Kingpin	☒	
4.2. Power Steering System (Hydraulic and Electric)	☒			4.5. Self-Steer and Controlled-Steer Axle		☒
4.3. Steering Operation (Active Steer Axle)	☒					

NOTES:

Section 5 - Instruments and Auxiliary Equipment						
Component	P	F	NA	Component	P	F NA
5.1. Fire Extinguisher	☒			5.8. Heater & Windshield Defroster	☒	
5.2. Hazard Warning Kit	☒			5.9. Fuel-Burning Auxiliary Heater		☒
5.3. Horn	☒			5.10. Chain/"Headache" Rack	☒	
5.5. Speedometer	☒			5.11. Auxiliary Controls and Devices	☒	
5.6. Odometer	☒			5.12. Auxiliary Drive Controls		☒
5.7. Windshield Wiper/Washer	☒					

NOTES:

Section 6 - Lamps						
Component	P	F	NA	Component	P	F NA
6.1. Required Lamps	☒			6.4. Instrument Panel Lamps	☒	
6.2. Reflex Reflector	☒			6.5. Headlamp Aim	☒	
6.3. Retro-Reflective Marking	☒					

NOTES:

Section 7 - Electrical System						
Component	P	F	NA	Component	P	F NA
7.1. Wiring	☒			7.3. Trailer Cord (output to towed vehicle)	☒	
7.2. Battery	☒					

NOTES:

Section 8 - Body						
Component	P	F	NA	Component	P	F NA
8.1. Hood or Engine Enclosure	☒			8.12. Bumper	☒	
8.2. Tilt Cab			☒	8.13. Windshield	☒	
8.3. Air-Suspended Cab	☒			8.14. Side Windows	☒	
8.4. Cab and Passenger-Vehicle Body	☒			8.15. Rear Window	☒	
8.5. Cargo Body			☒	8.16. Interior Sun Visor	☒	
8.6. Frame, Rails & Mounts	☒			8.17. Exterior Windshield Sun Visor	☒	
8.7. Utilized Body Elements	☒			8.18. Rear-View Mirror	☒	
8.8. Cab or Cargo Door	☒			8.19. Seat	☒	
8.9. Cargo Tank or Vessel			☒	8.20. Seat Belt/Occupant Restraint	☒	
8.10. Body, Device or Equipment Attached or Mounted to the Vehicle	☒			8.21. Fender/Mud Flap	☒	
8.11. Refrigeration/Heater Unit Fuel System (Reefer or Auxiliary Power Unit (APU))			☒	8.24. Aerodynamic Device & Attachment		☒

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

NOTES:

Section 9 - Tires and Wheels

Component	P	F	NA	Component	P	F	NA
9.1. Tire Tread Depth	/			9.7. Wheel/Rim (Applies to all wheel types)	/		
9.2. Tire Tread Condition	/			9.8. Multi-Piece Wheel/Rim	/		/
9.3. Tire Sidewall & Manufacturer Markings	/			9.9. Spoke Wheel/Demountable Rim System	/		/
9.4. Tire Inflation Pressure	/			9.10. Disc Wheel System	/		
9.5. Wheel Hub	/			9.11. Wheel Fasteners (Nuts, Bolts and Studs)	/		
9.6. Wheel Bearing	/						

NOTES:

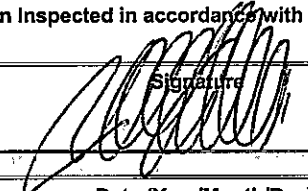
Section 10 - Couplers and Hitches

Component	P	F	NA	Component	P	F	NA
10.1. Hitch Assembly, Structure & Attaching Components	/			10.5. Roll-Coupling Hitch			/
10.2. Secondary Attachment (Safety Chain or Cable)			/	10.6. Automated Coupling Device			/
10.3. Pintle Hook, Pin Hitch, or Coupler Hitch			/	10.7. Fifth Wheel Coupler	/		
10.4. Ball Type Hitch			/	10.8. Oscillating Fifth Wheel Coupler			/

NOTES:

Certification

The Vehicle for which this Record of Inspection is issued has _____ the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

Date of Inspection <i>June 5/26</i>	Technician Number <i>C1246</i>	Facility Number <i>18733</i>	Signature 
--	-----------------------------------	---------------------------------	--


Customer Acknowledgment

I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.

Date (Year/Month/Day)

June 5/26

Customer Signature



All tires

Clean/Change Airdryer

re tape Air lines

wires chaffing on front of oil pan

hood latch missing LH

Middle Axel lines chaffing on diff filter

front diff leaking

headache rack no left signal

Broken Cross member behind tranny

Abs wire needs tied up

Belt/Change

diff filters change

Air filters

Chain rack LH side

Trail lose front bolts

loose rod

oil cooler

~~Spring pins~~ LH

Power steering leak

Fan Air line leaking

Coolant filter

Head light harness RH tie up

tail lights tie up harness

fan hub leaking

~~Lighter~~

LH mirror light

Cab light flickering

no LH signal in head light

trans Air leak

no AC - Clutch not spin

door seal

Steering u joint