
Kangas Equipment Repair Inc. 1305 Holden Road

1305 Holden Road Selwyn, Ontario K9J 6X5

Invoice

Date	Invoice #		
5/19/2023	13652C		

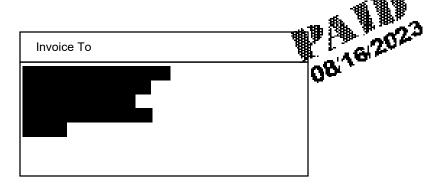

Terms
Net 30

Location

Serial # 922380

Hours


MACHINE ID	Item	Service Date	Description	Qty	Rate	Amount
KENWORTH T450			FUEL SUPPLY ISSUE			
	(R) L-3 JAC	4/18/2023	13652C RAN TRUCK IN YARD TO GET FUEL SUPPLY TO ACT UP. HOOKED UP GAUGES TO FUEL SYSTEM AS WELL AS SIGHT GLASS TO FIND IT WAS SUCKING AIR AND POSSIBLY BLOCKED AFTER RUNNING FOR 10-15 MINUTES FULL PSI WOULD DROP OFF. PULLED FILTERS AND FOUND EMPTY AS WELL AS NO FUEL RETURNING TO THE TANK. TIGHTENED FITTINGS AND CHANGED BOTH FUEL HOSES THAT WERE IN ROUGH SHAPE. REMOVED FUEL MOTOR AND INSPECTED. REMOVED COVER TO FUEL PUMP AND FOUND RETURN ORIFICE WAS PLUGGED. CLEANED OUT AND RE-ASSEMBLED. RAN TRUCK AND TESTED FUEL CIRCUIT AND WAS HOLDING PRIME. TOOK TRUCK FOR	12	130.00	1,560.00
Thank you for your business!			Subtotal			
PLEASE NOTE: THERE IS A 2.4 % SURCHARGE IF PAYING BY CREDIT CARD. Total Payments/Credi Balance Due		Total				
		/Credits				
		e Due				

Kangas Equipment Repair Inc. 1305 Holden Road

1305 Holden Road Selwyn, Ontario K9J 6X5

Invoice

Date	Invoice #		
5/19/2023	13652C		

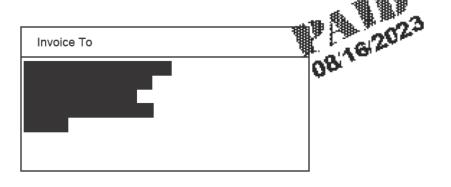

Terms
Net 30

Location

Serial # 922380

Hours

MACHINE ID	Item	Service Date	Description	Qty	Rate	Amount
	(R) L-0 MAT	4/18/2023	DRIVE AND THEN PARKED IN THE YARD. NOTICED AN OIL LEAK AT THE FRONT OF INJECTION PUMP. TOLD KEN TO REPAIR WE NEED TO REMOVE AND REPLACE SEAL. SWAPPED OUT SHUT OFF SOLENOID WHICH WAS LEAKING AND REPAIRED WIRING. 13652C RE/RE INJECTION PUMP, TIM	0	0.00	0.00
			AND RESEAL. REPAIRED STRIPPED MOUNTING HOLE IN FRONT COVER. INSTALL AND VERIFY. NO CHARGE			
	COGS 1 - P		13652C 100 PSI GAUGE	1	25.00	25.00
	COGS 1 - P	4/19/2023	13652C BRAIDED HOSE 201-10	1	125.30	125.30
	COGS 1 - P	4/19/2023	13652C FITTING 167826-10-10	3	53.52	160.56
	COGS 1 - P	4/19/2023	13652C FITTING 13726-10-10	1	78.74	78.74
	COGS 1 - P	4/19/2023	13652C ADAPTER 0503-10-10	1	10.22	10.22
	COGS 1 - P	4/21/2023	13652C SEAL O RING 6V-6921	1	5.63	5.63
	COGS 1 - P	4/21/2023	13652C SEAL O RING 175-7900	1	12.35	12.35
	COGS 1 - P	4/21/2023	13652C SEAL 5F-7054	1	3.72	3.72
	COGS 1 - P	4/21/2023	13652C SEAL 2H-3932	1	4.61	4.61
Thank you for yo	our business!			Subtotal	•	

PLEASE NOTE: THERE IS A 2.4 % SURCHARGE IF PAYING BY CREDIT CARD.

Total

Payments/Credits


Balance Due

Kangas Equipment Repair Inc. 1305 Holden Road

1305 Holden Road Selwyn, Ontario K9J 6X5

Invoice

Date	Invoice #		
5/19/2023	13652C		

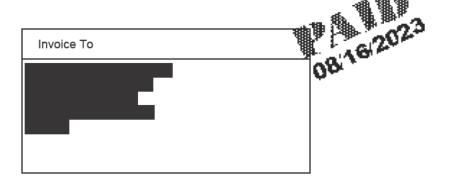

Terms
Net 30

Location

Serial # 922380

Hours

MACHINE ID	Item	Service Date	Description	Qty	Rate	Amount
	COGS 1 - P COGS 1 - P COGS 1 - P	4/21/2023 4/21/2023 4/21/2023	13652C SOLENOID 125-5773 13652C GASKET 6I-2002 13652C GASKET 6N-7887	1 1 1	500.82 26.60 19.42	500.82 26.60 19.42
	SHIPPING		SHIPPING		36.00	36.00
	FUEL SURC		FUEL SURCHARGE HST (ON) on sales		78.00 13.00%	78.00 344.11
Thank you for y	Thank you for your business!			Subtotal		\$2,646.97
		Total		\$2,991.08		
			Payments	s/Credits	-\$2,991.08	
				Balanc	e Due	\$0.00