Quality Truck Repair Inc.

840 Colonel Sam Dr. Oshawa, ON L1H 8A9

Phone # 905-721-2788 Fax # 905-721-0459



Garage Repair Order

Date	Invoice No.
28/01/2025	107763

License No.	Unit No.
270 1PT	2007

Year/Make Model	Mileage
2017 PETE	1333863

Invoic	е То	
Quantity	Item	


Quantity	Item	Description	Price Each	Amount
		PO#40957		
		TOWER BY BILLER TO MIT		
		TOWED IN - BILLED TO MTI ANNUAL INSPECTION - ML30AB35 - 5		
		B SERVICE -3		
		REPLACE CABIN FILTERS		
		REPLACE COOLANT FILTER5		
		WINTERIZE 1.5		
		REPLACE AIR DRYER CARTRIDGE		
		DIAGNOSE CEL ON -1		
		CLEAR INACTIVE CODES - OK		
		DIAGNOSE HVAC FAULTS -1		
		REPLACE STARTING AND AGM BATTERIES -4		
		CLEAN ALL BATTERY AND STARTER CONNECTIONS -1		
		REPLACE STARTER RELAY AND REPAIR WIRING -1		
		ASSEMBLE AND REPLACE POWER STEERING LINE FROM		
		PUMP TO BOX -1		
		REPLACE POWER STEERING FILTER		
		TOP UP FLUID		
		REPLACE CAB AIR BAGS -2		
		REPLACE WIPER TRANSMISSION ASSEMBLY -5		
		REPLACE WIPER BLADES		
		REPLACE LEFT WIPER NOZZLE		
		SECURE GRILLE AND RIGHT HOOD MIRROR -1		
		REPLACE LEFT MUD FLAP HANGER AND MUD FLAP		
		(SUPPLIED) -1		
		SECURE REAR QUARTER FENDERS -1		
		REPLACE QUARTER FENDER MUD FLAP EXTENSIONS		
		REPLACE BOTH HOOD SHOCKS -1.5		
		SECURE FIFTH WHEEL SLIDE AIR LINE -1		
		EXTRACT BROKEN BOLTS		
		ADJUST FIFTH WHEEL		
		REPAIR LICENCE PLATE LIGHT AND WIRING -1		
		REPLACE MISSING HEADLIGHT HOUSING COVER5		

your employees may operate above vehicle for purposes of testing. Inspection or delivery at my	Sub Total
risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.	нѕт
Authorized By	Total


Quality Truck Repair Inc.

840 Colonel Sam Dr. Oshawa, ON L1H 8A9

Phone # 905-721-2788 Fax # 905-721-0459

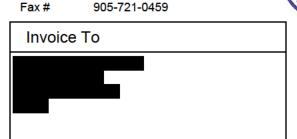

Garage Repair Order

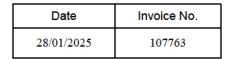

License No.	Unit No.
270 1PT	2007

Year/Make Model	Mileage	
2017 PETE	1333863	

Quantity	Item	Description	Price Each	Amount
		SECURE TRAILER LIGHT CORD AND AIR LINES5 DIAGNOSE TRANSMISSION FAULTS -6 NO COMMUNICATION, TCU FAILED REPLACE TCU		
1	EMISSION TEST	EMISSION TEST	269.00	269.00
1	LABOUR MVI TRK	ANNUAL INSPECTION TRUCK	195.00	195.00
1	LABOUR CD	CONNECT DIAGNOSTIC SOFTWARE	130.00	130.00
39.5	LABOUR 98.00	CONNECT BEIGNOSTIC SOLT WINE	98.00	3,871.00
		Total Labour		4,465.00
1	OIL SAMPLE	OIL SAMPLE KIT	35.00	35.00
1	1948921	PACCAR OIL FILTER	92.74	92.74
1	2164463	PACCAR FUEL FILTER	133.18	133.18
1	1922496	PACCAR OIL FILTER	102.62	102.62
1	1843659	COOLANT FILTER	107.59	107.59
1	K37-1012	PACCAR FUEL FILTER 86.32		86.32
1	P640110	CABIN FILTER	52.81	52.81
1	F37-1018	PACCAR CABIN FILTER	69.99	69.99
1	P951413	ADIS AIR DRYER CARTRIDGE PURAGUARD 114.58		114.58
42	F0114301	IRVING IDO SYN BLEND 10W30 CK-4 BULK	5.93	249.06
42	WASTE OIL	WASTE OIL DISPOSAL FEE	0.21	8.82
1	1982821	PACCAR DRAIN PLUG	22.91	22.91
4	31S	BATTERY	209.98	839.92
4	9A31	AGM BATTERY 925CCA 190RC	529.82	2,119.28
1	85125982	STARTER RELAY	59.17	59.17
2	F075-444	5/16 X 1 IN S BOLT	0.78	1.56
2	F108-016	5/16 NYLOCK NUT	0.47	0.94
4	F152-016	5/16 FLAT WASHER	0.42	1.68
1	K4315	EATON TRANSMISSION TCU / (USED PART)	1,849.85	1,849.85
3	GX08	1/2 BRAIDED HOSE	8.37	25.11
2	E08-08FJ	1/2 JIC 37 FEMALE	16.76	33.52
1	P550830	POWER STEERING FILTER	32.91	32.91

your employees may operate above vehicle for purposes of testing. Inspection or delivery at my	Sub Total
risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.	нѕт

Authorized By


Total

Quality Truck Repair Inc.


840 Colonel Sam Dr. Oshawa, ON L1H 8A9

Phone # 905-721-2788

Fax # 905-721-0459

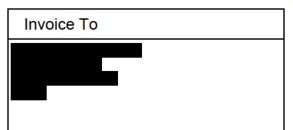

Garage Repair Order

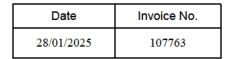

License No.	Unit No.
270 1PT	2007

Year/Make Model	Mileage	
2017 PETE	1333863	

Quantity	Item	Description	Price Each	Amount
2	F0020815			
2	0020815	IRVING TRANSFLO ATF 946 ML	8.92	17.84
2	EHC3	ENVIRONMENTAL CHARGE BOTTLE	0.22	0.44
		IRVING TRANSFLO ATF BOTTLE		18.28
2	25523181	CAB AIR BAG KIT	193.88	387.76
1	R23-6031	WIPER LINKAGE	826.61	826.61
1	R23-6014	WIPER MOTOR	656.25	656.25
1	85119714	WASHER NOZZLE	21.54	21.54
2	221	22" WIPER BLADE	19.06	38.12
1	WASHER FLUID	WINDSHIELD WASHER FLUID 4 LT JUG	4.83	4.83
1	NF30C	MUD FLAP HANGERS CHROME 31 INCH	332.76	332.76
1	N123-5	MUDFLAP EXTENSIONS	15.38	15.38
18	F075-309	1/4 X 1 INCH BOLT	0.61	10.98
18	F108-014	1/4 NYLOCK NUT	0.71	12.78
1	L71-1015	HOOD SHOCK	734.72	734.72
1	L71-6022	HOOD SHOCK	696.91	696.91
1	60381	LICENCE PLATE LIGHT LED	51.81	51.81
4	SN100	SKIRT NUT	13.46	53.84
1	17-420	TENDER SPRING ASSY	55.83	55.83
1	6025	HEADLIGHT COVER	159.56	159.56
1	WS1	WELDING SUPPLIES	15.00	15.00
20	M CABLE TIES	11 INCH CABLE TIE	0.34	6.80
1	99170	GROTE ULTRA SEAL	8.09	8.09
1	GL3	GREASE AND LUBE	17.25	17.25
		Total Parts		10,164.66
1	Shop Supply Charge	Shop Supply Charge	267.90	267.90

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing. Inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

Sub Total	\$14,897.56	
нѕт	\$1,936.68	
Total	\$16,834.24	

GST/HST No.

863738910