



Pressure Tests - 5HTDL4032E5G25311 - 2021-07-06

Authoring Information

Created By Shane Arps
17808753459

Facility Fusion Tank Services
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2021-07-05 15:43:51

Updated 2021-07-05 15:43:51

Client

Company Larson Management Inc.
5101-63st
Lloydminster, AB
T9V 2E7

Contact 780-205-9243

Tank Data

Ser. No. 5HTDL4032E5G25311

Unit Number LARSON 310015 (LEAD)

TC Spec. DOT 407

Date of mfr. 2013-07-01

Cert. date 2013-07-01

VIN 5HTDL4032E5G25311

Tank mfr. Heil

Assembler Heil

TCRN or CRN N/A

MDIN N/A

CTMV Orig. Test Date 2013-07-01

CTMV Cert Date 2013-07-01

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .325 in

Mfd. shell thick .250 in

Min. shell thick .216 in

Exposed Surface 697 ft2

Cap. 8635 gallons

Lining Sherglass FF

Original Test Date 2013-07-01

Pressure Test

Inspection Date 2021-07-06

Inspection Expiry Date 2026-07-06

Test Medium Air

No. of
Compartments

1

Compartment 1

Start (psi)

End (psi)

Hold Time

52.5

52.5

60

Test Results

When venting devices are removed, they are bench tested and meet the requirements for the tank

Pass

Product piping with all valves and accessories in place and operative must be pressure tested at not less than 80% MAWP

Pass

When removed from the pressure supply, the test pressure is retained for the specified time for the pneumatic or hydrostatic test

Pass

Inspect the entire area of the head, shell and welds for leaks or deformation. If defects found note the location on the report

Pass

Defects

No defects found.

PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						
PRESSURE/VACCUM	GIRARD	psi	431308 SCFH at 45psi	36 PSI 10 HG	36 PSI 10 HG	Reinstalled

Tank Disposition

Current Disposition Passed / No Defects Found

Approval

Inspector
Shane Arps

Tester
Shane Arps

Service provided by eStandard Solutions.



Upper Coupler Inspections - 5HTDL4032E5G25311 - 2021-07-06

Authoring Information

Created By Shane Arps
 17808753459
Facility Fusion Tank Services
 780-875-3459
 6007 52nd ave
 Lloydminster, AB
 T9V 2S7
Created 2021-07-05 15:45:01
Updated 2021-07-05 15:45:01
Client
Company Larson Management Inc.
 5101-63st
 Lloydminster, AB
 T9V 2E7
Contact 780-205-9243

Tank Data

Ser. No. 5HTDL4032E5G25311
Unit Number LARSON 310015 (LEAD)
TC Spec. DOT 407
Date of mfr. 2013-07-01
Cert. date 2013-07-01
VIN 5HTDL4032E5G25311
Tank mfr. Heil
Assembler Heil
TCRN or CRN N/A
MDIN N/A
CTMV Orig. Test Date 2013-07-01
CTMV Cert Date 2013-07-01
MAWP 35 psi
Test P. 52.5 psi
Mfd. head thick .375 in
Min. head thick .325 in
Mfd. shell thick .250 in
Min. shell thick .216 in
Exposed Surface 697 ft2
Cap. 8635 gallons
Lining Sherglass FF
Original Test Date 2013-07-01

Upper Coupler Inspection

Inspection Date 2021-07-06
Inspection Expiry Date 2026-07-06

Inspection

Corroded or abraded areas
Pass

Cracks or defects in welds
Pass

Dents or distortions
Pass

Defects No defects found.



PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						

Tank Disposition

Current Disposition Passed / No Defects Found

Approval

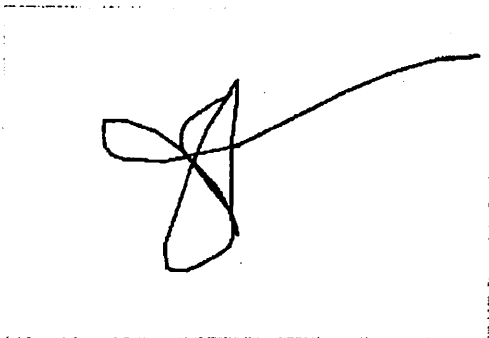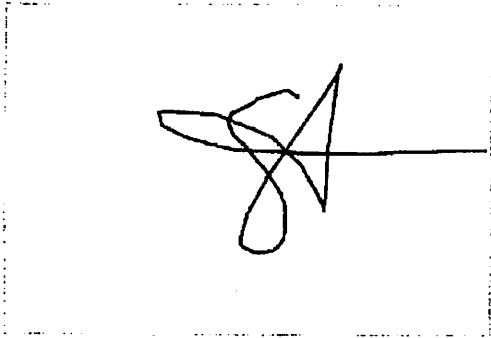

Inspector
Shane Arps

Tester
Shane Arps



Pressure Tests - 5HTDL292XD5F25342 - 2021-07-06

Authoring Information

Created By Shane Arps
17808753459

Facility **Fusion Tank Services**
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2021-07-05 10:43:32

Updated 2021-07-05 10:43:32

Client

Company **Larson Management Inc.**
5101-63st
Lloydminster, AB
T9V 2E7

Contact 780-205-9243

Tank Data

Ser. No. 5HTDL292XD5F25342

Unit Number LARSON 310016 (PUP)

TC Spec. DOT 407

Date of mfr. 2013-06-01

Cert. date 2013-06-01

VIN 5HTDL292XD5F25342

Tank mfr. Heil

Assembler Heil

TCRN or CRN N/A

MDIN N/A

CTMV Orig. Test Date 2013-06-01

CTMV Cert Date 2013-06-01

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .309 in

Mfd. shell thick .250 in

Min. shell thick .220 in

Exposed Surface 622 ft2

Cap. 7270 gallons

Lining Sherglass FF

Original Test Date 2013-06-01

Pressure Test

Inspection Date 2021-07-06

Inspection Expiry Date 2026-07-06

Test Medium Air

No. of	1						
Compartments							
Compartment 1	<table border="0"> <tr> <td>Start (psi)</td> <td>End (psi)</td> <td>Hold Time</td> </tr> <tr> <td>52.5</td> <td>52.5</td> <td>60</td> </tr> </table>	Start (psi)	End (psi)	Hold Time	52.5	52.5	60
Start (psi)	End (psi)	Hold Time					
52.5	52.5	60					
Test Results	When venting devices are removed, they are bench tested and meet the requirements for the tank Pass Product piping with all valves and accessories in place and operative must be pressure tested at not less than 80% MAWP Pass When removed from the pressure supply, the test pressure is retained for the specified time for the pneumatic or hydrostatic test Pass Inspect the entire area of the head, shell and welds for leaks or deformation. If defects found note the location on the report Pass						
Defects	No defects found.						

PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						
PRESSURE/VACCUM	GIRARD	psi	484718 SCFH @ 52.5 psi	42 psi 10 HG	42 psi 10 HG	Reinstalled

Tank Disposition

Current Disposition Passed / No Defects Found

Approval

Inspector
Shane Arps

Tester
Shane Arps



Upper Coupler Inspections - 5HTDL292XD5F25342 - 2021-07-06

Authoring Information

Created By Shane Arps
17808753459

Facility Fusion Tank Services
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2021-07-05 10:46:26

Updated 2021-07-05 10:46:26

Client

Company Larson Management Inc.
5101-63st
Lloydminster, AB
T9V 2E7

Contact 780-205-9243

Tank Data

Ser. No. 5HTDL292XD5F25342

Unit Number LARSON 310016 (PUP)

TC Spec. DOT 407

Date of mfr. 2013-06-01

Cert. date 2013-06-01

VIN 5HTDL292XD5F25342

Tank mfr. Heil

Assembler Heil

TCRN or CRN N/A

MDIN N/A

CTMV Orig. Test Date 2013-06-01

CTMV Cert Date 2013-06-01

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .309 in

Mfd. shell thick .250 in

Min. shell thick .220 in

Exposed Surface 622 ft²

Cap. 7270 gallons

Lining Sherglass FF

Original Test Date 2013-06-01

Upper Coupler Inspection

Inspection Date 2021-07-06

Inspection Expiry Date 2026-07-07

Inspection**Corroded or abraded areas**

Pass

Cracks or defects in welds

Pass

Dents or distortions



Pass

Defects

No defects found.

PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						

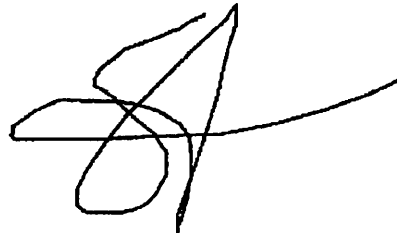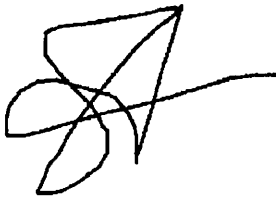Tank Disposition**Current Disposition** Passed / No Defects Found**Approval****Inspector**

Shane Arps

Tester

Shane Arps

Service provided by eStandard Solutions.