



L26-7 Pup
NOV

		9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Control Record EXTERNAL VISUAL INSPECTION				QF-041 Rev: 8 PAGE 1 OF 1			
				Tank S/N 10753		WO No. SV-26247		Inspection Date JULY 10- 2026			
Owner Rick's Oilfield Hauling Box 979, 4808 - 44 Street Red Water, AB T0A 2W0 Phone No. 780-942-2932				Mfr TREMCAR		Tank Spec TC 407		Mfr Date OCT. 2012		Retest Required On Jul 2027	
				Assembler TREMCAR		Min Thickness, Heads (in) 5.97 MM		Min Thickness, Shell (in) 5.49 MM		Special Services NO	
Tank Type TAIL S.B				Certification Date OCT. 2012		Original Test Date OCT. 2012					
Tank is Lined NO		Tank is Insulated YES		Both		Inspection Location WESTLOCK		VIN 2TLBL3124DB005292		Material 5454-H32	
Owners's Serial No. T167P				TCRN / MDIN / CRN 9240		Unit No T167P		MAWP 172 KPA		# Compartments 1	
MARKINGS				Complies		Concerns		EXTERNAL EXAMINATION		Complies	
1. TDG Nameplate legible & correct. VIN numbers match				X				1. Barrel weld seams and attachments		X	
2. Placarding provisions				X				2. Hold down bolts and tank mounting		X	
3. Tests/inspections marked on vessel				X				3. Pipe and fittings protected w/ shear section		X	
4. Railway crossing decal				X				4. Structural components, outriggers, crossmembers		X	
SAFETY DEVICES				Complies		Concerns		5. Manways; Shell; signs of leakage?		X	
1. Primary Venting, press & vacuum				X				6. Overturn protection adequate		X	
2. Total Vent cap (SCFM)				X				7. Bumper&protection adequate: Height must not exceed 30"		X	
3. Grounding provisions				X				8. Level indicator operational		X	
4. Self closing stop valve on outlet				X				9. Appurtenances on repads		X	
5. Remote emergency shut off for outlets				X				10. Ladder sound and tight		X	
6. Thermal shut off for outlets				X				11. Overlay Patches (None allowed)		NO	
7. Items 4, 5 & 6 not required on "Crude"				N/A				12. Tank wall corroded or abraded		NO	
8. Items 3 to 6 not revised, if tank is in class 8 service				N/A				13. Condition of hoses and connections		X	
Comments/Description of concerns (include severity of defects, how they were noticed. Use QF-070 to document any repairs)											
Current Disposition of Tank Tested											
New Tank Entered in to Service ☐ Returned to Service ☒ Repair Required ☐ Condemned (removed from service) ☐											
CERTIFICATE OF INSPECTION COMPLIANCE We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.											
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93											
Inspector Signature 								Fire Extinguisher Mounted to Unit and Available:			
Name:		MAURY LITKE						Complies		Location	
Title:		INSPECTOR						X		D/S	
Date:		JULY 10- 2026									

		9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Control Record INTERNAL VISUAL / LINING INSPECTION				QF-042 Rev: 7 PAGE 1 OF 1	
				Tank S/N 10753		WO No. SV-26247		Inspection Date JULY 10- 2026	
Owner Rick's Oilfield Hauling Box 979, 4808 - 44 Street Red Water, AB T0A 2W0				Mfr TREMCAR		Tank Spec TC 407		Mfr Date OCT. 2012	
				Assembler TREMCAR		Min Thickness, Heads (in) 5.97 MM		Min Thickness, Shell (in) 5.49 MM	
Phone No. 780-942-2932				Tank Type TAIL S.B		Certification Date OCT. 2012		Original Test Date OCT. 2012	
Tank is Lined NO		Tank is Insulated YES		Both		Inspection Location WESTLOCK		VIN 2TLBL3124DB005292	
Owners's Serial No. T167P		TCRN / MDIN / CRN 9240		Unit No T167P		MAWP 172 KPA		Material 5454-H32	
						# Compartments 1			
						Complies		Concerns	
						Fails			
LINING INSPECTION				Yes		No		N/A	
Internal lining Inspection								X	
Comments:									
INTERNAL VISUAL EXAMINATION				Complies		Concerns			
1. Head surfaces				X					
2. Shell welds, seams and surface				X					
3. Baffle welds and surfaces				X					
4. Manways, signs of leakage				X					
5. Float can				X					
6. Gauge cans (temp. press.)						X			
7. Sump						X		X	
8. Piping						X			
9. Nozzle						X			
10. Internal valves						X			
11. Dumps						N/A			
12. Overlay patches (None allowed)						NO			
13. Corrosion strips - If yes, provide Location								NO	
Comments/Description of concerns (include severity of defects, how they were noticed. Use QF-070 to document any repairs)									
Current Disposition of Tank Tested									
New Tank Entered in to Service ☐ Returned to Service ☒ Repair Required ☐ Condemned (removed from service) ☐									
CERTIFICATE OF INSPECTION COMPLIANCE We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.									
Wabash Mfg Inc - TDG Certificate of Registration #25-93									
Inspector Signature 									
Name: MAURY LITKE									
Title: INSPECTOR									
Date: JULY 10- 2026									

		9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Control Record PRESSURE TEST REPORT				QF-044			
				Tank S/N 10753		WO No. SV-26247		Rev: 7 Page 1 of 1 Test Date JULY 10- 2026			
Owner Rick's Oilfield Hauling Box 979, 4808 - 44 Street Red Water, AB T0A 2W0 Phone No. 780-942-2932		Mfr TREM CAR		Tank Spec TC 407		Mfr Date OCT. 2012		Retest Required On Jul 2031			
		Assembler TREM CAR		Min Thickness, Heads (in) 5.97 MM		Min Thickness, Shell (in) 5.49 MM		Special Services NO			
Tank Type TAIL S.B		Inspection Location WESTLOCK		VIN 2TLBL3124DB005292		Certification Date OCT. 2012		Original Test Date OCT. 2012			
		Tank is Lined NO		Tank is Insulated YES		Both YES		Material 5454-H32			
Owners's Serial No. T167P		TCRN / MDIN / CRN 9240		Unit No T167P		MAWP 172 KPA		# Compartments 1			
Test Pressure 40 PSI		Test Medium WATER									
PREPARATION		Complies N/A	Concerns	Fails	Re-test after repair	PIPING & ACCESSORIES		Complies N/A	Concerns	Fails	Re-test after repair
1. External & Internal visual (& thickness if required) done		X				1. Assemble hose and piping on unit		X			
2. Select proper gauges and SRV		X				2. Mount test head at top of piping		X			
3. Inspect reclosing vents, inert & red flag		X				3. Press to 80% MAWP&disconnect		X			
COMPARTMENT HYDRO TEST		Complies N/A	Concerns	Fails	Re-test after repair	4. Check for leaks & 10 min retention		X			
1. Mount test head at top. Visible from safe distance		X				5. Bleed off pressure & drain		X			
2. Fill test compartment		X				COMPLETION		Complies N/A	Concerns	Fails	Re-test after repair
3. Pressure up to Test pressure & disconnect hose		X				1. Flush per 300WP		X			
4. Check for leaks &/or 10min retention/Bleed of pressure to MAWP/10min retention		X				2. Tag valve & placard if required		X			
5. Apply soap water, check for leak and/or Bleed off pressure		N/A				3. Sticker as appropriate		X			
6. Activate vent to confirm set pressure. Bleed off pressure & drain		X				4. Original Wabash file. Copies to owner		X			
PRV		Compartment 1		Compartment 2		Compartment 3		Compartment 4		Compartment 5	
Make		TIONA VENTED									
Serial Number		1307962									
Set Pressure		30 PSI 12" HG									
Tank Volume		32,000		PRV Test Report QF-046 Completed and Attached?		YES					
Comments/Description of concerns (include severity of defects, how they were noticed. Use QF-070 to document any repairs)											
Current Disposition of Tank Tested											
New Tank Entered in to Service ☐ Returned to Service ☒ Repair Required ☐ Condemned (removed from service) ☐											
CERTIFICATE OF INSPECTION COMPLIANCE											
We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.											
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93											
Inspector Signature 						Tester Signature 					
Name: MAURY LITKE						Name: JOENARD JOROLAN					
Title: INSPECTOR						Title: TESTER					
Date: JULY 10- 2026						Date: JULY 10- 2026					

 9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Assurance Record				QF-045	
		LEAKAGE TEST/REPAIR REPORT				Rev: 6 Page 1 of 1 Test Date: JULY 10- 2026	
Owner Rick's Oilfield Hauling Box 979, 4808 - 44 Street Red Water, AB T0A 2W0 Phone No. 780-942-2932		Tank S/N 10753		WO No. SV-26247		Retest Required On Jul 2027	
		Mfr TREM CAR		Tank Spec TC 407		Mfr Date OCT. 2012	
		Assembler TREM CAR		Min Thickness, Heads (in) 5.97 MM		Min Thickness, Shell (in) 5.49 MM	
		Tank Type TAIL S.B		Certification Date OCT. 2012		Original Test Date OCT. 2012	
Tank is Lined NO	Tank is Insulated YES	Both	Inspection Location WESTLOCK	VIN 2TLBL3124DB005292		Material 5454-H32	
Owners's Serial No. T167P		TCRN / MDIN / CRN 9240		Unit No T167P		MAWP 172 KPA	
Test Pressure 20 PSI		Test Medium WATER		# Compartments 1			
PREPARATION		Complies N/A	Concerns	Re-test after repair	COMPARTMENT LEAKAGE TEST		
1. External & Internal visual (& thickness if required)		X			5. Check for leaks & 10 min retention		
2. Ensure all valves and plumbing are leak tight		X					
3. Select proper gauges and SRV		X			6. Bleed of pressure and drain		
4. Inspect reclosing vents, inert & red flag		X			COMPLETION		
COMPARTMENT LEAKAGE TEST		Complies N/A	Concerns	Re-test after repair	1. Flush per 300WP		
1. Assemble hose and piping on unit		X			X		
2. Mount test head at top. Visible from safe distance		X			X		
3. Fill test compartment		X			X		
4. Press to 80% MAWP & disconnect		X			X		
TANK VOLUME (LITERS)					32,000		

PRV	Compartment 1	Compartment 2	Compartment 3	Compartment 4	Compartment 5	PRV Test Report QF-046 Completed and Attached? YES
Make	FORT VALE					
Serial Number	1307962					
Set Pressure	30 PSI 12" HG					

Comments/Description of concerns (include severity of defects, how they were noticed. Use QF-070 to document any repairs)



Current Disposition of Tank Tested

New Tank Entered in to Service ☐ Returned to Service ☒ Repair Required ☐ Condemned (removed from service) ☐

CERTIFICATE OF INSPECTION COMPLIANCE

We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.

Wabash Mfg Inc - TD TDG Certificate of Registration #25-93

Inspector Signature 		Tester Signature 	
Name:	MAURY LITKE	Name:	JOENARD JOROLAN
Title:	INSPECTOR	Title:	TESTER
Date:	JULY 10- 2026	Date:	JULY 10- 2026



9312 - 110A Street
Westlock, AB Canada
780-349-4282


Quality Control Record B620 REPAIR REPORT

QF-070

Rev: 1 PAGE 1 OF 1

Owner Rick's Oilfield Hauling Box 979, 4808 - 44 Street Red Water, AB T0A 2W0		Tank S/N 10753		WO No. SV-26247		Inspection Date JULY 6- 2026	
Phone No. 780-942-2932		Mfr TREM CAR		Tank Spec TC 407		Mfr Date OCT. 2012	
Tank is Lined NO		Assembler TREM CAR		Min Thickness, Heads 5.97 MM		Retest Required On	
Both		Tank Type TAIL S.B		Min Thickness, Shell 5.49 MM		Special Services NO	
Inspection Location WESTLOCK		VIN 2TLBL3124DB005292		Certification Date OCT. 2012		Original Test Date OCT. 2012	
Owners's Serial No. T167P		TCRN / MDIN / CRN 9240		Unit No T167P		Material 5454-H32	
		MAWP 172 KPA		# Compartments 1			

The location of the defect shall be indicated in the table below. The graphical boxes can be used for further clarification, if needed.

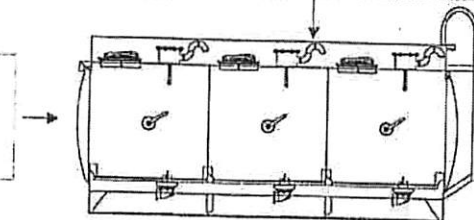

COMPARTMENT 2

COMPARTMENT N

#	LOCATION OF DEFECTS IDENTIFIED	METHOD OF REPAIR	MATERIAL SPEC & GRADE	WPS	WELDER STAMP
1	LEAK AT SUMP	LOCATE & WELD UP		W-GMAW-AL-1A	
2					
3					
4					
5					
6					
7					
8					
9					
10					
11					
12					
13					
14					

Current Disposition of Tank Tested

Returned to Service ☒ Re-test was required ☐ Condemned (removed from service) ☐

CERTIFICATE OF INSPECTION COMPLIANCE

We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.

Wabash Mfg Inc - TC TDG Certificate of Registration #25-93

Date:	Inspector Signature	Welder Signature	Compliance Officer
Name:	JULY 6- 2026	DEVIN LLODY	
Title:	MAURY LITKE		
Sign:	INSPECTOR		

		9312 - 110A Street, Westlock, AB 780-349-4282		Quality Control Record PRESSURE RELIEF VALVE TEST REPORT				QF-046 Rev: 5 Page 1 of 1	
Owner Rick's Oilfield Hauling Box 979, 4808 - 44 Street Red Water, AB T0A 2W0 Phone No. 780-942-2932				Tank SIN 10753		WO No. SV-26247		Test Date JULY 10- 2026	
Mfr TREM CAR				Tank Spec TC 407		Mfr Date OCT. 2012		Retest Required On	
Assembler TREM CAR				Min Thickness, Heads (in) 5.97 MM		Min Thickness, Shell (in) 5.49 MM		Special Services NO	
Tank Type TAIL S.B				Inspection Location WESTLOCK		Certification Date OCT. 2012		Original Test Date OCT. 2012	
Tank is Lined NO		Tank is Insulated YES		Both		VIN 2TLBL3124DB005292		Material 5454-H32	
Owners's Serial No. T167P		TCRN / MDIN / CRN 9240		Unit No T167P		MAWP 172 KPA		# Compartments 1	
Make: FORT VALE				Make:					
Design Pressure (psi): 30 PSI				Design Pressure (psi):					
Vacuum Design Press (psi): 12" HG				Vacuum Design Press (psi):					
Leakage Pressure (psi): 30 PSI				Leakage Pressure (psi):					
ReSet Pressure (psi): 29 PSI				ReSet Pressure (psi):					
Model: HYPER TANK				Model:					
Serial: 1307962				Serial:					
Nom Dia (in): 3"				Nom Dia (in):					
Set Pressure (psi): 30 PSI				Set Pressure (psi):					
Vacuum Set Pressure (Hg): 12" HG				Vacuum Set Pressure (Hg):					
Comments/Description of concerns (include severity of defects, how they were noticed. Use QF-070 to document any repairs)									
Comments:					Comments:				
Current Disposition of Pressure Relief Valve:									
Returned to Service ☒ Repair Required ☐ Condemned (removed from service) ☐									
CERTIFICATE OF INSPECTION COMPLIANCE									
We certify that the statement in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.									
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93									
Inspector Signature									
Name: FREDDIE TUBOG									
Title: TESTER									
Date: JULY 10- 2026									

		9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Assurance Record WATER/AIR TEST REPORT						QF-061			
				Tank S/N 10753		WO No. SV-26247		Rev. 0 Page 1 of 1					
OWNER RICK'S OILFIELD HAULING BOX 979, 4808-44 STREET RED WATER, A.B T0A-2W0 Phone Number 780-942-2932		Mfr TREM CAR		Tank Spec TC 407		Mfr Date OCT. 2012		Test Date JULY 6- 2026					
		Assembler TREM CAR		Min Thickness, Heads (in) 5.97 MM		Min Thickness, Shell (in) 5.49 MM		Retest Required On NO					
		Tank Type TAIL S.B		Certification Date OCT. 2012		Original Test Date OCT. 2012							
		Inspection Location WESTLOCK		VIN 2TLBL3124DB005292		Material 5454-H32							
Tank is Lined NO		Tank is Insulated YES		Both YES		Owners's Serial No. T167P		TCRN / MDIN / CRN 9240					
Unit No T167P		MAWP 172 KPA		# Compartments 1		Test Pressure 40 PSI		Test Medium WATER					
PREPARATION 1. Tank is ready for water test 2. Select proper gauges and SRV WATER TEST 1. Fill test compart & empty adjacent 2. Mount test head at top of tank 3. Pressure up and disconnect hose 4. Check for leaks & 10 min retention 5. Bleed off pressure 6. Repeat each compartment COMPLETION 1. Flush per 300WP 2. Tag valve & placard if required 3. Original Wabash file		ONE		TWO		THREE		FOUR		FIVE			
		Complies		Fails		Complies		Fails		Complies		Fails	
		X											
		X											
		Complies		Fails		Complies		Fails		Complies		Fails	
		X											
		X											
		X											
		X											
		X											
N/A													
Complies		Fails		Complies		Fails		Complies		Fails			
N/A													
X													
X													

Comments:-

Current Disposition of Tank Tested		GOOD		Weld Required	
CERTIFICATE OF INSPECTION COMPLIANCE					
We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.					
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93					
Tester Signature 					
Name:		FREDDIE TUBOG			
Title:		TESTER			
Date:		JULY 6- 2026			