
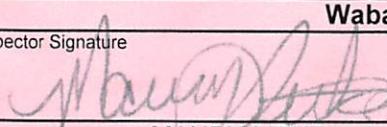


2/9-1  
GR-FEB

WABASH MFG. INC.		9312 - 110A Street Westlock, AB Canada 780-349-4282	Quality Control Record PRESSURE TEST REPORT					QF-044		
			Tank S/N 2641199			WO No. SV-22318	Test Date JAN. 4- 2022		Rev: 2	
Owner RYDER FLUID SOLUTIONS Box 3014 Clairmont, AB T8X 0W0		Mfr Nocorode Tank	Tank Spec TC312RP	Mfr Date Jan 2000	Retest Required On JAN. 2027					
		Tank Type Deck Trailer			Certification Date Jan 2000	Original Test Date Jan 2000				
		Inspection Location WESTLOCK	VIN 4LF2Y4322Y3509626				Material FRP			
Phone (780) 897-9215		TCRN / MDIN / CRN SV16131			Unit No	MAWP 25 PSI		# Compartments 1		
Test Pressure		37.5 PSI			Test Medium				WATER	
PREPARATION		Complies N/A	Concerns	Fails	Re-test after repair	PIPING & ACCESSORIES	Complies N/A	Concerns	Fails	Re-test after repair
1. External & Internal visual (& thickness if required) done		X				1. Assemble hose and piping on unit	X			
2. Select proper gauges and SRV		X				2. Mount test head at top of piping	X			
3. Inspect reclosing vents, inert & red flag		X				3. Press to 80% MAWP&disconnect	X			
COMPARTMENT HYDRO TEST		Complies N/A	Concerns	Fails	Re-test after repair	4. Check for leaks & 10 min retention	X			
1. Mount test head at top. Visible from safe distance		X				5. Bleed off pressure & drain	X			
2. Fill test compartment		X				COMPLETION	Complies N/A	Concerns	Fails	Re-test after repair
3. Pressure up to Test pressure & disconnect hose		X				1. Flush per 300WP	X			
4. Check for leaks &/or 10min retention/Bleed off pressure to MAWP/10min retention		X				2. Tag valve & placard if required	X			
5. Apply soap water, check for leask and/or Bleed off pressure		N/A				3. Sticker as appropriate	X			
6. Activate vent to confirm set pressure. Bleed off pressure & drain		X				4. Original Wabash file. Copies to owner	X			
PRV	Compartment 1	Compartment 2	MC330/331 / TC331/341/11/51/60 tanks only							
Make	GIRARD	GIRARD	1. Is tank QT or NQT N/A							
Serial Number	113698001001	113698001002	2. Stress relieved after manufacture? (New Tanks) N/A							
Set Pressure	30 PSI	30 PSI	3. If applicable: Stress relief after repair? N/A							
Compartment 3	Compartment 4	Compartment 5	Location:							
Comments:/Description of Repair:										
Current Disposition of Tank Tested										
New Tank Entered in to Service <input type="checkbox"/> Returned to Service <input checked="" type="checkbox"/> Repair Required <input type="checkbox"/> Condemned (removed from service) <input type="checkbox"/>										
CERTIFICATE OF INSPECTION COMPLIANCE										
We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.										
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93										
Inspector Signature 		Tester Signature 								
Name:	MAURY LITKE	Name:	FREDDIE TUBOG							
Title:	INSPECTOR	Title:	TESTER							
Date:	JAN. 4- 2022	Date:	JAN. 4- 2022							

 <p>9312 - 110A Street Westlock, AB Canada 780-349-4282</p>		<b>Quality Assurance Record</b> <b>UPPER COUPLER TEST</b>				Test Date <b>JAN. 4- 2022</b>			
		Tank S/N 2641199		WO No. SV-22318					
Owner <b>RYDER FLUID SOLUTIONS</b> BOX 3014 CLAIRMONT, A.B T8X 0W0		Tank Mfr Advance		Tank Spec TC 312 RP		Mfr Date JAN.2000	Retest Required On JAN. 2027		
		Tank Type DECK TRAILER				Certification Date JAN. 2000	Original Test Date JAN. 2000		
		Inspection Location Westlock	VIN 4LF2Y4322Y3509626			Material FRP			
Phone (780) 897-3215	TCRN / MDIN / CRN SV16131		Unit No	MAWP 25 psi		# Compartments 1			
Trailer Mfr <b>L &amp; S CRYOGENICS INC</b>			Trailer Material STEEL	Trailer Mfr Date DEC. 99					
<b>PREPARATION</b>		<b>YES</b>	<b>NO or N/A</b>	<b>VISUAL OF HIDDEN AREA</b>		Complies	Concerns	Fails	Re-test after repair
1. Trailer Blocked		X		1. Corrosion		X			
2. Visual of Upper Coupler		X		2. Abrasion		X			
3. Any Loose or Missing Bolts?		X		3. Cracks		X			
4. Remove Upper Coupler		X		4. Dents		X			
4. Reinstall Upper Coupler			X	5. Distortions		X			
5. Replace Upper Coupler		X		6. Weld Defects		X			
				7. Other Weakness		X			
				8. Repaired as Necessary		X			
				<b>COMPLETION</b>		Complies	Concerns	Fails	Re-test after repair
				1. Original Wabash File		X			
				2. Copies to Owner		X			
Comments:									
<b>Current Disposition of Trailer Upper Coupler Tested</b>					<b>Weld Required</b>			<b>NO</b>	
<b>RETURNED TO SERVICE</b>									
<b>CERTIFICATE OF INSPECTION COMPLIANCE</b>									
We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.									
<b>Wabash Mfg Inc - TC TDG Certificate of Registration #25-93</b>									
Inspector Signature 									
Name: MAURY LITKE									
Title: INSPECTOR									
Date: JAN. 4- 2022									

