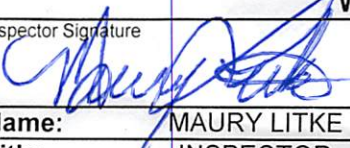
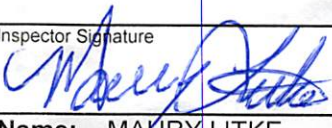


J20-24

		9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Control Record PRESSURE TEST REPORT				QF-044			
								Rev: 4 Page 1 of 1			
Owner Larson Management Inc. 240, 6715 8th Street NE Calgary, AB T2E 7H7		Tank S/N 5HTDL4030D5G25306		WO No. SV-23502		Test Date MAR. 1- 2023					
		Mfr HEIL		Tank Spec DOT 407		Mfr Date Feb 2013					
		Tank Type SUPER B LEAD		Certification Date Feb 2013		Retest Required On MAR. 2028					
		Inspection Location WESTLOCK		VIN 5HTDL4030D5G25306		Original Test Date Feb 2013					
Phone		TCRN / MDIN / CRN		Unit No 310005		MAWP 35PSI		# Compartments 1			
Test Pressure		52.5 PSI		Test Medium		WATER					
PREPARATION		Complies N/A	Concerns	Fails	Re-test after repair	PIPING & ACCESSORIES		Complies N/A	Concerns	Fails	Re-test after repair
1. External & Internal visual (& thickness if required) done		X				1. Assemble hose and piping on unit		X			
2. Select proper gauges and SRV		X				2. Mount test head at top of piping		X			
3. Inspect reclosing vents, inert & red flag		X				3. Press to 80% MAWP & disconnect		X			
COMPARTMENT HYDRO TEST		Complies N/A	Concerns	Fails	Re-test after repair	4. Check for leaks & 10 min retention		X			
1. Mount test head at top. Visible from safe distance		X				5. Bleed off pressure & drain		X			
2. Fill test compartment		X				COMPLETION		Complies N/A	Concerns	Fails	Re-test after repair
3. Pressure up to Test pressure & disconnect hose		X				1. Flush per 300WP		X			
4. Check for leaks &/or 10min retention/Bleed of pressure to MAWP/10min retention		X				2. Tag valve & placard if required		X			
5. Apply soap water, check for leak and/or Bleed off pressure		N/A				3. Sticker as appropriate		X			
6. Activate vent to confirm set pressure. Bleed off pressure & drain		X				4. Original Wabash file. Copies to owner		X			
PRV		Compartment 1		Compartment 2		MC330/331 / TC331/341/11/51/60 tanks only					
Make		GIRARD				1. Is tank QT or NQT					
Serial Number		73382002003				2. Stress relieved after manufacture? (New Tanks)					
Set Pressure		42 PSI 10" HG				3. If applicable: Stress relief after repair?					
Compartment 3		Compartment 4		Compartment 5		Location:					
Comments:/Description of Repair:										TANK VOLUME (LITERS)	32,640
Current Disposition of Tank Tested											
New Tank Entered in to Service ☐ Returned to Service ☒ Repair Required ☐ Condemned (removed from serv											
CERTIFICATE OF INSPECTION COMPLIANCE											
We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.											
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93											
Inspector Signature				Tester Signature				Welder & Weld Procedure:			
											
Name: MAURY LITKE				Name: JOENARD JOROLAN							
Title: INSPECTOR				Title: TESTER							
Date: MAR. 1- 2023				Date: MAR. 1- 2023							

		9312 - 110A Street Westlock, AB Canada 780-349-4282		Quality Assurance Record UPPER COUPLER INSPECTION				Test Date MAR. 1- 2023			
		Tank S/N 5HTDL4030D5G25306		WO No. SV-23502							
Owner Larson Management Inc. 240, 6715 8th Street NE Calgary, AB T2E 7H7		Tank Mfr HEIL		Tank Spec DOT 407		Mfr Date Feb 2013		Retest Required On Mar 2028			
		Tank Type SUPER B LEAD		Certification Date Feb 2013		Original Test Date Feb 2013					
		Inspection Location Westlock		VIN 5HTDL4030D5G25306		Material 5454-H32					
Phone		TCRN / MDIN / CRN		Unit No 310005		MAWP 35PSI		# Compartments 1			
Trailer Mfr HEIL		Trailer Material STEEL		Trailer Mfr Date: FEB. 2013							
PREPARATION		YES		NO or N/A		VISUAL OF HIDDEN AREA		Complies	Concerns	Fails	Re-test after repair
1. Trailer Blocked		X				1. Corrosion		X			
2. Visual of Upper Coupler		X				2. Abrasion		X			
3. Any Loose or Missing Bolts?		X				3. Cracks		X			
4. Remove Upper Coupler		X				4. Dents		X			
4. Reinstall Upper Coupler		X				5. Distortions		X			
5. Replace Upper Coupler				X		6. Weld Defects		X			
						7. Other Weakness		X			
						8. Repaired as Necessary		X			
						COMPLETION		Complies	Concerns	Fails	Re-test after repair
						1. Original Wabash File		X			
						2. Copies to Owner		X			
Comments: NO DEFECTS FOUND											
Current Disposition of Trailer Upper Coupler Tested				Weld Required				YES	NO		
CERTIFICATE OF INSPECTION COMPLIANCE We certify that the statements in this report are correct and the said unit has been inspected in accordance with D.O.T. Regulations, Transport Canada Regulations and Alberta Regulations.											
Wabash Mfg Inc - TC TDG Certificate of Registration #25-93											
Inspector Signature											
Name: MAURY LITKE											
Title: INSPECTOR											
Date: MAR. 1- 2023											