

S17-1
GR-FEB



Trailer Quarterly Inspection



Date	2026/01/13	Unit	23	CVIP Due	6/2026
License Plate	6JB2-28	Mileage	1260081		

✓ Indicates Pass X indicates Fail (Comments must be made on all Failures)

Undercarriage	
1	Inspect for Damage
2	Inspect 5th Wheel Plate & King Pin
3	Inspect Landing Gear / Operation
4	Inspect Frame & Cross Members (Cracks/Damage)
5	Inspect Suspension Components (Damage/Wear)
6	Check Brake Components (Record)
7	Check Brake Operation
8	Adjust Brakes
9	Check Air System (Leaks)
10	Check Wheel bearing, hubs, Seals, Oil Level
11	Grease

Exterior	
1	Check all Lights, Refectors, Reflective Tape
2	Check Fenders, Mud Flaps
3	License Plate Condition
4	Check Tire Condition (record)
5	Check Tire Pressure (record) Adjust if Necessary
6	Visual inspection of Rims, Studs, Lug Nuts
7	Tires Rotated (Except Wheelers)
8	Torque Wheel Nuts
Secondary Attachments	
1	Signs, Placard Holders
2	Tool/Storage Boxes
3	Strap Rollers
4	Tarps, (Inspect, Lube, Confirm Operation)

PSI & Tread Depth

PSI	100	100					100	100
32nd	9mm	11mm					11mm	8mm
	100	100					100	100
	10mm	11mm					9mm	10mm
	100	100					100	100
	10mm	11mm					10mm	12mm
	100	100					100	100
	13mm	14mm					13mm	12mm
	100	100					100	100
	13mm	14mm					13mm	12mm

Brake Lining & Travel

Thickness	10mm	8mm	
Travel	1.5in	1.5in	
	2in	8mm	
	1.25in	1.25in	
	8mm	8mm	
	1.5in	1.5in	



All Repairs must be recorded on a Shop Repair/Work Order

Comments:

Inspected by: Colten Mark

Signature: Becky

Legend:

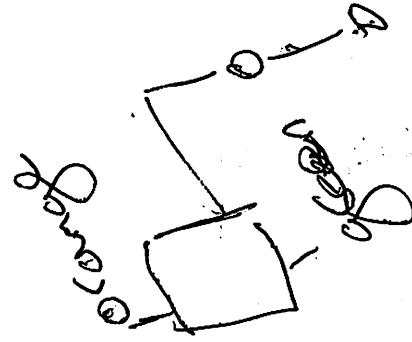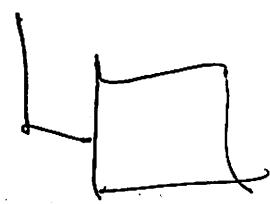

*ILLUST DO Tires Use Inspection
One Axle Each Side

*Inspection
min 4 Hrs



Trailer Quarterly Inspection



Date	Oct 3/25	Unit	23	CVIP Due	06/2026
License Plate	65BZ-28	Mileage	124 293		

✓ Indicates Pass X indicates Fail (Comments must be made on all Failures)

Undercarriage	
1	Inspect for Damage
2	Inspect 5th Wheel Plate & King Pin
3	Inspect Landing Gear / Operation
4	Inspect Frame & Cross Members (Cracks/Damage)
5	Inspect Suspension Components (Damage/Wear)
6	Check Brake Components (Record)
7	Check Brake Operation
8	Adjust Brakes
9	Check Air System (Leaks)
10	Check Wheel bearing, hubs, Seals, Oil Level
11	Grease

Exterior	
1	Check all Lights, Refectors, Reflective Tape
2	Check Fenders, Mud Flaps
3	License Plate Condition
4	Check Tire Condition (record)
5	Check Tire Pressure (record) Adjust if Necessary
6	Visual inspection of Rims, Studs, Lug Nuts
7	Tires Rotated (Except Wheelers)
8	Torque Wheel Nuts
Secondary Attachments	
1	Signs, Placard holders
2	Tool/Storage Boxes
3	Strap Rollers
4	Tarps, (Inspect, Lube, Confirm Operation)

PSI	100	100	95	90			
32nd	11	12	10	9			
	95	95	97	96			
	15	15	12	10			
	98	98	100	98			
	16	15	13	13			

Brake Lining & Travel		
Thickness	8	1/2
Travel	1/2	1/2
	1/38	1/4
	1/58	1/58
	1/98	8

All Repairs must be recorded on a Shop Repair/Work Order

Comments: electrical hookup missing
cover

Inspected by: Mark Fiedl

Signature: MF



Trailer Quarterly Inspection



Date	11 June 25	Unit	23	CVIP Due	June 25.
License Plate	6JBZ-28	Mileage	113705		

✓ Indicates Pass X indicates Fail (Comments must be made on all Failures)

Undercarriage	
1	Inspect for Damage
2	Inspect 5th Wheel Plate & King Pin
3	Inspect Landing Gear / Operation
4	Inspect Frame & Cross Members (Cracks/Damage)
5	Inspect Suspension Components (Damage/Wear)
6	Check Brake Components (Record)
7	Check Brake Operation
8	Adjust Brakes
9	Check Air System (Leaks)
10	Check Wheel bearing, hubs, Seals, Oil Level
11	Grease

Exterior	
1	Check all Lights, Refectors, Reflective Tape
2	Check Fenders, Mud Flaps
3	License Plate Condition
4	Check Tire Condition (record)
5	Check Tire Pressure (record) Adjust if Necessary
6	Visual inspection of Rims, Studs, Lug Nuts
7	Tires Rotated (Except Wheelers)
8	Torque Wheel Nuts
Secondary Attachments	
1	Signs, Placard holders
2	Tool/Storage Boxes
3	Strap Rollers
4	Tarps, (Inspect, Lube, Confirm Operation)

PSI & Tread Depth

PSI	100	100				100	100
	5	8				9	5
32nd	100	100				100	100
	8	NEW				9	10
Tread	100	100				100	100
	NEW	NEW				14	14

Brake Lining & Travel

Thickness	8	8		
	1 1/2	1 1/2		
Travel	8	6		
	1 1/2	1 1/2		
Travel	8	8		
	1 1/2	1 1/2		

All Repairs must be recorded on a Shop Repair/Work Order

Comments:

Three new were fitted on the rear.
One tube of grease was used to grease up.

Inspected by:

IAN

Signature:





Trailer Quarterly Inspection



Date	28 MARCH 24	Unit	23	CVIP Due	June
License Plate	6JB2-28	Mileage	89392		

✓ Indicates Pass X indicates Fail (Comments must be made on all Failures)

Undercarriage	
1	Inspect for Damage
2	Inspect 5th Wheel Plate & King Pin
3	Inspect Landing Gear
4	Inspect Frame & Cross Members (Cracks/Damage)
5	Inspect Suspension Components (Damage/Wear)
6	Check Brake Components (Record)
7	Check Brake Operation
8	Adjust Brakes
9	Check Air System (Leaks)
10	Check Wheel bearing, hubs, Seals, Oil Level
11	Grease

Exterior	
1	Check all Lights, Refectors, Reflective Tape
2	Check Fenders, Mud Flaps
3	License Plate Condition
4	Check Tire Condition (record)
5	Check Tire Pressure (record) Adjust if Necessary
6	Visual inspection of Rims, Studs, Lug Nuts
7	Tires Rotated (Except Wheelers)
8	Torque Wheel Nuts
Secondary Attachments	
1	Signs, Placard holders
2	Tool/Storage Boxes
3	Strap Rollers
4	Tarps, (Inspect, Lube, Confirm Operation)

PSI & Tread Depth

PSI	100	100					100	100
32nd	13	5	4				5	12
	100	100					100	100
	13	8	0			0	3	7
	100	100					100	100
	4	6					8	6

Brake Lining & Travel

Thickness			
Travel	1 1/2	1 1/2	
	1 1/2	1 1/2	
	1 1/2	1 1/2	

Comments: Pass axle inside # 2 wheel is in bad shape'

Inspected by:

Vince.

Signature:



Northern Trailer and Truck

2210 - 19 Avenue

Wainwright, AB T9W 1L2, CA

northerntrailerandtrucksales@gmail.com

780-842-0080



Invoice

10596

Date:

3/26/2024

Bill To

Cutting Edge Ventures
 Box 2909
 Wainwright, AB T9W 1S8, CA
 P: 780-842-0624

ENTERED

Terms	Due Date	CS	Unit #	Purchase Order
COD	3/26/2024	3872	23 - 2018, Peak, WBoy; Plate: 5TW600 (VIN: 2N9FG4030JE065372)	

Line	Part #	Description	Quantity	UOM	Rate	Amount
1	FBC-90554107	PRESSURE PROTECTION VALVE	1	ea	\$73.50	\$73.50
					Subtotal	\$73.50
					GST (5.0000% of \$73.50)	\$3.68
					Total	\$77.18
					Payments & Credits	\$0.00
					Balance Due	\$77.18

WE ACCEPT DEBIT AND CREDIT CARD PAYMENT

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection.

Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of the repairs there to.

All parts removed will be discarded unless instructed otherwise: save all parts ____.

NORTHERN TRAILER AND TRUCK SALES LTD. IS NOT RESPONSIBLE FOR LOSS OF OR DAMAGE TO VEHICLES OR ARTICLES LEFT IN VEHICLES IN THE CASE OF FIRE, THEFT, OR ANY OTHER CAUSE.

NORTHERN TRAILER AND TRUCK SALES ASSUMES THE RIGHT TO CHARGE 2% ON ANY INVOICE OUTSTANDING OVER 30 DAYS.



Trailer Quarterly Inspection



Date	26 MAR 25	Unit	23	CVIP Due	June 25
License Plate	6J32-28	Mileage	105291		

✓ Indicates Pass X indicates Fail (Comments must be made on all Failures)

Undercarriage	
1	Inspect for Damage
2	Inspect 5th Wheel Plate & King Pin
3	Inspect Landing Gear / Operation
4	Inspect Frame & Cross Members (Cracks/Damage)
5	Inspect Suspension Components (Damage/Wear)
6	Check Brake Components (Record)
7	Check Brake Operation
8	Adjust Brakes
9	Check Air System (Leaks)
10	Check Wheel bearing, hubs, Seals, Oil Level
11	Grease

Exterior	
1	Check all Lights, Refectors, Refleective Tape
2	Check Fenders, Mud Flaps
3	License Plate Condition
4	Check Tire Condition (record)
5	Check Tire Pressure (record) Adust if Neccesary
6	Visual inspectin of Rims, Studs, Lug Nuts
7	Tires Rotated (Except Wheelers)
8	Torque Wheel Nuts
Secondary Attachments	
1	Signs, Placard holders
2	Tool/Storage Boxes
3	Strap Rollers
4	Tarps, (Inspect, Lube, Confrim Operation)

PSI & Tread Depth

PSI	100	100					100	100
32nd	8mm	9mm					5mm	10mm
	100	100					100	100
	10mm	6mm					10mm	11mm
	100	100					100	100
	3mm	2mm					2mm	3mm

Brake Lining & Travel			
Thickness	10mm		8mm
Travel	1 1/2		1 1/2
	8mm		8mm
	1 1/2		1 1/2
	10mm		10mm
	1 1/2		1 1/2

All Repairs must be recorded on a Shop Repair/Work Order

Comments:

Broken deck boards (replaced with steel plate)

Broken air fitting Glad hand at the rear.

Inspected by: IAN

Signature: IAN