


T28-3  
MAY

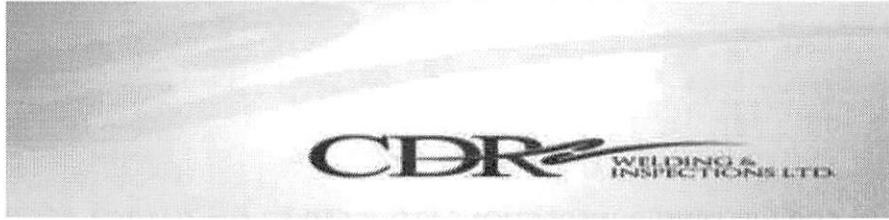

CDR WELDING & INSPECTIONS LTD. 5519-67 Ave T9V 3G7  
Lloydminster, Alberta Reg# 25-969

**BOSS VAC ENTERPRISES**

**UNIT # 304**

**TRUCK VIN# 1M2AG10C77M066740**

**TANK VIN# 2AEATBBOX7R000131**

**INSPECTION COMPLETED: P.V.I.K. Pressure, Visual, Internal & Leak**

**DATE: April 21, 2026**

**NEXT INSPECTION DUE: V.K. Visual & Leak**

**April 30, 2027**

**TC SPEC: 406**

**04/26 P.V.I.K. 969**

EXTERNAL VISUAL INSPECTION

Type of Inspection Performed	Pass Y/N	Repaired Y/N	Comments
Inspect tank, shell, heads, and attachments for corroded abraded areas, dents distortions, defects in welds and signs of leakage. Note: Corroded or abraded areas shall be thickness tested.	N	Y	Repaired D/S fender support bracket (3 cracked)
Inspect external piping, condition of valves, gaskets, pressure gauges and check for signs of leakage.	Y		
Ensure devices for tightening manhole covers are operative and covers are leak tight.	Y		
Ensure proper functioning of all valves, vents, pressure relief devises, emergency devices including self-closing stop valves, excess flow valves, remote closure devices, ensure free of corrosion, distortion, leakage or any condition that would prevent normal operation.	Y		
Ensure all nuts and bolts are in place and properly tightened.	Y		
Inspect all major appurtenances, attachments and connecting structures for damages, corrosion, cracks as to affect safe operation of the vehicle.	Y		
Upper Coupler: Without removing upper coupler assembly inspect coupler plate and kingpin for corrosion, abrasion, damage, warp age, and cracks to insure safe operation.	N/A		
On tanks transporting lading corrosive to the tank, remove the upper coupler plate and inspect the upper coupler and area covered by the upper coupler. Inspect for damage, corrosive, cracks, distortions, abrasion of any other condition that might render the tank safe for transportation. Frequency: Once in each 5 year period.	N/A		
Multi compartment tanks: Inspect void drains for signs of leakage; ensure drains are operable and unplugged or uncapped during inspection.	N/A		
Inspect tank mounting hardware and sub frame	Y		
Full opening rear heads; Inspect gaskets for cuts, cracks, splits and replace if likely to cause leakage or cuts, cracks are a depth of 12.7 mm (0.5) or more.	N/A		
Ensure all specification data plates and other safety marks are legible.	Y		

Tank Disposition: Good Pass return to service; Yes Fail remove from service: No

Date of external visual inspection: April 21, 2026

Date of next required external Inspection: April 30, 2027 Unit # 304

Has the Tank been tested after repairs have been completed: Yes

This Inspection is conducted in accordance with and meets requirements of CSA: 620- 20

REG. FACILITY REPRESENTATIVE

OWNER/OWNERS REPRESENTATIVE

NAME: Devin Fialkowski

COMPANY NAME: Boss Vac Enterprises

PHONE# 780-875-4920

PHONE# 306-753-7868

ADDRESS: 5519-67 Ave Lloydminster, AB

ADDRESS: Macklin, SK

SIGNATURE 

SIGNATURE: \_\_\_\_\_

**\*NO HOSES TESTED DURING INSPECTION\***

**INTERNAL VISUAL INSPECTION**

<b>Type of inspection performed</b>	<b>pass Y/N</b>	<b>Repaired Y/N</b>	<b>Comments</b>
Inspect tank shell and heads for corroded areas, bad dents, digs, gouges, scrapes, defects in weld (check for conditions that indicate weakness that might render the tank unsafe for transportation. Note: Corroded or abraded areas shall be thickness tested.	Y		
Inspection of internal piping, valves, flanges, and attachments including gaskets (check for leakage and areas of weakness)	Y		
Check condition of internal self- closing valve	Y		
Inspect baffle integrity and attachments for cracks, corroded areas, dents, distortions and defects in welds.	Y		
Check operation of level gauging device	Y		

**Tank Disposition: Good Pass return to service YES Fail remove from service: No**

**Date of internal visual inspection: April 21, 2026**

**Date of next required internal inspection: April 30, 2031                      Unit # 304**

**Has the Tank been tested after repairs have been completed: Yes**

**This inspection is conducted in accordance with and meets requirements of CSA B620-20**

**REG. FACILITY REPRESENTATIVE:**

**OWNER/OWNERS REPRESENTATIVE**

NAME : Devin Fialkowski


COMPANY NAME: Boss Vac Enterprises

ADDRESS: 5519-67 Ave Lloydminster, AB

ADDRESS: Macklin, SK

Phone: 780-875-4920

Phone: 306-753-7868

SIGNATURE: 

SIGNATURE: \_\_\_\_\_