



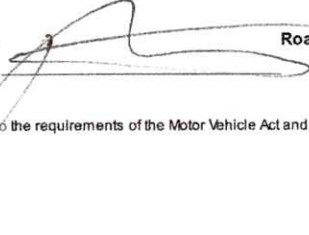
Commercial Vehicle Inspection Report

Decal Number: GM80847
Decal Expiry Date: 2027-Mar-31
Inspection Number: 21917849

Inspection Result:
PASS

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	80	82	Lining (Shoe)	15	15	Drum		
2	50	60	Lining (Shoe)	18	15	Drum		
3	0	70	Lining (Shoe)	17	17	Drum		
4	75	65	Lining (Shoe)	15	15	Drum		
Comment:			Comment:			Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.		

Inspection Comments:

Has this Vehicle been road tested? No
Inspector: STEWART, PEARCE Hunter
Road Test Date: 2
Signature: 
Road Tester:

This Inspection Report was submitted to CVSE on 2026-Sep-14 12:25 PM MST
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NS/CV/P at the Commercial Vehicle Safety Enforcement

CV/SE0014

9/14/2026 12:25:11 PM MST



Commercial Vehicle Inspection Report

Decal Number: GM80847
Decal Expiry Date: 2027-Mar-31
Inspection Number: 21917849

Inspection Result:

PASS

FACILITY: MADROCK ENTERPRISES LTD. / S20367
INSPECTOR: STEWART, PEARCE Hunter / 201510
WORK ORDER #:

INSP. TYPE: Complete
INSP. CLASS: Class 2 - Heavy Vehicle with LGVW 5501 kg or more
INSP. REASON: Semi-annual

INSP. START: 2026-Sep-14 08:30 AM MST
INSP. COMPLETE: 2026-Sep-14 10:30 AM MST

J01-1

VEHICLE JUR: British Columbia
PLATE #: WP4170
LICENCED GVW(kg): 63500
VEHICLE YEAR: 2021
MAKE: KENWORTH
MODEL:

REGI: 14713698
UNIT/FLEET#: 20201
BODY STYLE: Truck Tractor
ODOMETER: 537578 KM
HUB ODOMETER:
BRAKE TYPE: Air
FUEL TYPE:

VIN: 1XKWP4EX7MR968833
OWNER/LESSEE NAME: SAGE CREEK OILFIELD, NA
ADDRESS: 1111 ENTERPRISE WAY
Fort St John, British Columbia
V1J 8C9, Canada

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Passed
Section 2 - Suspension	Repaired (same day) LOOSE SHOCKS
Section 3 - Brake System	Repaired (same day) #2 RIGHT SLACK NOT WORKING
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Passed
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Passed

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles	Type	Size	Slack Adj.	Left	Right
1	Clamp	20XL	Automatic	40	40
2	Clamp	30L	Automatic	30	32
3	Clamp	30L	Automatic	30	30
4	Clamp	30L	Automatic	30	30

Comment: #3 REPLACED, SIEZED

Tire Tread Depth (mm)

Outer L	Inner L	Inner R	Outer R	Steering
14			19	✓
23	24	23	21	
24	22	22	22	
23	23	23	22	

Comment:

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/IP at the Commercial Vehicle Safety Enforcement.

CVSE0014

9/14/2026 12:25:11 PM MST