



BRITISH COLUMBIA

Commercial Vehicle Inspection Report

Decal Number:

Decal Expiry Date:

Inspection Number:

2025-Jul-31

20992331

INSP. START:

INSP. COMPLETE:

2024-Jul-04 06:00 AM PDT

2024-Jul-04 08:00 AM PDT

TY:

CTOR:

K ORDER #:

MOTOR-WAY TRUCK AND TRAILER / S15040

MROKE, GURPAL SINGH / 108739

20881

INSP. TYPE:

INSP. CLASS:

INSP. REASON:

Complete

Class 3 - Ter and Semi-Trailer

Annual

REGI:

UNIT/FLEET#:

BODY STYLE:

ODOMETER:

HUB ODOMETER:

BRAKE TYPE:

FUEL TYPE:

03744677

533V209

Van Trailer

1243 KM

Air

VIN:

OWNER/LESSEE NAME:

ADDRESS:

5V8VA53B37M700303

COMOX, COMOX VALLEY DISTRIBUTION LTD

11398 BRIDGEVIEW DRIVE

Surrey, British Columbia

V3R0C2, Canada

VEHICLE JUR:

VEHICLE #:

VEHICLE GVW(kg):

VEHICLE YEAR:

VEHICLE MAKE:

VEHICLE MODEL:

British Columbia

62481B

999999

2007

VANGUARD

Vehicle Identification (VIN)

Section 1 - Power Train

Section 2 - Suspension

Section 3 - Brake System

Section 3A - Air Brakes

Section 3H - Hydraulic Brakes

Section 4 - Steering

Section 5 - Instruments and Auxiliary Equipment

Section 6 - Lamps

Section 7 - Electrical System

Section 8 - Frame and Body

Section 9A - Tires

Section 9B - Wheels

Section 10 - Coupling Devices

Section 11 - Other Vehicle Components

Passed

Not Applicable

Repaired (same day)

Passed

Passed

Not Applicable

Not Applicable

Not Applicable

Passed

Passed

Passed

Repaired (same day)

Passed

Not Applicable

REPLACED AXLE# 2 BOTH SIDES SHOCKS.

REPLACED AXLE# 3 LEFT SIDE HUB CAP PLUG.

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles

Type

Size

Slack Adj.

Left

Right

1

Clamp

30

Automatic

45

50

2

Clamp

30

Automatic

45

45

3

Clamp

30

Automatic

40

40

Tire Tread Depth (mm)

Outer L

Inner L

Inner R

Outer R

Steering

10

10

13

13

21

20

16

13

13

14

12

12

Comment:

Air Brake Camshaft Rotation (degrees)

Axles

Left

Right

1

60

70

2

55

40

3

45

45

Brake Lining/Pad (mm)

Lining/Pad

Left

Right

Lining (Shoe)

16

16

Lining (Shoe)

16

16

Lining (Shoe)

18

18

Comment:

Rotor Thickness or Drum Inside Diameter (mm)

Rotor/Drum

Left

Right

Drum

420.65

420.95

Drum

420.15

420.31

Drum

420.10

420.03

Comment:

Inspection Comments:

Has this Vehicle been road tested?


Inspector:

No

MROKE, GURPAL SINGH

Road Test Date:

Signature:

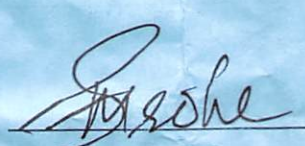

Road Tester:

This Inspection Report was submitted to CVSE on 2024-Jul-04 11:45 AM PDT

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/VP at the Commercial Vehicle Safety Enforcement

CVSE0014

7/4/2024 11:46:02 AM PDT

Page 1 of 1

