

FACILITY: OCEAN TRAILER / S6173
INSPECTOR: PANTOVIC, JOVICA / 202071
WORK ORDER #: WO2814

VEHICLE JUR: Alberta
PLATE #:

UNLICENSED GVW(kg): 0
VEHICLE YEAR: 2013
MAKE: UTILITY
MODEL: REEFER

INSP. TYPE: Complete
INSP. CLASS: Class 3 - Trailer and Semi-Trailer
INSP. REASON: Annual

REGI: UNIT/FLEET#: 58380
BODY STYLE: Semi Trailer
ODOMETER:
HUB ODOMETER: 14550 Miles
BRAKE TYPE: Air
FUEL TYPE: Not Applicable

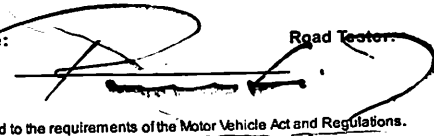
VIN: 1UYVS3530DU662505
OWNER/LESSEE NAME: C KEAY INVESTMENTS LTD, O/A OCEAN TRAILER
ADDRESS: 234136 84 ST SE
ROCKY VIEW, Alberta
T1X0K2, Canada

INSP. START: 2024-Apr-16 11:30 AM PDT
INSP. COMPLETE: 2024-Apr-16 12:30 PM PDT

Vehicle Identification (VIN)	
Section 1 - Power Train	Passed
Section 2 - Suspension	Not Applicable
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Passed
Section 4 - Steering	Not Applicable
Section 5 - Instruments and Auxiliary Equipment	Not Applicable
Section 6 - Lamps	Not Applicable
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Not Applicable

Brake Chamber Type, Size and Push Rod Stroke (mm)				Tire Tread Depth (mm)						
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	30	Automatic	32	32	6.4	6.4	6.4	6.4	
2	Clamp	30	Automatic	32	32	11.1	11.1	10.3	9.5	
3	Clamp	30	Automatic	32	32	6.4	6.4	4.8	4.8	
Comment:				Comment:						

Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	49	74	Lining (Shoe)	16	15	Drum		
2	64	52	Lining (Shoe)	16	16	Drum		
3	50	35	Lining (Shoe)	16	20	Drum		
Comment:			Comment:			Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.		

Inspection Comments:
Has this Vehicle been road tested? No
Inspector: PANTOVIC, JOVICA
Road Test Date:
Signature: 
Road Tester:
Inspection Report was submitted to CVSE on 2024-Apr-16 02:21 PM PDT
Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

