



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEM (WATER TRUCK)

Maintenance Request / Report Form

Information

406

Red Deer - Shop

Thursday, April 16th 2026, 4:20 PM (MDT -06:00)

Unit Information

Date: April 14, 2026

Select Unit Number: 406

KMs: # 43051

Hours: # 1563

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Cvip, engine light, crossmember between cab and tank cracked, driver door window track gets stuck going up

- took measurements
- intake pressure sensor ground wire damage, installed new ground wire
- full service engine, fuel, air, coolant filter, diff filter
- repaired driver door window track

Needs crossmember welded

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:



Red Deer Shop



FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Signatures

Luke Jacobsen, *Mechanic*



April 16th 2026, 4:20 PM (MDT -06:00)



52.2873867, -113.8638365



SEMI (WATER)

Brothers HDD Inc.
2002 23 Avenue,
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

406

Grand Prairie - Shop

Sunday, March 8th 2026, 3:59 PM (MDT -06:00)

Unit Information

Date:

March 8, 2026

Select Unit Number:

406

KMs:

1234

Hours:

1234

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):



Install hydrolic fluid cooler, mount it to the side of the pump box
Get hoses built to fit new system
Wire is fan so that when pto is in fan turned on
Replace hydrolic filter
Add 3 pails hydrolic oil
Run system and test while at operating temps to cheaks temps
Replace front drive axel left side brake pot

Serial/Part # if applicable:

Urgency of Repairs:

Select priority level of repairs:

☒ completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Grande Prairie Shop

FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:



Dewitt (David) Steinbrenner

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Signatures

Dewitt (David) Steinbrenner, *Mechanic/Driller*



March 8th 2026, 3:59 PM (MDT -06:00)

A handwritten signature in black ink, likely belonging to David Steinbrenner.



SEMI (WATER)

GP SHOP

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

406



Sage Creek KB 2601-021



Wednesday, February 4th 2026, 8:10 AM [MST -07:00]

Unit Information

Date:



February 4, 2026

Select Unit Number:



406

KMs:



57000

Hours:



1400

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.



Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):



Bad power drain, night switch does not work

Needs repair. Truck batteries drained in am, jumping to start.

Night switch replaced, power still to unit, grounded somewhere else in truck. Drain still occurring

Serial/Part # if applicable:

No Response

Urgency of Repairs:

Select priority level of repairs:



Standard Priority - Required within 3-5 days

Location of repairs being completed:

Pick the location where the repairs were completed:

 Grande Prairie Shop

FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:

 Dan Fontaine

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Original

Dan Fontaine, *Business Development*

 February 4th 2026, 8:10 AM [MST -07:00]

 55.8166358, -120.6899409



Revised on February 5th 2026, 8:03 AM [MST -07:00]

Current View

Dan Fontaine, *Business Development*

 February 5th 2026, 8:03 AM [MST -07:00]

 55.8166058, -120.6898824





SEMI (WATER TRUCK)

Brothers HDD Inc.
2002 23 Avenue,
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

406

Grand Prairie - Shop

Saturday, January 17th 2026, 10:45 AM [MST -07:00]

Unit Information

Date: January 15, 2026

Select Unit Number: 406

KMs: # 40920

Hours: # 9646

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Transmission noise, hydraulic control valve damaged/leaking

- repaired air bag line
- topped up fluids
- replaced hydraulic control valve
- replaced bowie pump
- replaced hydraulic motor
- replaced hydraulic lines on pto
- replaced tire
- rewiring brake controller
- repaired trailer plug wiring

Serial/Part # if applicable:

No Response

Urgency of Repairs:

Select priority level of repairs:

 Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

 Grande Prairie Shop

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Original

Luke Jacobsen, *Mechanic*

 January 17th 2026, 10:45 AM (MST -07:00)

 55.309434, -118.7972397



Revised on January 20th 2026, 5:22 PM (MST -07:00)

Current View

Luke Jacobsen, *Mechanic*

 January 20th 2026, 5:22 PM (MST -07:00)

 55.3093985, -118.7974245





Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEKI

(WATER TRUCK)

Maintenance Request / Report Form

Information

406

BHDD Shop

Wednesday, November 19th 2025, 1:55 PM [MST -07:00]

Unit Information

Date: November 19, 2025

Select Unit Number: 406

KMs: # 39158

Hours: # 6732

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Pto hydraulics slow

- changed pto filter
- changed pto breather

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



November 19th 2025, 1:55 PM (MST -07:00)



52.8514343, -110.8420946

A handwritten signature in black ink, appearing to be 'L. Jacobsen'.



SEMI (WATER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

406

Wallys DH 2508-004

Saturday, September 6th 2025, 9:50 AM (MDT -06:00)

Unit Information

Date: September 6, 2025

Select Unit Number: 406

KMs: # 37869.6

Hours: # 8752

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.


☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Need packing

2x 4" VICTOLIC GASKETS & NORTH STAR.

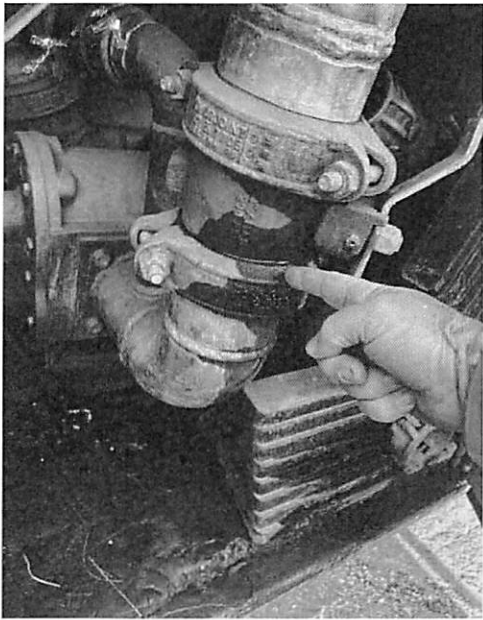

Serial/Part # if applicable: ≡ Do not know

Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

Requested By:

Worker Requesting Repairs:  Dale Hennig

Signatures

Dale Hennig, *Supervisor*

 September 6th 2025, 9:50 AM [MDT -06:00]

 52.6976371, -112.4486725





SEMI (WATER TRUCK)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 406

 BHDD Shop

 Thursday, August 14th 2025, 4:39 PM (MDT -06:00)

Unit Information

Date:  August 6, 2025

Select Unit Number:  406

KMs:  36484

Hours:  4174

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  Cvip
- replaced 3 drums
 - replaced power steering line
 - changed air filters
 - installed rain caps
 - replaced rear driveshafts

Trans output shaft/yoke has some play

Front and middle diff input shaft/yoke have some play

Front diff case halve starting to leak

Rear water tank valve leaking

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Location of repairs being completed:

Pick the location where the repairs were completed:



Wainwright Shop

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



August 14th 2025, 4:39 PM [MDT -06:00]



52.85132, -110.84209

Integra Tire Wainwright Ltd.
1613 - 1st Street Wainwright AB T9W 1L5

PH: 780-842-1500
FX: 780-842-1520

SOLD TO:
BRO001
BROTHERS HDD INC
2002 23 AVE

Invoice WAIR067318 (Copy)

SHIP TO
SAME

DATE: 25 May 27

Wainwright
T9W 0B8

AB

TEL:

FAX:

TEL: 780.214.7711

PAGE: 1

YEAR	MAKE	MODEL	ENGINE
PLATE NO	VIN	ODOMETER	UNIT NO.
		0	406
TIME IN	PROMISED	TERMS	P.O.
3:58 PM		NET 30	
			TAG

QTY	ITEM/DESCRIPTION	SIZE	TAX	NET	EXT.PRICE
4	HHS21711245	11R24.5	G	360.00	1440.00
4	MISC HUMSUNG HS217 ON/OFF DRIVE 16H		G	14.00	56.00
4	TIRE RECYCLING FEE - AB (Medium Truck, ETC)		G		165.00
4	COMT CHANGE OVER MEDIUM TRUCK W/PURCHASE CMG JAR		G	9.95	39.80
4	TEC545D VALVE		G		
1	MISC O-RING VALVE		G	20.38	20.38
	SHP				
	SHOP SUPPLIES				
	GST Registration# 820001915RT0001				
	**WARNING, WHEEL MANUFACTURERS RECOMMEND CHECKING THE TORQUE ON FASTENERS ON PASSENGER CARS/LIGHT TRUCKS AT 30-50 KM AND MEDIUM TRUCKS AT 80-160 KM AFTER EACH WHEEL REMOVAL AND INSTALL. THIS SERVICE IS PROVIDED FREE OF CHARGE. PLEASE SEE US TO HAVE THIS DONE. FAILURE TO DO SO MAY RESULT IN A WHEEL OFF SITUATION. AIR SET AT _____ WHEEL NUTS HAND TORQUED _____ FT. LBS				
	GST EXEMPT #:	PST EXEMPT #:			

PARTS:	1479.80
LABOUR:	165.00
OTHER:	76.38
SUB-TOTAL:	1721.18
GST:	86.06
PST:	N/C
TOTAL:	1807.24



MAINTENANCE WORK ORDER

Nº 3160

UNIT #: 406
ENGINE HOURS: 4068 hr
MILEAGE: 36476.2 km
WORK LOCATION: Wainwright Shop
WORK REQUESTED: _____

ORDER DATE: Feb 20 2025
COMPLETED DATE: Feb 20 2025
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Service, check fluids

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

Service 2

ENTERED
FEB 21 2025

LABOUR TOTAL _____

PARTS & MATERIALS

P.O. # QUANTITY PRICE AMOUNT

<u>Oil Filter</u>	<u>1</u>		
<u>Fuel Filter</u>	<u>1</u>		
<u>Fuel/Water Separator Filter</u>	<u>1</u>		
<u>OW-40 oil</u>	<u>38L</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Ron WORK COMPLETED BY: Lucas

UNIT RETURNED TO SERVICE: YES OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____



SEM

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

TYLER

Maintenance Request Form

Information

406

Midwest Ipl 2501 004

Monday, January 27th 2025, 9:25 AM [MST -07:00]

Unit Information

Date: January 27, 2025

Select Unit Number: 406

KMs: # 35

Hours: # 1

Repairs Required

Description of Repairs Required (attach photos):

Blower motor is not working

ON ROUTE FROM
VELOCITY JAN 28 to
WW

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Critical - Immediate attention needed

FIELD REPAIR

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

Requested By:

Worker Requesting Repairs:

Tyler Kleckner


Signatures

Tyler Kleckner, *Driller*

 January 27th 2025, 9:25 AM [MST -07:00]

 55.4984209, -110.8574728





406

MAINTENANCE REQUEST FORM

UNIT# 406

HRS/KM

THIR K

DESCRIPTION OF REPAIRS REQUIRED

HEATER BLOWER MOTOR.

REQUESTED BY:

DATE:

ADDITIONAL COMMENTS: _____

ENTERED
FEB 10/2025

UNIT #: 406
ENGINE HOURS: 35278.4
MILEAGE: _____
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: Dec/27/24
COMPLETED DATE: Dec/31/24
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: service fix exhaust leak
fix winter exhaust

TECH COMMENTS: _____

LABOUR DESCRIPTION: _____ HOURS

replaced pipe off the turbo
changed oil and fuel filters
fix winter exhaust

LABOUR TOTAL _____

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
filters		1		
pipe		1		
oil		15.42L		
flex hose		15 ft		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Ron WORK COMPLETED BY: chris

UNIT RETURNED TO SERVICE: YES OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 3069

UNIT #: 406

ENGINE HOURS:

MILEAGE: 32721

WORK LOCATION:

WORK REQUESTED:

ORDER DATE: SEPT 24/2024

COMPLETED DATE: SEPT 24/2024

JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED:

TECH COMMENTS:

LABOUR DESCRIPTION: HOURS

CHECKING OUT ELECTRICAL SYSTEM (GROUND POINTS, CHARGING
SYSTEM, BATTERY CONNECTIONS)
- FOUND POSITIVE FEED WIRE TO POWER RELAY BOX
NOT HOOKED UP

LABOUR TOTAL 2

PARTS & MATERIALS P.O. # QUANTITY PRICE AMOUNT

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: SHAYNE M WORK COMPLETED BY: RON J

UNIT RETURNED TO SERVICE: SEPT 24/2024 OVERALL CONDITION OF UNIT: UNKNOWN

ADDITIONAL COMMENTS:



MAINTENANCE WORK ORDER

Nº 2955

UNIT #: 406ENGINE HOURS: 8916.4MILEAGE: 30262.9WORK LOCATION: shop

WORK REQUESTED: _____

ORDER DATE: AUG/6/24COMPLETED DATE: AUG/16/24

JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: transmission leak fix air leak

TECH COMMENTS: _____

LABOUR DESCRIPTION: _____ HOURS

replaced seal and gasket fixed Air leak 4.3

LABOUR TOTAL _____

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
	<u>4</u>		
	<u>2</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: cony/ron WORK COMPLETED BY: chaseUNIT RETURNED TO SERVICE: yes OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 1589

UNIT #: 406
ENGINE HOURS: 8746
MILEAGE: 27380.0
WORK LOCATION: Wainwright
WORK REQUESTED: _____

ORDER DATE: Mar/14/24
COMPLETED DATE: _____
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: CVIP fit working lights put 2 new joints in
oil pan gasket grease it oil change

TECH COMMENTS: _____

LABOUR DESCRIPTION: _____ HOURS
took tires off took measurements replaced 2 joints 18
replaced oil pan gasket replace working lights
oil change/full service fit air track new gaskets on
trans inspection ~~oil~~ cover

LABOUR TOTAL _____

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>NAPA # 052-291362</u>	<u>CO-5585</u>	<u>4</u>		<u>\$335.93</u>
<u>FILTERS</u>				

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Cory/ron WORK COMPLETED BY: chase/cory

UNIT RETURNED TO SERVICE: _____ OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: _____

UNIT #: 4060
 ENGINE HOURS: _____
 MILEAGE: _____
 WORK LOCATION: _____
 WORK REQUESTED: Tyler K

ORDER DATE: Dec 19/23
 COMPLETED DATE: Jan 5/24
 JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____
 Cracked windshield.
 Electrical issues/light flicker
 Dump/PTO.
 Oil change

TECH COMMENTS: Oil pan is leaking

LABOUR DESCRIPTION:	HOURS

LABOUR TOTAL _____

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
<u>Oil filter</u>		<u>1</u>		
<u>Fuel filter</u>		<u>1</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Shane WORK COMPLETED BY: Chase
 UNIT RETURNED TO SERVICE: yes OVERALL CONDITION OF UNIT: good
 ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 1691

UNIT #: 406
ENGINE HOURS: 8204
MILEAGE: 21554
WORK LOCATION: Dawson Creek
WORK REQUESTED: _____

ORDER DATE: Nov 7
COMPLETED DATE: Nov 14 2023
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Hydraulics over heated
Frozen Pump cause Break Valve

TECH COMMENTS: _____

LABOUR DESCRIPTION: _____ HOURS

Change valve:
Pull apart valve spool Found metal chunks In
spool Reassembled and tested OK.

LABOUR TOTAL _____

PARTS & MATERIALS

Northern material P.O. # 4270 QUANTITY PRICE AMOUNT

PARTS & MATERIALS TOTAL 883.32

WORK AUTHORIZED BY: Con WORK COMPLETED BY: Con

UNIT RETURNED TO SERVICE: Nov 14 2023 OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 1668

UNIT #: 406
ENGINE HOURS: 8104
MILEAGE: 19749
WORK LOCATION: Felson.
WORK REQUESTED: _____

ORDER DATE: Sept 22 23
COMPLETED DATE: Sept 22-23
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Complaints of volts Bouncing around.

TECH COMMENTS: _____

LABOUR DESCRIPTION: Tested volts found gauge to be faulty HOURS 2

LABOUR TOTAL 2

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: _____ WORK COMPLETED BY: Con

UNIT RETURNED TO SERVICE: Sept 22-23 OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 1753

UNIT #: 406
ENGINE HOURS: _____
MILEAGE: _____
WORK LOCATION: WAINWRIGHT SHOP
WORK REQUESTED: _____

ORDER DATE: FEB 28/2023
COMPLETED DATE: FEB 28/2023
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

*REPAIR PTO AIR LINE ASSEMBLY (FITTING BROKEN OFF)
*REPAIRING MARKER LAMP SHORT (BURNED BY EXHAUST) RON (4)
*EXHAUST LEAK (TIGHTEN ALL EXHAUST MANIFOLD CLAMPS @ TURBO) RON (5)
*RE ROUTE FRONT MARKER WIRING (CRUSHED BY ANIMAL
GUARD)
LABOUR TOTAL 9

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
--------	----------	-------	--------

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: CORY R WORK COMPLETED BY: RON JEROME

UNIT RETURNED TO SERVICE: MARCH 1/2023 OVERALL CONDITION OF UNIT: _____

ADDITIONAL COMMENTS: NEEDS - AIRBAG DROP SYSTEM REPAIR
- WORK LAMPS 2 of 6 WORK
- WATER PUMP (BOULE - CORT?)



MAINTENANCE WORK ORDER

N^o 1615

UNIT #: 406
ENGINE HOURS: _____
MILEAGE: _____
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: Feb 6/23
COMPLETED DATE: Feb 6/23
JOB #: _____

W.O. TYPE (Circle): PM CVIR Reactive

REPAIRS REQUIRED: _____

Tail Light Stays on.
Water Pump Not working Properly

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

Tail lights are wired into the Tail switch.
Freightliner option (Safety).
Power Pump need engine to be 1600 RPM
New PO different ratio

LABOUR TOTAL _____

PARTS & MATERIALS

P.O. # QUANTITY PRICE AMOUNT

P.O. #	QUANTITY	PRICE	AMOUNT

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Shyne WORK COMPLETED BY: Car R

UNIT RETURNED TO SERVICE: _____ OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 1049

UNIT #: 406
ENGINE HOURS: _____
MILEAGE: _____
WORK LOCATION: CAVANAUGH SHOP
WORK REQUESTED: _____

ORDER DATE: FEB JAN 31/2023
COMPLETED DATE: FEB. 1/2023
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
- REPAIR COOLANT LEAK (LOOSE COOLANT FILTER) TIGHTEN HOSE CLAMPS	
- FILL SYSTEM WITH ANTI-FREEZE AND RUN TRUCK (NO MEDS)	3
- REPLACE WIPER BLADES	

LABOUR TOTAL 3

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>NAPA VAN # 052-760961</u>	<u>2105</u>			

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: CORY R WORK COMPLETED BY: RON JEROME

UNIT RETURNED TO SERVICE: FEB 1/2023 OVERALL CONDITION OF UNIT: _____

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

N^o 1076

UNIT #: 406

ENGINE HOURS:

MILEAGE: 12400

WORK LOCATION: Wer Viking

WORK REQUESTED:

ORDER DATE: Jan 8 2023

COMPLETED DATE: Jan 8 2023

JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Possible Blown engine

TECH COMMENTS: Drive to unit checked oil Found.

PASS to be tripped. Broken switch

LABOUR DESCRIPTION:

HOURS

Drive to unit and back 3

Reset PASS 1

change switch

LABOUR TOTAL 4

PARTS & MATERIALS

Toggle Switch

P.O. # QUANTITY PRICE AMOUNT

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: Cory

WORK COMPLETED BY: Cory

UNIT RETURNED TO SERVICE: Jan 8 2023

OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS:



MAINTENANCE WORK ORDER

N^o 1077

UNIT #: 406
ENGINE HOURS: _____
MILEAGE: 12600
WORK LOCATION: Callington Lake AB
WORK REQUESTED: _____

ORDER DATE: Jan 9 2023
COMPLETED DATE: Jan 10 2023
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Boiler Pump will not turn and
spool valve stuck

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
<u>Find metal chunks in spool valve</u>	<u>1</u>
<u>Turn motor apart and pulled chunks out</u>	<u>2</u>
<u>Travel</u>	<u>5</u>

LABOUR TOTAL 8

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Con R WORK COMPLETED BY: Con R

UNIT RETURNED TO SERVICE: Jan 10 2023 OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____

MAINTENANCE REQUEST FORM

UNIT# 406

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

- TURBO OUT EXHAUST BLOWN APART

- SERVICE

- REPAIR WINTER EXHAUST

- WASHM

- ELECTRICAL ISSUES BY STARTER?

(ASK MILES) ✓

- REAR LIGHTS | BRAKE LIGHTS

REQUESTED BY: JOHN A

DATE: DEC 27/24