



WESTERN STAR & FREIGHTLINER TRUCKS of GRANDE PRAIRIE

Address: 7802 - 110 Street | Grande Prairie, AB T8W 1M3
Phone: 780-513-2236 | Toll Free: 1-866-388-7827 | Fax: 780-513-2846

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

Invoice: 0020322820
Date / Hour: 6/11/2026 9:53:22AM
Repair Order: 22820
Customer:
Branch: GRP
Total Invoice: \$0.00

CHARGE AR

Page 1

SEMI (WATER)

Bill To: BROTHERS HDD INC.
2002-23 AVE
WAINWRIGHT, AB T9W 0B8

Ship To: BROTHERS HDD INC.
2002-23 AVE
WAINWRIGHT, AB T9W 0B8
Shop Phone:
Email:

UNIT # 409

Customer P/O: 16738

Add User: SWurtz

Open Date: 06/09/2026

Completion Date: 06/10/2026

Salesperson: HOUSE

Unit Number: 409

Model Year: 2024

Make/Model: WESTERN STAR 4900

Type: TRUCK

VIN: 5KKPBWD1XSPVP9148

Meter: 19538 Kilometers

ECM Reading: 2146

Task: 1 600023 CHECK ENGINE LIGHT DIAGNOSE

Department: SERVICE

600008

Complaint: DIAGNOSE CHECK ENGINE LIGHT IS ON
PRINTED OFF CODES

Cause: FAILING CRANKCASE SPINNER

Correction: BROUGHT TRUCK INSIDE. HOOKED UP LAPTOP. UNIT HAS RECENT FAULT 5444/1 CRANKCASE SPINNER SPEED TOO LOW. RAN ENGINE AND MONITORED SPINNER SPEED. AFTER 1 MINUTE OF IDLE THE SPINNER ONLY REACHED 542 RPM. TROUBLE SHOOTING STATES TO REPLACE ASSEMBLY. ORDERED PARTS. REMOVED INTAKE AND CAC PIPE FOR ACCESS. REMOVED AND REPLACED CRANKCASE BREATHER. REASSEMBLED. RAN ENGINE AND CONFIRMED SPINNER SPEED REACHING 5000 RPM AT IDLE. CLEARED INACTIVE CODES. TAGGED OLD SPINNER FOR WARRANTY. REPAIR COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	DDE CA4720108262	BREATHER ASSEMBLY - CRANKCASE VENTILATIO-Core	EA	-1.0	\$124.80	\$(124.80)
	DDE A4720180780	SEAL Oil separator to crankcase	EA	1.0	\$13.77	\$13.77
	DDE CA4720108262	BREATHER ASSEMBLY - CRANKCASE VENTILATIO-Core	EA	1.0	\$124.80	\$124.80
	DDE EA4720108262	BREATHER ASSEMBLY - CRANKCASE VENTILATIO	EA	1.0	\$657.98	\$657.98
	SS SVC	SHOP SUPPLIES		1.0	\$19.10	\$19.10

GST/HST Number: 892297052RT0001

Detail Tax Info:

Total Parts: \$0.00

Total Labor: \$0.00

Invoice Subtotal: \$0.00

Total Tax: \$0.00

Total Invoice: \$0.00

Payment Method

Terms

Due Date

CHARGE AR

NET 30

7/11/2026

Remit To

WESTERN STAR & FREIGHTLINER TRUCKS OF GRP
24210 - 114 AVENUE
ACHESON, AB T7X 6B9

UNIT # 409



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEMI (WATER)

Maintenance Request / Report Form

Information

409



BHDD Shop



Monday, May 25th 2026, 7:11 AM (MDT -06:00)

Unit Information

Date:



May 20, 2026

Select Unit Number:



409

KMs:



18565

Hours:



2113

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.



Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):



Cvip, service

- full service
- replaced pto pump
- repaired light wiring
- replaced clamp seal on belly valve

Serial/Part # if applicable:



No Response

Urgency of Repairs:

Select priority level of repairs:



Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

 Wainwright Shop

 FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome, Jason Brown, Jon Archibald.

Signatures

Luke Jacobsen, *Mechanic*

 May 25th 2026, 7:11 AM (MDT -06:00)

 52.8513295, -110.8421918





Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEMI (WATER TRUCK)

Maintenance Request / Report Form

Information

409

W/O # 63068120169

BHDD Shop

Tuesday, December 30th 2025, 10:08 AM (MST -07:00)

Unit Information

Date: December 30, 2025

Select Unit Number: 409

KMs: # 17413

Hours: # 1624

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

ENTERED
DEC 30 25

Repairs Required

Description of Repairs Required (attach photos):

Did full service.
Wrapped belly valve with insulation so it doesn't freeze.
Drained and refilled hydraulic tank for PTO. Someone put diesel in it.

INSTALL WINTER EXHAUST

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:



Wainwright Shop

Requested By:

Worker Requesting Repairs:



Chase Atkinson

Signatures

Chase Atkinson, *Laborer*



December 30th 2025, 10:08 AM [MST -07:00]



52.8511938, -110.8414486

Maintenance Request / Report Form

Information

 409

 2509-001 RA Lotus Creek

 Tuesday, September 2nd 2025, 9:38 AM (MDT -06:00)

Unit Information

Date:  September 2, 2025

Select Unit Number:  409

KMs:  15018

Hours:  1125

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.


☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

 ABS problems

LIGHT OUT.

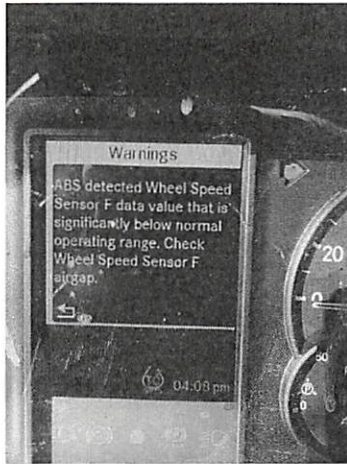

Serial/Part # if applicable:

 No Response


Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:



Requested By:

Worker Requesting Repairs:



Iaroslav Kvasha

Signatures

Iaroslav Kvasha, Driller



September 2nd 2025, 9:38 AM (MDT -06:00)



SEMI (WATER TRUCK)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 409

 BHDD Shop

 Friday, May 9th 2025, 7:01 AM (MDT -06:00)

Unit Information

Date:  May 7, 2025

Select Unit Number:  409

KMs:  9638

Hours:  877

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

 Cvip, checkover, need's new windshield
-greased
-installed wheel checks
-installed fire extinguisher

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Standard Priority - Required within 3-5 days

Location of repairs being completed:

Pick the location where the repairs were completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



May 9th 2025, 7:01 AM [MDT -06:00]



52.8513801, -110.8420857

A handwritten signature in black ink, appearing to be 'LJ' or similar, located to the right of the printed name and date.

**Daimler Truck North
America LLC**

SEMI (WATER TRUCK)

Daimler Truck North America LLC
P.O. Box 4090
Portland, OR 97208-4090
800.547.0712 Phone

May 2025

SF718

408/409

Subject: Transmission Oil Cooler Line Clearance

Daimler Truck North America LLC (DTNA), on behalf of its Freightliner Trucks Division, and wholly owned subsidiary, Western Star Truck Sales, Inc., is initiating Field Service Campaign SF718 to modify specific 2025-2026 Western Star 47X, 47X RHD, 48X RHD, 49X, 49X RHD vehicles, manufactured March 18, 2024, through April 9, 2025.

The transmission cooler lines may come in contact with nearby surfaces.

Daimler Truck North America authorized service facility will inspect the cooler line for damage and modify the recirculation baffle to ensure proper clearance.

Please contact an authorized DTNA dealer to arrange to have the campaign performed and to ensure that parts are available. The campaign will take approximately one hour and will be performed **free of charge**. To locate an authorized dealer, go to <https://northamerica.daimlertruck.com/brands/support>. At the bottom of the page click on the appropriate brand (shown as an icon), and at the top of each brand's page is an option to 'Find a Dealer'.

This Field Service Campaign will **terminate on May 31, 2026**. Please make sure the campaign is completed prior to this date. Work completed after this date will be done at the customer's expense.

As stated in the terms of your express limited warranty, Daimler Truck North America LLC will not pay for any damage caused by failure to properly maintain your vehicle. Daimler Truck North America LLC considers the work necessary under this campaign to be proper maintenance and, therefore, will not pay for any damage to your vehicle caused by your failure to have the repairs that are the subject of this campaign performed in a reasonable time.

If you have any questions, contact the Warranty Campaigns Department at (800) 547-0712, from 7 a.m. to 4 p.m. Pacific Time, Monday through Friday, e-mail address: dtna-war-campaigns@daimlertruck.com, or contact the Customer Assistance Center at (800) 385-4357.

WARRANTY CAMPAIGNS DEPARTMENT

Enclosure

MONDAY JUNE 30/2025

408 - RECALL | PTO

409 - RECALL | DRIVER HEADLAMP



SEMI (WATER TRUCK)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

409

w/o #000152

FSJ Shop

Thursday, April 17th 2025, 10:15 AM (MDT -06:00)

ENTERED
APR 28 2025

Unit Information

Date: April 11, 2025

Select Unit Number: 409

KMs: # 8273

Hours: # 644

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Oil change, oil filter, fuel filters grease truck completed

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Ft. St. John Shop

Requested by: 10/10/2025 10:10 AM

Worker Requesting Repairs:  Kirk Bauming

Signatures

Kirk Bauming, *Construction Coordinator - BC*



 April 17th 2025, 10:15 AM [MDT -06:00]

 56.2286589, -120.8331391



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information

 409



Paramount/WPW - D Hennig



Thursday, February 6th 2025, 8:07 AM (MST -07:00)

Unit Information

Date:



February 6, 2025

Select Unit Number:



409

KMs:



6167

Hours:



359

Repairs Required

Description of Repairs Required (attach photos):



This is just follow up check engine light is out

Serial/Part # if applicable:



Nothing required

Urgency of Repairs:

Select priority level of repairs:



No repair needed

Location of repairs being completed:

Pick the location where the repairs were completed:



Other (ie. Dealership/Town)

Requested By:

Worker Requesting Repairs:



Howard Ferron

Signature

Howard Ferron, *Laborer*



February 6th 2025, 8:07 AM (MST -07:00)

A handwritten signature in black ink, appearing to be 'H. Ferron'.



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information



409



Paramount/WPW - D Hennig



Tuesday, February 4th 2025, 8:27 AM [MST -07:00]

Unit Information

Date:



February 4, 2025

Select Unit Number:



409

KMs:



6167

Hours:



355

Repairs Required

Description of Repairs Required (attach photos):



Regen issue continues we have hooked up batteries started regen regen kicked out and it is now out of limp mode still has check engine light Adam from velocity called back at 9:25 am and said codes went inactive and appears to be good to go

Serial/Part # if applicable:



No Response

Urgency of Repairs:

Select priority level of repairs:



Critical - Immediate attention needed

Location of repairs being completed:

Pick the location where the repairs were completed:



Other [ie. Dealership/Town]

Requested By:



Original

Howard Ferron, *Laborer*



February 4th 2025, 8:27 AM (MST -07:00)

Revised on February 4th 2025, 9:26 AM (MST -07:00)

Current View

Howard Ferron, *Laborer*



February 4th 2025, 9:26 AM (MST -07:00)



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEM1

Maintenance Request Form

Information

 409

 Paramount/WPW - D Hennig

 Tuesday, February 4th 2025, 8:27 AM [MST -07:00]

Unit Information

Date:  February 4, 2025

Select Unit Number:  409

KMs:  6167

Hours:  355

Repairs Required

Description of Repairs Required [attach photos]:

 Regen issue continues we have hooked up batteries started regen regen kicked out and it is now out of limp mode still has check engine light

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

 Critical - Immediate attention needed

Location of repairs being completed:

Pick the location where the repairs were completed:

 Other [ie. Dealership/Town]

Requested By:

Worker Requesting Repairs:

 Howard Ferron

Howard Ferron, *Laborer*



February 4th 2025, 8:27 AM (MST -07:00)

A handwritten signature in black ink, appearing to be 'H. Ferron'.

Revised on February 4th 2025, 9:26 AM (MST -07:00)

Howard Ferron, *Laborer*



February 4th 2025, 9:26 AM (MST -07:00)

A handwritten signature in black ink, appearing to be 'H. Ferron'.



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Stan

Maintenance Request Form

Information

409

Paramount/WPW - D Hennig

Tuesday, February 4th 2025, 7:49 AM [MST -07:00]

Unit Information

Date: February 3, 2025

Select Unit Number: 409

KMs: # 6167

Hours: # 354

Repairs Required

Description of Repairs Required [attach photos]:

Truck won't finish regen called velocity was told to let regen for another 1/2 hour
Dale called office was told truck has taken 6 hours in past to regen left truck running came back 8 hours later still was regening
Dale called Roger was told to disconnect power through switch try still wouldn't finish regen I called Stan at velocity he said there is over 20 codes
will need to be looked at by dealer. Dale called Roger at velocity and we decided to disconnect batteries and leave over night

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Critical - Immediate attention needed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Other [ie. Dealership/Town]

Requested By:

worker requesting repairs:



Howard Ferron

Signatures

Howard Ferron, *Laborer*



February 4th 2025, 7:49 AM (MST -07:00)

1/1
Handwritten signature



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information

 409

 Paramount/WPW - D Hennig

 Monday, February 3rd 2025, 6:19 PM [MST -07:00]

Unit Information

Date:  February 3, 2025

Select Unit Number:  409

KMs:  6000

Hours:  500

Repairs Required

Description of Repairs Required [attach photos]:

 Truck needed to do a regen we forced a burn it regened for 8 hrs tripped a bunch of codes we talked to Roger at Western Star we are unhooking battery's for the night then going to try reset the computer do a burn in morning if that dosnt work we are supposed to call him back

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ High Priority - Required within 1-2 days

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

Requested By:



Signatures

Dale Hennig, *Supervisor*



February 3rd 2025, 6:19 PM [MST -07:00]



54.9898609, -118.8904197



SEMI (WATER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information

 409

 Paramount/WPW - D Hennig

 Thursday, January 23rd 2025, 1:44 PM (MST -07:00)

Unit Information

Date:  January 23, 2025

Select Unit Number:  409

KMs:  5962

Hours:  240

Repairs Required

Description of Repairs Required:

 Check engine light out
Had phoned velocity trucks in Lloydminster and they said to keep driving it and the check engine light would go out and it did. This request is just to inform you your light is out now. truck is running fine.

Requested By:

Worker Requesting Repairs:  Howard Ferron

Signatures

Howard Ferron, *Laborer*

 January 23rd 2025, 1:44 PM (MST -07:00)



Greg Spicer, Driller



January 23rd 2025, 4:58 PM (MST -07:00)



54.8059245, -119.058173



SEMI (WATER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information

 409

 Carbonex - Dale Hennig

 Wednesday, January 15th 2025, 4:42 PM [MST -07:00]

Unit Information

Date:  January 15, 2025

Unit Number: # 409

KMs: # 5527

Hours: # 185

Repairs Required

Description of Repairs Required:

 Check Engine light is on , truck appears to have no issues

* RON CALLED ROGER @ VELOCITY

* DAN CONTACTED DALE H ON SITE (SERVICE MANAGER)

Requested By:

Worker Requesting Repairs:  Howard Ferron

Signatures

Howard Ferron, Laborer

 January 15th 2025, 4:42 PM [MST -07:00]





Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request Form

Information



409



Carbonex - Dale Hennig



Wednesday, January 15th 2025, 7:49 AM [MST -07:00]

Unit Information

Date:



January 14, 2025

Unit Number:



409

KMs:



5495

Hours:



181

Repairs Required

Description of Repairs Required:



Def purge pump continues to run when truck is shut off. Fired truck back up did parked regen , pump seems to be shutting off now. Will monitor and advise if problem reoccurs. Western star in loydmister was called for advise by shop Forman when problem occurred..No check engine lights are present.

Requested By:

Worker Requesting Repairs:



Howard Ferron

Signatures

Howard Ferron, *Laborer*



January 15th 2025, 7:49 AM [MST -07:00]

Dale Hennig, *Supervisor*



January 15th 2025, 7:53 AM [MST -07:00]



SEMI (WATER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

409

Paramount 2510-002

Tuesday, January 6th 2026, 8:31 AM [MST -07:00]

Unit Information

Date: January 6, 2026

Select Unit Number: 409

KMs: # 17826

Hours: # 621

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.


☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

Gasket seal gone in water pump

P.U @ SWIFT OILFIELD
JAN 7/26

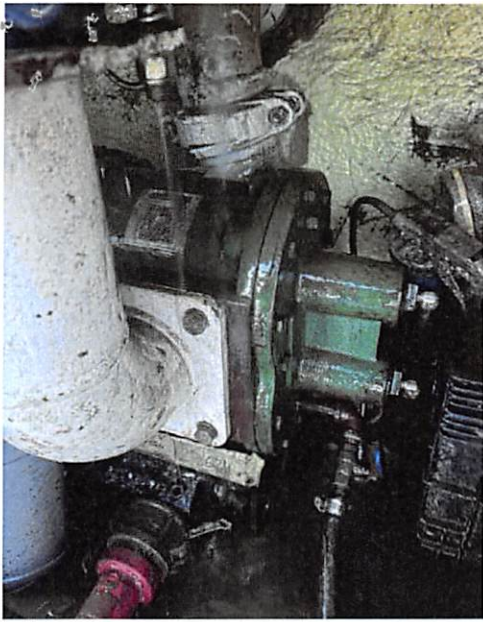

Serial/Part # if applicable:

No Response

Urgency of Repairs:

Select priority level of repairs:

☒ High Priority - Required within 1-2 days

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

Requested By:

Worker Requesting Repairs:

 Ryan Anderson

Signatures

Ryan Anderson, *Supervisor*

 January 6th 2026, 8:31 AM [MST -07:00]

 52.3203336, -114.8115455





PARTS ORDER CONFIRMATION

Page: 1 (1)

Finning (Canada), a division of Finning International Inc.
YELLOWHEAD CROSSING II, BUILDING 4
11554 - 186th STREET NW
EDMONTON, AB T5S 0J1
(888) 346-6464

Date 30/12/25

Order Total \$1,213.00

Payment Terms NET 30 DAYS

Manual Due Date

Currency CANADIAN DOLLAR

Customer Tax Exemption No.

Sales Person FINNING CANADA

CUSTOMER NUMBER CA-0020205

BROTHERS H D D INC
2002 23 AVENUE
WAINRIGHT AB T9W 0B8

Order Date 30/12/25

Customer Reference No. 14693

Customer Contact RON 306 537-2440

Order Number 0048224714 / EN1

Finning Quotation Number

Requested Delivery Date 30/12/25

Delivery Specifications

Delivery Method HOLD TILL COMPLETE

Delivery Terms Free Carrier (Transport ID)-COL



Ship To

BROTHERS H D D INC
2002-23 AVE
WAINRIGHT, AB T9W 0B8
WAINWRIGHT AB T9W 0B8
SHIT OUT ON HWY 9

Make

Unit No

Model

Year

Serial Number

Legal Land Description (LLD)

Line No.	Sub Line	Qty	Item No.	Description	Shipping/ Pickup WHS	U/M	Sales Price	Amount	RET1
1		1	4616304	TANK AS-HEAD	EDMONTON RDC MAIN WHS YELLOWHEAD	PC	1,097.58	1,097.58	R
2		1	3916399	CAP AS-RADIA	EDMONTON RDC MAIN WHS YELLOWHEAD	PC	51.29	51.29	R
Approx. branch arrival date: Contact dealer to confirm date.									
3		1	4J5573	SEAL	EDMONTON RDC MAIN WHS YELLOWHEAD	PC	6.37	6.37	R

Approx. branch arrival date: Contact dealer to confirm date.

Sub-Total 1,155.24

GST 57.76

Order Total \$1,213.00

GST/HST Registration Number: 101801561 RT0001

1.Returnable Indicator: R for Returnable, N for Non-returnable, X for Non-cancellable PO/ Non-Returnable.

This Parts Order Confirmation is subject to and incorporates by reference the Finning Parts Terms and Conditions, which can be found at www.finning.com/PartsTerms

Any Services provided by Finning are subject to Finning's Service Warranty & On-Time Completion Guarantee which can be found at www.finning.com/ServiceWarranty

Parts returns are governed by the Finning Customer Return Policy which can be found at www.finning.com/ReturnPolicy

Finning's liability, even if caused by its own negligence, and the remedies available to the Customer are limited by these Terms and Conditions.

These items are controlled by the U.S. government and authorized for export only to the country of ultimate destination for use by the ultimate consignee or end-user(s) herein identified. They may not be resold, transferred, or otherwise disposed of, to any other country or to any person other than the authorized ultimate consignee or end-user(s), either in their original form or after being incorporated into other items, without first obtaining approval from the U.S. government or as otherwise authorized by U.S. law and regulations.

The Terms and Conditions of this Parts Order Confirmation, including all documents incorporated by reference, is the entire agreement. No other documentation or other terms and conditions provided by the Customer prior to or subsequent to the finalization of this Order by the Customer shall be of any force or effect.



MAINTENANCE WORK ORDER

No 3233

UNIT #: 409

ENGINE HOURS: 164.24

MILEAGE: 3657 km

WORK LOCATION:

WORK REQUESTED:

REPAIRS REQUIRED: NO Radio

ORDER DATE: Dec/3/24

COMPLETED DATE: Dec/3/24

JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

TECH COMMENTS:

LABOUR DESCRIPTION: installed radio 1.5 HOURS

fixed exhaust

LABOUR TOTAL

PARTS & MATERIALS

radio

P.O. # QUANTITY PRICE AMOUNT

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: ron

WORK COMPLETED BY: chase

UNIT RETURNED TO SERVICE: yes

OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: