



H02-110
SEP

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEMI (WATER)

Maintenance Request / Report Form

Information

408

Grand Prairie - Shop

Sunday, June 7th 2026, 8:30 AM (MDT -06:00)

Unit Information

Date:  June 7, 2026

Select Unit Number:  408

KMs:  25245

Hours:  2908

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  Completed wheels on limited CVIP
- Replace both steering axel hub caps/gaskits/oil
- Tighten one coolant fitting
- Cut off tank to frame insulator that was sticking out
- Full grease/brake set
- Full service on engine
- All fuel filters (3) oil,air,cabin air(2)
- Wash engine bay
- Get oil sampel
- Truck is booked in to get windshield replaced

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ completed

Location of repairs being completed:

Pick the location where the repairs were completed:



Grande Prairie Shop



FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:



Dewitt (David) Steinbrenner

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval tab and select either from the Given Names below: Ron Jerome, Jason Brown, Jon Archibald.

Signatures

Dewitt (David) Steinbrenner, *Mechanic/Driller*



June 7th 2026, 8:30 AM (MDT -06:00)

D. S.



SEMI (WATER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

408

Grand Prairie - Shop

Thursday, March 26th 2026, 2:46 PM (MDT -06:00)

Unit Information

Date: March 26, 2026

Select Unit Number: 408

KMs: # 21893

Hours: # 2752

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

☒ Cheak all work lights everyone is functioning correctly
Inspect coolant line around belly valve secure and not leaking

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Grande Prairie Shop

FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:



Dewitt (David) Steinbrenner

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Signatures

Dewitt (David) Steinbrenner, *Mechanic/Driller*



March 26th 2026, 2:46 PM (MDT -06:00)



55.3095532, -118.797426

A handwritten signature in black ink, likely belonging to Dewitt (David) Steinbrenner, written over a grid background.



SEMI (WATER TRUCK)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 408

 Grand Prairie - Shop

 Wednesday, January 7th 2026, 8:15 PM [MST -07:00]

Unit Information

Date:  January 7, 2026

Select Unit Number:  408

KMs:  18712

Hours:  2454

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  -replaced cracked coolant hose
- replaced rad cap
- changed oil in right steer hub

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:



Grande Prairie Shop

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



January 7th 2026, 8:15 PM (MST -07:00)



55.2274432, -118.8746965

Ron Jerome

From: Dan Fontaine
Sent: December 22, 2025 12:38 PM
To: Ron Jerome
Subject: Immediate attention RO 21349 UNIT VP0890

Hi Ron could you please give Westernstar a call concerning our truck that went in last week. Or let me know what you would like to address while it is in their shop.

Have a great day.

Dan

From: Brittiney Blair <bblair@wsnorth.com>
Sent: Monday, December 22, 2025 12:25 PM
To: Dan Fontaine <dfontaine@brothershdd.ca>
Cc: GP Service <GPSservice@wsnorth.com>; uptimegrp <uptimegrp@wsnorth.com>
Subject: RO 21349 UNIT VP0890

Good afternoon,
We finished up with the check engine light, its all repaired and covered thru warranty,
During the complimentary inspection we had noticed a few important items that require attention.

ITEMS THAT REQUIRE ATTENTION**

- COOLANT LEAK AT TOP OF RADIATOR CAP
 - COOLANT LEAK AT THE RETURN MANIFOLD
 - #1 LEFT HAND SIDE HUB CAP GLASS WEeping
 - #1 RIGHT HAND SIDE HUB OIL MILKY
 - RIGHT HAND SIDE STALK HEAT SHEILD HAS LOOSE BOLTS
 - TPMS WARNING LIGHT ON
 - OIL PAN INSERT FOR HEATER ELEMENT IS LEAKING (POSSIBLE WARRENTY)
- WITH OIL CHANGE
- Handwritten notes in blue ink:*
CAP IN TRUCK
HOSE
LEAK

Please let us know if you would like us to take care of this while the unit is here.
If you do not want us to do anything else the unit is ready for pick up.

Thank you



Brittiney Blair | Service Writer

Western Star & Freightliner Trucks of Grande Prairie

7802-110 Street, Grande Prairie, Alberta T8W 1M3

E: bblair@wsnorth.com | **E:** gpSERVICE@wsnorth.com

Phone: 780-513-2236 **Ext** 3110 | **fax:** 780-513-2846

toll free: 1-866-388-7827





NORTH

408

**WESTERN STAR & FREIGHTLINER TRUCKS
of GRANDE PRAIRIE**

Address: 7802 - 110 Street | Grande Prairie, AB T8W 1M3
Phone: 780-513-2236 | Toll Free: 1-866-388-7827 | Fax: 780-513-2846

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

***** Customer Review *****

Date / Time: 1/7/2026 4:48:35PM
Repair Order: 21349
Customer:
Branch: GRP
Invoice Total: \$670.67

Cash

Page 1 of 3

Bill To: BROTHERS HDD INC
2002-23 AVE
WAINWRIGHT, AB T9W0B8

Ship To: BROTHERS HDD INC
2002-23 AVE
WAINWRIGHT, AB T9W0B8

ENGINE OIL & FILTER CHANGED

Customer P/O

Created By

Completion Date

BBlair

Unit Number: VP0890

Model Year: 2025

Make/Model: WST 49X

Type: TRUCK

VIN: 5KKPBWD13SPVP0890

Meter: 18686 Kilometers

In-Service Date: 09/20/2024

ECM Reading: 2450

Task: 1 600023 CHECK ENGINE LIGHT DIAGNOSE Department: SERVICE

600008

Complaint: DIAGNOSE ** CHECK ENGINE LIGHT

Cause: EGR SENSOR

Correction: BROUGHT TRUCK INSIDE. HOOKED UP LAPTOP. FOUND UNIT HAS RECENT CODE FOR EGR FLOW TARGET ERROR HIGH FLOW 2659/0. NO PRIMARY FAULTS PRESENT. UNIT IS DD 16 WITH GATS 2. CHECKED MCM SOFTWARE. FOUND ABOVE REQUIRED LEVEL. DPF ZONE 0 ALREADY. DELTA P SENSOR VOLTAGE 0.69V ENGINE OFF. BAROMETRIC AND INTAKE MANIFOLD PRESSURES READING CORRECT AND IN RANGE. INTAKE MANIFOLD AND CAC OUTLET TEMPERATURE WITHIN RANGE OF EACH OTHER. REMOVED DELTA P SENSOR AND VERIFIED PORTS CLEAR. REMOVED EGR HOT PIPE. USED SCOPE INTO EGR COOLER. NO RESTRICTIONS FOUND IN HOT PIPE OR COOLER. CONFIRMED EGR VALVE WORKING CORRECTLY. T/S STATES TO REPLACE DELTA P SENSOR. ORDERED. REMOVED AND REPLACED DELTA P SENSOR. TAGGED OLD PART FOR WARRANTY. PERFORMED REPAIR VERIFICATION. CLEARED INACTIVE FAULTS.

REPAIR COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Ext Price
	SS SVC	SHOP SUPPLIES	Misc	1.00	36.62	36.62
	DDE A4701530428	EGR SENSOR	Part	EA	217.71	217.71

Task 1 Subtotals: Parts: \$0.00

Labor: \$0.00

Task 1 Totals: \$0.00

Task: 2 47-100028.01 COMPLIMENTARY INSPECTION Department: SERVICE

Complaint: PERFORM COMPLIMENTARY INSPECTION

Cause: CUSTOMER SATISFACTION

Correction: THE FOLLOWING ITEMS HAVE BEEN NOTED THAT REQUIRE ATTENTION OR MONITORING:
CHECKED OVER UNIT. RECORDED FINDINGS.

ITEMS THAT REQUIRE ATTENTION

- COOLANT LEAK AT TOP OF RADIATOR CAP
- COOLANT LEAK AT THE RETURN MANIFOLD
- #1 LEFT HAND SIDE HUB CAP GLASS WEEPING
- #1 RIGHT HAND SIDE HUB OIL MILKY
- RIGHT HAND SIDE STALK HEAT SHIELD HAS LOOSE BOLTS
- TPMS WARNING LIGHT ON
- OIL PAN INSERT FOR HEATER ELEMENT IS LEAKING (POSSIBLE WARRANTY)

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Ext Price
	CR INSPECT	CREDIT QUALITY INSPECTION	Misc	(1.00)	89.49	(89.49)

Labor Quote: 89.49

Task 2 Subtotals: Parts: \$0.00



**WESTERN STAR & FREIGHTLINER TRUCKS
of GRANDE PRAIRIE**

Address: 7802 - 110 Street | Grande Prairie, AB T8W 1M3
Phone: 780-513-2236 | Toll Free: 1-866-388-7827 | Fax: 780-513-2846

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: 892297052

***** Customer Review *****

Date / Time: 1/7/2026 4:48:35PM
Repair Order: 21349
Customer:
Branch: GRP
Invoice Total: \$670.67

Cash

Page 2 of 3

Bill To: BROTHERS HDD INC
2002-23 AVE
WAINWRIGHT, AB T9W0B8

Ship To: BROTHERS HDD INC
2002-23 AVE
WAINWRIGHT, AB T9W0B8

<u>Customer P/O</u>	<u>Created By</u>	<u>Completion Date</u>
	BBlair	

Labor:	\$89.49
Miscellaneous:	(\$89.49)
Task 2 Totals:	\$0.00

Task: 3 42-000001.01 COOLING SYSTEM DIAGNOSE Department: SERVICE

Complaint: DIAGNOSE: COOLANT LEAK AT THE RETURN MANIFOLD

EGR TO SURGE TANK VENT HOSE CRACKED

Cause: EGR TO SURGE TANK VENT HOSE CRACKED

Correction: BRING UNIT INSIDE. PRESSURE TEST COOLANT SYSTEM. INSPECT SYSTEM DURING TEST. FOUND FITTING ON DEF COOLANT MANIFOLD LEAKING AT THREADS INTO MANIFOLD. ALSO FOUND RETURN LINE FROM EGR COOLER TO RESERVOIR CRACKED OVER THE ENTIRE LENGTH OF THE HOSE. CUSTOMER IS GOING TO INSTALL HIMSELF CHECKED FOR WARRANTY ON FITTINGS AND EGR VENT TUBE AND IT IS NOT COVERED. CUSTOMER WILL DO REPAIRS.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Ext Price
	SS SVC	SHOP SUPPLIES	Misc	1.00	17.51	17.51
	05-34263-000	"HOSE-EGR VENT,DD16,K90/K105,SB"	Part	EA	1.00	30.03
	CAL;GARY					
	23-12691-003	CLAMP 3/8 HOS	Part	EA	2.00	4.00
	05-32313-000	CAP-SURGE TANK,FILL	Part	EA	1.00	15.28

Task 3 Subtotals:	Parts:	\$49.31
	Labor:	\$218.90
	Miscellaneous:	\$17.51
Task 3 Totals:		\$285.72

Task: 4 40-000002.01 ENGINE DIAGNOSE Department: SERVICE

600008

Complaint: DIAGNOSE: OIL PAN INSERT FOR HEATER ELEMENT IS LEAKING

Cause: OIL PAN

Correction: BROUGHT UNIT IN DRAINED ENGINE OIL DISCONNECTED OIL PAN HEATER, LET OIL FINISH DRAINING REMOVED OIL PAN.TRANSFERRED DRAIN PLUG AND PAN HEATER. SCRAPED ALL OLD SILICONE OFF OF BOTTOM OF BLOCK. AND SCUFFED SURFACE WITH SCOTCH BRIGHT. SILICONE REAR STRUCTURE AND FRONT COVER POINTS ON BLOCK. PUT NEW PAN UP AND TIGHTENED ALL BOLTS. TORQUED IN SEQUENCE AND TO SPEC. RE CONNECTED DIPSTICK TUBE AND OIL PAN HEATER. REPAIR COMPLETE

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Ext Price
	SS SVC	SHOP SUPPLIES	Misc	1.00	125.77	125.77
	DDE A4730103413	OIL SUMP	Part	EA	1.00	1,071.38

Task 4 Subtotals:	Parts:	\$0.00
	Labor:	\$0.00
Task 4 Totals:		\$0.00

Task: 5 90-100008.01 GRP LUBE SPECIAL (ABOVE 20 LITRES OF OIL) Department: SERVICE

Complaint: PERFORM LUBE SPECIAL: CHANGE OIL TO 0-W40 AS WELL CHANGE OIL FILTER

Cause: CUSTOMER REQUEST-MAINTENANCE



WESTERN STAR & FREIGHTLINER TRUCKS of GRANDE PRAIRIE

Address: 7802 - 110 Street | Grande Prairie, AB T8W 1M3
Phone: 780-513-2236 | Toll Free: 1-866-388-7827 | Fax: 780-513-2846

Visit us online at www.wsnorth.com

Remit To: 24210 - 114 Avenue | Acheson, AB T7X 6B9

GST: B92297052

*** Customer Review ***

Date / Time: 1/7/2026 4:48:35PM
Repair Order: 21349
Customer:
Branch: GRP
Invoice Total: \$670.67

Cash
Page 3 of 3

Bill To: BROTHERS HDD INC
2002-23 AVE
WAINWRIGHT, AB T9W0B8

Ship To: BROTHERS HDD INC
2002-23 AVE
WAINWRIGHT, AB T9W0B8

Customer P/O		Created By		Completion Date		
		BBlair				
Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Ext Price
	LUBESPGREA	LUBE SPECIAL GREASE	Misc	1.00	10.00	10.00
	SLL 550045137	OIL, Rotella T4 10W30 CK4 DRUM 208L	Part	L 40.00		
	OIL-BULK	BULK OIL	EHC			
	DDE A4711800209	TS OIL FILTER	Part	EA 1.00		
	OVER8	OVER 8"	EHC			
Parts Quote: 340.00						
Task 5 Subtotals:				Parts:	\$340.00	
				EHC:	\$3.00	
				Labor:	\$0.00	
				Miscellaneous:	\$10.00	
				Task 5 Totals:	\$353.00	

GST/HST Number: 892297052RT0001

Payment Method

Cash

Totals

Total Parts:	\$389.31
Total Core Chg:	\$0.00
Total Core Ret:	\$0.00
Total EHC:	\$3.00
Total Labor:	\$308.39
Total Miscellaneous:	(\$61.98)
Invoice Subtotal:	\$638.72
Total Tax:	\$31.95
Invoiced Total:	\$670.67

HAVING AUTHORIZED REPAIRS TO MY (OUR) MOTOR VEHICLE, AND/OR AUTHORIZED PART(S) PURCHASES, I (WE) HERBY ACKNOWLEDGE MY (OUR) INDEBTEDNESS TO: WESTERN STAR TRUCKS (NORTH) LTD.

IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OF THE ACCOUNT FOR SAID WORK.

DATE: _____ X _____ ERRORS AND OMISSIONS EXCEPTED

***** EMAIL IN NOW AVAILABLE * NO RETURNS ON ELECTRICAL * CORES MUST BE RETURNED IN 90 DAYS FOR CREDIT *****

***** EACH REPAIR TASK HAS BEEN INSPECTED FOR QUALITY AND FUNCTION VERIFIED - IF YOU ARE NOT COMPLETELY SATISFIED, PLEASE CONTACT DEPARTMENT MANAGER *****



SEMI (WATER TRUCK)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

408



Canadian Plains DL 2507-002



Monday, August 25th 2025, 9:14 AM (MDT -06:00)

Unit Information

Date:



August 25, 2025

Select Unit Number:



408

KMs:



12166

Hours:



1893

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.



Maintenance Request - Request shop assistance in facilitating repairs.


Repairs Required

Description of Repairs Required (attach photos):



Missing hydraulic tank oil cap

SASICATOON

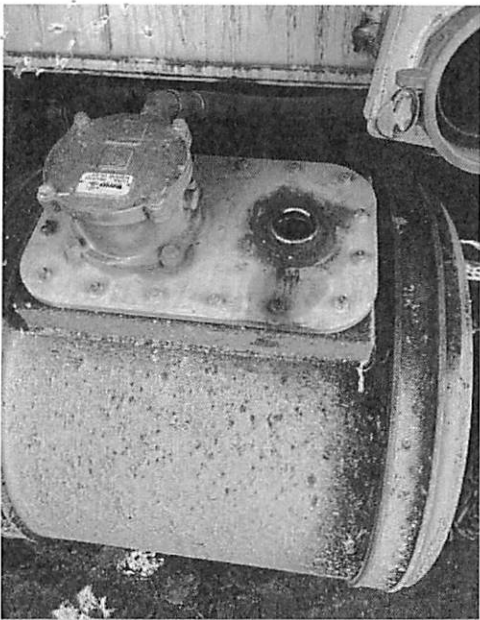

Need cap will put on in field

Serial/Part # if applicable:

No Response

Urgency of Repairs:

Select priority level of repairs:

☒ High Priority - Required within 1-2 days

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

Requested By:

Worker Requesting Repairs:


Howard Ferron

Signatures

Howard Ferron, *Laborer*

 August 25th 2025, 9:14 AM [MDT -06:00]



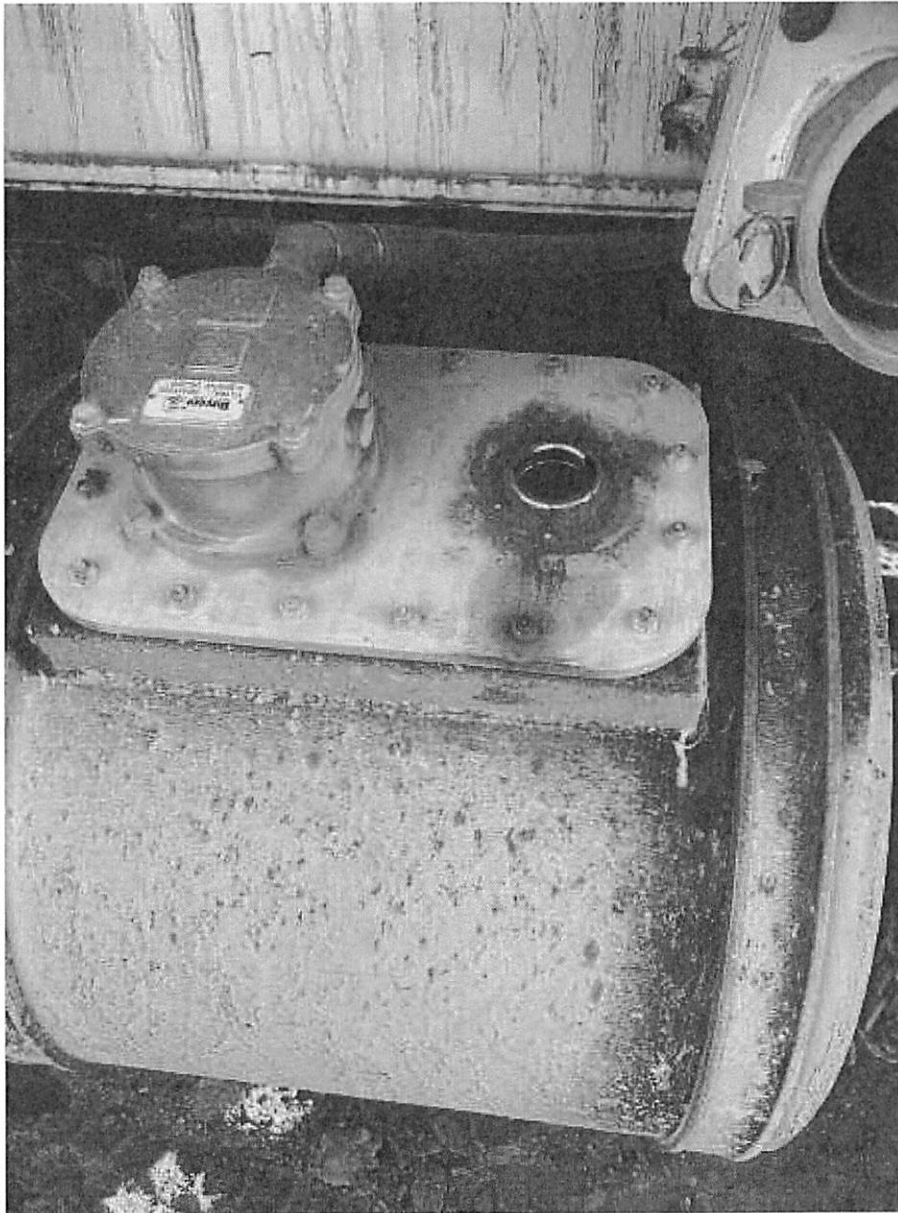



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

 408

 Canadian Plains DL 2507-002

 Saturday, August 23rd 2025, 7:09 AM (MDT -06:00)

Unit Information

Date:  August 23, 2025

Select Unit Number:  408

KMs:  12074

Hours:  1885

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

 Warning drivetrain function impaired not allowing truck to start , after cycling trucks range selector and power night switch it eventually started

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Can be looked at when it goes into Warren industries in Saskatoon next week

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Other (ie. Dealership/Town)

SASKATOON

Requested by:

Worker Requesting Repairs:



Howard Ferron

Signatures

Howard Ferron, *Laborer*



August 23rd 2025, 7:09 AM [MDT -06:00]

A handwritten signature in black ink, appearing to read 'H. Ferron'.



SEMI
WATER TRUCK

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information

408

Canadian Plains DL 2507-002

Thursday, August 21st 2025, 1:03 PM [MDT -06:00]

Unit Information

Date: August 21, 2025

Select Unit Number: 408

KMs: # 12036

Hours: # 1877

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

Check engine light Truck shut down
Had solid yellow illuminated check engine light also illuminated

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Standard Priority - Required within 3-5 days

SASKATOON

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Other (ie. Dealership/Town)

Requested by:

Worker Requesting Repairs:



Howard Ferron

Signatures

Howard Ferron, *Laborer*



August 21st 2025, 1:03 PM (MDT -06:00)

A handwritten signature in black ink, appearing to be 'H. Ferron', written over a light blue horizontal line.

Daimler Truck North America LLC

SEMI (WATER TRUCK)

Daimler Truck North America LLC
P.O. Box 4090
Portland, OR 97208-4090
800.547.0712 Phone

May 2025

SF718

408/409

Subject: Transmission Oil Cooler Line Clearance

Daimler Truck North America LLC (DTNA), on behalf of its Freightliner Trucks Division, and wholly owned subsidiary, Western Star Truck Sales, Inc., is initiating Field Service Campaign SF718 to modify specific 2025-2026 Western Star 47X, 47X RHD, 48X RHD, 49X, 49X RHD vehicles, manufactured March 18, 2024, through April 9, 2025.

The transmission cooler lines may come in contact with nearby surfaces.

Daimler Truck North America authorized service facility will inspect the cooler line for damage and modify the recirculation baffle to ensure proper clearance.

Please contact an authorized DTNA dealer to arrange to have the campaign performed and to ensure that parts are available. The campaign will take approximately one hour and will be performed **free of charge**. To locate an authorized dealer, go to <https://northamerica.daimlertruck.com/brands/support>. At the bottom of the page click on the appropriate brand (shown as an icon), and at the top of each brand's page is an option to 'Find a Dealer'.

This Field Service Campaign will **terminate on May 31, 2026**. Please make sure the campaign is completed prior to this date. Work completed after this date will be done at the customer's expense.

As stated in the terms of your express limited warranty, Daimler Truck North America LLC will not pay for any damage caused by failure to properly maintain your vehicle. Daimler Truck North America LLC considers the work necessary under this campaign to be proper maintenance and, therefore, will not pay for any damage to your vehicle caused by your failure to have the repairs that are the subject of this campaign performed in a reasonable time.

If you have any questions, contact the Warranty Campaigns Department at (800) 547-0712, from 7 a.m. to 4 p.m. Pacific Time, Monday through Friday, e-mail address: dtna-war-campaigns@daimlertruck.com, or contact the Customer Assistance Center at (800) 385-4357.

WARRANTY CAMPAIGNS DEPARTMENT

Enclosure

MONDAY JUNE 30 12025

408 - RECALL | PTO

409 - RECALL | DRIVER HEADLAMP



FTCI - Lloydminster
A Division of Velocity Vehicle Group
6203 - 56TH STREET
LLOYDMINSTER, AB T9V 3T7
(780) 875 - 6211

UNIT# 408

BILL TO
BROTHERS HDD INC. - 102508
2002-23 AVE
WAINWRIGHT AB T9W0B8
P: (780) 214-7711 F:

DELIVER TO
BROTHERS HDD INC. - 102508
2002-23 AVE
WAINWRIGHT AB T9W0B8
P: (780) 214-7711 F:

Please Remit Payment to:
First Truck Centre, INC
(DBA Velocity Truck Centres)
C/O VX5339
PO Box 7727
Vancouver, BC V6B 4E2

Emailed

GST #:
119401776 RT001

SERVICE INVOICE: RA803061804:01

Date Arrived: 06/03/2025
Date Invoiced: 06/04/2025
SalesType: SR
PO No: WTY LK
Terms: 30
Advisor: CHERYL Z.
Email: czimmerman@vvgtruck.ca
Salesman: CHERYL Z.
Reviewer: MAURA PHILLIPS

VIN: 5KKPBWD13SPVP0890 Fleet Unit #: 409
Year/Make/Model: 2025 WESTERN STAR 49X
Engine Model / Serial#: DD16 / 473910S1163926
Engine Hours: 1,480
Trans Model / Serial#: RTLO18918B / P1679395
Front Axle Model / Serial#: MFS20133 / MON05701612
Rear FWD Axle Model / Serial#: T46M /
Rear Rear Axle Model / Serial#: T46M /

Mileage: 9939
Body ID#:
License#:
Axle Ratio: 4.1
Tag#: SHOP
Selling Dealer: VVG
Date In Svc:

JOB #1 02 SWF Express Assessment

COMPLAINT EXPRESS ASSESSMENT ** CHECK ENGINE LIGHT
CAUSE done
CORRECTION THE VEHICLE'S CHECK ENGINE LIGHT WAS DIAGNOSED DUE TO TWO FAULT CODES RELATED TO THE EGR SYSTEM. THE PRIMARY FAILED COMPONENT IDENTIFIED WAS THE EGR PRESSURE SENSOR, WHICH WAS REGISTERING INCORRECTLY. THE RECOMMENDED CORRECTION WAS TO REPLACE THE SENSOR - PFP: DDE A4701530428 - PARTS DISPOSITION: SCRAP - REPAIR PROCEDURE INVOLVED A SERIES OF DIAGNOSTIC STEPS TO VERIFY THE ISSUE AND ENSURE PROPER FUNCTIONING OF THE EGR SYSTEM.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	803D/DDE A4701530428	SENSOR, EGR DELTA PRESSURE		
1	HAZMAT	HAZMAT - DISPOSAL		

JOB #2 05-INSP SR Courtesy Inspection

COMPLAINT COURTESY INSPECTION ** 306-537-2440 RON
CAUSE ASAP
CORRECTION DONE
NO CONCERNS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE

Parts: Labor: Other: Sublet:

INVOICE

I, the undersigned owner, or duly authorized representative, authorize the repair and service work as detailed on this repair order. Permission is also granted to your employees to operate the vehicle herein described on the streets, highways, or elsewhere for the purpose of testing and/or inspection. It is understood that Velocity Truck Centre does not assume any responsibility whatsoever to vehicles or contents while in their possession.

****Disclaimer of Warranty****

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and Velocity Truck Centre neither assumes nor authorizes any other person to assume any liability in connection with the sale of the said products. Velocity Truck Centre shall not be liable for special, indirect or consequential damages, e.g.: down time, loss of revenue, loss of vehicle, towing charges, driver's expenses, loss of perishable cargo, etc. Failed parts return requests must be made when the unit is checked in. Please be aware that any aftermarket modifications to OEM components are customer responsibility. Velocity Truck Centre assumes no responsibility for damage to any aftermarket component as a result of our diagnostics or repairs. Workmanship is warranted for 90 Days from date of invoice. If a possible warrantable situation arises at a location other than Velocity Truck Centre then Velocity Truck Centre must be contacted to be involved in the repair decision.

I/we hereby acknowledge this invoice and an express garageman's lien thereon to secure full amount of indebtedness.

I/We agree to pay interest at the rate of 1 1/2% per month (18% per annum), if the balance due is not paid within the credit terms of Velocity Truck Centre.

I/We also agree to pay storage fees of fifty dollars (\$50.00) per day, both before and after judgment plus all costs incurred in the collection of the balance owing, legal fees and disbursements on a solicitor client basis.



Tell Us How We Did

As an Elite Support dealer, we inspect every job for quality of workmanship. A Quality Inspection Report has been completed by a factory trained technician at the end of your repairs on service order RA803061804.

LABOR	\$0.00
PARTS	\$0.00
OTHER	\$0.00
SUBLET	\$0.00
MISCELLANEOUS	\$0.00
SUBTOTAL	0.00
GST	\$0.00
PST	\$0.00
TOTAL	\$0.00

AUTHORIZED BY _____ DATE _____



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEMI (WATER TRUCK)

Maintenance Request / Report Form

Information

 408

 BHDD Shop

 Monday, June 2nd 2025, 10:04 AM [MDT -06:00]

Unit Information

Date:  June 2, 2025

Select Unit Number:  408

KMs: # 9830

Hours: # 1698

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  Cvip, checkover
- installed wheel checks
- cvip measurements
- tightened hydraulic tank fitting
- checked oils
- installed summer exhaust

CHECK ENGINE LAMP
REPAIRED @ VELOCITY

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Standard Priority - Required within 3-5 days

Location of repairs being completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



June 2nd 2025, 10:04 AM (MDT -06:00)



52.8511101, -110.8421938

A handwritten signature in black ink, appearing to be 'L' followed by a stylized flourish.



SEMI (WATER TRUCK)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7771

Maintenance Request / Report Form

Information

408

BHDD Shop

w/o # 000129

Monday, March 3rd 2025, 2:46 PM [MST -07:00]

Unit Information

Date: March 3, 2025

Select Unit Number: 408

KMs: # 7722

Hours: # 1476

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

E-MAILED

Repairs Required

Description of Repairs Required (attach photos):

Did service-
oil change
Fuel Filter
Oil Filter

ENTERED
MAR 04/25

Serial/Part # if applicable: No Response

*WS LLOYD for
ELECTRICAL ISSUE

Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

Requested By:

Worker Requesting Repairs:



Derik Lynch

Signatures

Derik Lynch, *Locator*



March 3rd 2025, 2:46 PM [MST -07:00]



52.8513029, -110.842161

A handwritten signature in black ink, appearing to read 'Derik Lynch', located to the right of the printed name.



SEMI
DALE / DORTCH

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Field Requisition Form for Tools, Parts, & Consumables

Information

☐ Steering tire Chain

409 / 409

☐ Paramount/WPW - D Hennig

☐ Friday, January 31st 2025, 3:41 PM (MST -07:00)

General Information

Date: ☐ January 31, 2025

Location: ☐ Grande Prairie WPW

Job # ☐ 2501

Site Supervisor: ☐ Dale Hennig

Item Details - List all items clearly

Tool/Part/Consumable Description

☐ Steering tire chain for unit 409



SINGLE STEERING CHAIN (PAIR)
TIRE STUDDED

281.64

408 / 409

RICK C GREGG'S

Quantity: Number of Items Needed ☐ 1

Serial/Part Number if applicable: ☐ N/A

Special Instructions (ie. Specific brand, model or usage details)

☐ No Response

Urgency of Request:

Comments or Delivery Instructions:

No Response

Signatures

Worker Submitting the Request

Howard Ferron

Site Supervisor

Dale Hennig

Additional Photos



Signatures

Howard Ferron, Laborer

January 31st 2025, 3:41 PM [MST -07:00]

A handwritten signature in black ink, appearing to read "Howard Ferron".