



SEMI

(WATER TRUCK)

H02-111  
SEP

Brothers HDD Inc  
2002 23 Avenue  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

## Maintenance Request / Report Form

### Information

402

Red Deer - Shop

Wednesday, April 8th 2026, 7:02 PM (MDT -06:00)

### Unit Information

Date: April 7, 2026

Select Unit Number: 402

KMs: # 6

Hours: # 40021

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

### Repairs Required

Description of Repairs Required (attach photos):

≡ Cvip, fuel leak

- took measurements
- replaced fan clutch solenoid
- replaced low beam light
- replaced pto
- changed trans oil
- changed engine oil
- changed fuel filters
- changed air filters
- changed fan belt
- replaced 2 rear tires
- tightened fuel line fitting
- replaced front hub caps
- replaced front mudflap

Serial/Part # if applicable:

— No Response

Urgency of Repairs:

Select priority level or repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Red Deer Shop

☒ FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

Signatures

Luke Jacobsen, *Mechanic*

 April 8th 2026, 7:02 PM (MDT -06:00)

 52.290046, -113.8654555





SEMI (WATER)

Brothers HDD Inc.  
2002 23 Avenue,  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

## Maintenance Request / Report Form

### Information

402

Ledcor Wolf KA 2512-009

Monday, March 16th 2026, 2:46 PM (MDT -06:00)

### Unit Information

Date: March 16, 2026

Select Unit Number: 402

KMs: 185.7

Hours: 268.1

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

### Repairs Required

Description of Repairs Required (attach photos):

Dim headlights replaced and fixed

Serial/Part # if applicable: No Response

### Urgency of Repairs:

Select priority level of repairs:

☒ Completed

### Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

☒ FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

### Requested By:

Worker Requesting Repairs: Jason Robins

Request submitted to:

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

**Signatures**

**Jason Robins**, *Laborer*



March 16th 2026, 2:46 PM (MDT -06:00)

A handwritten signature in black ink, appearing to be 'J-R' or similar initials.



SEMI (WATER)

Brothers HDD Inc  
2002 23 Avenue  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

## Maintenance Request / Report Form

### Information

402

Grand Prairie - Shop

Saturday, January 31st 2026, 7:20 AM [MST -07:00]

### Unit Information

Date:  January 31, 2026

Select Unit Number:  402

KMs:  15263.1

Hours:  13571.3

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

### Repairs Required

Description of Repairs Required (attach photos):

 Fixed belly valves  
Fixed step  
Fixed insulation wrap for belly valves

Serial/Part # if applicable:  No Response

### Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

 Grande Prairie Shop

FULL SERVICE COMPLETED? Check the box if Oil /Filters & inspection are performed.

**Requested By:**

Worker Requesting Repairs:

 Chase Atkinson

**Request submitted to:**

After signing Request Form be sure to: Request Signature or Approval Tab and select either from the Given Names below: Ron Jerome Dan Fontaine Jon Archibald

**Signatures**

Chase Atkinson, *Laborer*

 January 31st 2026, 7:20 AM (MST -07:00)

 55.309254, -118.7967714





WATER TRUCK

Brothers HDD Inc  
2002 23 Avenue  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

## Maintenance Request / Report Form

### Information

 402

 BHDD Shop

 Monday, November 3rd 2025, 4:56 PM (MST -07:00)

### Unit Information

Date:  November 3, 2025

Select Unit Number:  402

KMs:  369

Hours:  17404

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

### Repairs Required

Description of Repairs Required (attach photos):

 Bowie pump chain broken, install winter exhaust

- installed new chain on hydraulic pump to bowie pump, tightened set screws
- installed winter exhaust

Serial/Part # if applicable:  No Response

### Urgency of Repairs:

Select priority level of repairs:

☒ Completed

### Location of repairs being completed:

Pick the location where the repairs were completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



November 3rd 2025, 4:56 PM (MST -07:00)



52.8514393, -110.842078

A handwritten signature in black ink, appearing to be the name 'A' or 'J'.



SEMI- (WATER TRUCK)

Brothers HDD Inc  
2002 23 Avenue  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

## Maintenance Request / Report Form

### Information

402

w/o #000153

FSJ Shop

Thursday, May 22nd 2025, 10:29 AM (MDT -06:00)

ENTERED  
May 23/25

### Unit Information

Date: May 22, 2025

Select Unit Number: 402

KMs: # 2011

Hours: # 16918

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

### Repairs Required

Description of Repairs Required (attach photos):

- Engine oil and filter, coolant filter, fuel filters, engine air filter, grease.
- New windshields x2
- Check diff oils
- Change 4" gasket in pump box
- Fix P/S step.
- Drivers side door window - replace glass track, fix power window guide
- Remove winter exhaust, install summer stacks

Serial/Part # if applicable: Work completed in FSJ Shop

### Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:



Ft St. John Shop



Requested By:

Worker Requesting Repairs:



Kirk Bauming

## Additional Photos

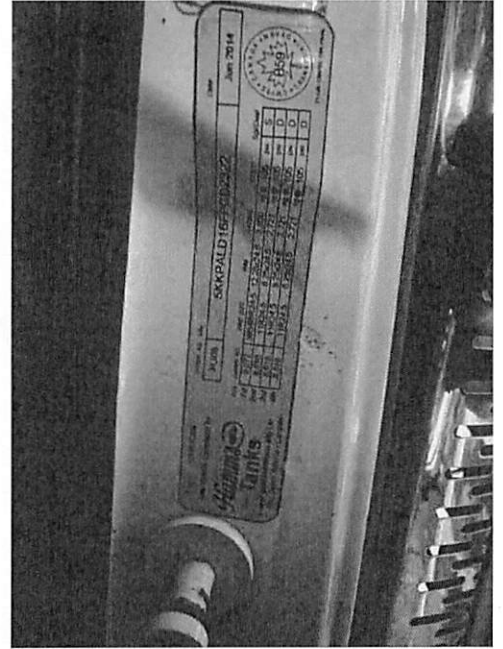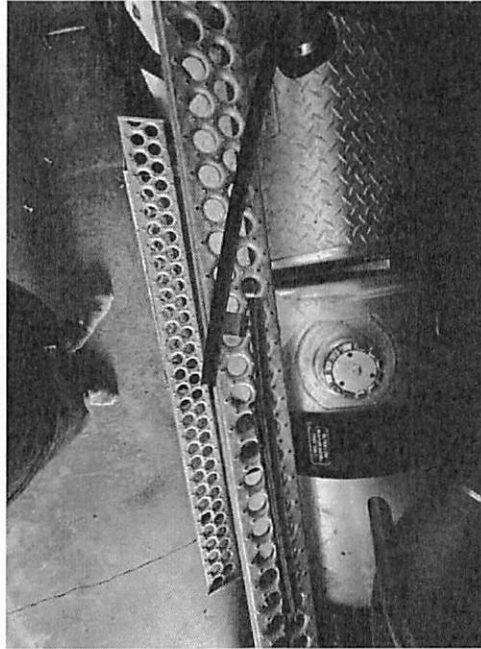

## Signatures

Kirk Bauming, *Construction Coordinator - BC*



May 22nd 2025, 10:29 AM [MDT -06:00]



56.2289443, -120.8335479



## MAINTENANCE WORK ORDER

Nº 3379

ENTERED  
FEB 10 2025

UNIT #: 402

ENGINE HOURS: 16167

MILEAGE: 1458

WORK LOCATION: Wainwright

WORK REQUESTED:

REPAIRS REQUIRED: Service

ORDER DATE: Feb 11 2025

COMPLETED DATE: Feb 11 2025

JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

TECH COMMENTS:

LABOUR DESCRIPTION:

HOURS

Charged engine oil + filter  
checkover

2

LABOUR TOTAL 2

PARTS &amp; MATERIALS

P.O. # QUANTITY PRICE AMOUNT

PARTS &amp; MATERIALS TOTAL

WORK AUTHORIZED BY: Ron

WORK COMPLETED BY: Luke Jacobsen

UNIT RETURNED TO SERVICE: Feb 11 2025

OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS:



Brothers HDD Inc  
2002 23 Avenue  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

SEMI (WATER TRUCK)

## Maintenance Request / Report Form

### Information

402

BHDD Shop

Tuesday, July 22nd 2025, 4:52 PM [MDT -06:00]

### Unit Information

Date: July 18, 2025

Select Unit Number: 402

KMs: # 2025

Hours: # 17058

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

### Repairs Required

Description of Repairs Required (attach photos):

Cvip  
-replaced fan clutch  
-greased  
-replaced brake pot  
-replaced driveshaft u-joints and steady bearing  
-replaced front differential yoke

Serial/Part # if applicable: No Response

### Urgency of Repairs:

Select priority level of repairs:

☒ High Priority - Required within 1-2 days

Location of repairs being completed:

Requested By:

Worker Requesting Repairs:



Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*



July 22nd 2025, 4:52 PM [MDT -06:00]



56.2289968, -120.8345592

A handwritten signature in black ink, likely belonging to Luke Jacobsen, the mechanic.



SEMI (WATER TRUCK)

Brothers HDD Inc  
2002 23 Avenue  
Wainwright, Alberta  
T9W 0B8  
780-214-7711

## Maintenance Request / Report Form

### Information

 402

 A&B RZ 2504-001

 Tuesday, April 15th 2025, 12:34 PM [MDT -06:00]

### Unit Information

Date:  April 15, 2025

Select Unit Number:  402

KMs:  13

Hours:  13

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

### Repairs Required

Description of Repairs Required (attach photos):

-  Km gage doesn't work
- New packing for water pump
- No bright light on one side of truck wrong light was installed
- Door latch for pump box doesn't stay latched
- Both windshields cracked
- Passenger side bottom step missing two bolts.
- Both belly valves leak

Serial/Part # if applicable:  N/A

### Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

 Ft. St. John Shop

Requested By:

Worker Requesting Repairs:



Randy Zaiser

Signatures

Randy Zaiser, *Supervisor*



April 15th 2025, 12:34 PM (MDT -06:00)



53.261944, -110.0244749





## MAINTENANCE WORK ORDER

Nº 2773

UNIT #: 402ENGINE HOURS: /MILEAGE: /WORK LOCATION: F3JWORK REQUESTED: RandyORDER DATE: Nov. 30/24COMPLETED DATE: Dec. 2/24

JOB #: \_\_\_\_\_

W.O. TYPE (Circle): PM CVIP ReactiveREPAIRS REQUIRED: ~~Wash~~ Heat traced and insulated flow lines and belly valves  
Top up coolant

TECH COMMENTS: \_\_\_\_\_

LABOUR DESCRIPTION:

HOURS

KirkRandy/Brandon

LABOUR TOTAL \_\_\_\_\_

PARTS &amp; MATERIALS

|                                                             | P.O. #       | QUANTITY | PRICE | AMOUNT          |
|-------------------------------------------------------------|--------------|----------|-------|-----------------|
| <del>SOFT</del> <u>SOFT</u> silicone hose, barbed fittings, | <u>10844</u> |          |       | <u>\$367.67</u> |
| insulation wrap, black tape, Gorilla tape,                  |              |          |       |                 |
|                                                             |              |          |       |                 |
|                                                             |              |          |       |                 |
|                                                             |              |          |       |                 |
|                                                             |              |          |       |                 |
|                                                             |              |          |       |                 |

PARTS &amp; MATERIALS TOTAL \_\_\_\_\_

WORK AUTHORIZED BY: KirkWORK COMPLETED BY: KirkUNIT RETURNED TO SERVICE: Dec. 2/24OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: \_\_\_\_\_



UNIT #: 4102  
ENGINE HOURS: 14843.3  
MILEAGE: 635.2  
WORK LOCATION: Wainwright  
WORK REQUESTED: \_\_\_\_\_

ORDER DATE: SEP/3/24  
COMPLETED DATE: SEP/3/24  
JOB #: \_\_\_\_\_

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: replace brake pot

TECH COMMENTS: \_\_\_\_\_

| LABOUR DESCRIPTION:      | HOURS    |
|--------------------------|----------|
| <u>replace brake pot</u> | <u>2</u> |
| _____                    | _____    |
| _____                    | _____    |
| _____                    | _____    |
| _____                    | _____    |
| _____                    | _____    |
| _____                    | _____    |
| _____                    | _____    |

LABOUR TOTAL \_\_\_\_\_

| PARTS & MATERIALS | P.O. # | QUANTITY | PRICE | AMOUNT |
|-------------------|--------|----------|-------|--------|
| <u>brake pot</u>  | _____  | <u>1</u> | _____ | _____  |
| _____             | _____  | _____    | _____ | _____  |
| _____             | _____  | _____    | _____ | _____  |
| _____             | _____  | _____    | _____ | _____  |
| _____             | _____  | _____    | _____ | _____  |
| _____             | _____  | _____    | _____ | _____  |
| _____             | _____  | _____    | _____ | _____  |

PARTS & MATERIALS TOTAL \_\_\_\_\_

WORK AUTHORIZED BY: ron WORK COMPLETED BY: chase

UNIT RETURNED TO SERVICE: yes OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS: \_\_\_\_\_



## MAINTENANCE WORK ORDER

Nº 3061

UNIT #: 402  
ENGINE HOURS: 14834 HRS  
MILEAGE: 446.3 KM  
WORK LOCATION: WAINWRIGHT SHOP  
WORK REQUESTED: A/C REPAIR

ORDER DATE: JULY 9/2024  
COMPLETED DATE: JULY 9/2024  
JOB #: \_\_\_\_\_

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: \_\_\_\_\_

TECH COMMENTS: \_\_\_\_\_

LABOUR DESCRIPTION: \_\_\_\_\_ HOURS

- CHECK A/C SYSTEM  
- TIGHTEN ALL A/C HOSE FITTINGS / REPLACE CABIN AIR FILTER  
- FILL SYSTEM WITH R134a FREON  
- INSTALL 2g OIL w/ DIE  
- TEST / RUN SYSTEM

LABOUR TOTAL 3

| PARTS & MATERIALS                  | P.O. #  | QUANTITY | PRICE | AMOUNT  |
|------------------------------------|---------|----------|-------|---------|
| 3.5 <del>kg</del> lbs R134a REFRIG | SHOP    |          |       |         |
| 2 g REFRIG OIL w/ DIE              | SHOP    |          |       |         |
| 1 CABIN AIR FILTER                 | 00-6515 | 1        |       | \$23.36 |

PARTS & MATERIALS TOTAL \_\_\_\_\_

WORK AUTHORIZED BY: RON J WORK COMPLETED BY: RON J

UNIT RETURNED TO SERVICE: JULY 9/2024 OVERALL CONDITION OF UNIT: GOOD

ADDITIONAL COMMENTS: \_\_\_\_\_



## MAINTENANCE WORK ORDER

Nº 2037

UNIT #: 402

ENGINE HOURS: 14826

MILEAGE: 238 Km

WORK LOCATION: Camrose

WORK REQUESTED:

ORDER DATE: Sep 27 21

COMPLETED DATE: Sep 2 21

JOB #:

W.O. TYPE (Circle): PM CVIP ReactiveREPAIRS REQUIRED: Trailer Brakes would come on by  
them selfs.

TECH COMMENTS: Found TPU to be plumbed in wrong

## LABOUR DESCRIPTION:

HOURS

Trouble shot. Found TPU to be plumbed in  
wrong. When Bumper was moved and  
TPU to be relocated.

LABOUR TOTAL

## PARTS &amp; MATERIALS

P.O. # QUANTITY PRICE AMOUNT

PARTS &amp; MATERIALS TOTAL

WORK AUTHORIZED BY: Carl

WORK COMPLETED BY: Carl

UNIT RETURNED TO SERVICE: Yes

OVERALL CONDITION OF UNIT: OK.

ADDITIONAL COMMENTS: New CPC4 Installed.  
Mileage milage is way off



## MAINTENANCE WORK ORDER

Nº 2035

UNIT #: 402

ORDER DATE: June 17 24

ENGINE HOURS: 14819

COMPLETED DATE: June 17 24

MILEAGE: 103500

JOB #:

WORK LOCATION: Waverly

W.O. TYPE (Circle): PM CVIP Reactive

WORK REQUESTED:

REPAIRS REQUIRED: Check engine light on and will not idle up.

Bowie Pump Packing / sprocket worn Hydraulic take apart for Bowie pump Broken Packing gland.

TECH COMMENTS:

LABOUR DESCRIPTION: HOURS

|                                |  |
|--------------------------------|--|
| Hooked scanner got CPC4 codes  |  |
| checked wires order a new CPC4 |  |
|                                |  |
|                                |  |
|                                |  |
|                                |  |
|                                |  |

LABOUR TOTAL

PARTS &amp; MATERIALS

|                                | P.O. # | QUANTITY | PRICE | AMOUNT |
|--------------------------------|--------|----------|-------|--------|
| CPC4                           |        |          |       |        |
| Bowie Pump Sprocket and Keyway |        |          |       |        |
|                                |        |          |       |        |
|                                |        |          |       |        |
|                                |        |          |       |        |
|                                |        |          |       |        |

PARTS &amp; MATERIALS TOTAL

WORK AUTHORIZED BY: Carl

WORK COMPLETED BY:

UNIT RETURNED TO SERVICE: yes

OVERALL CONDITION OF UNIT:

ADDITIONAL COMMENTS:

waiting on parts for the Bowie Pump



## MAINTENANCE WORK ORDER

N<sup>o</sup> 1679

UNIT #: 402  
ENGINE HOURS: 13574 (8911)  
MILEAGE: 63327 MI  
WORK LOCATION: 1 on 1  
WORK REQUESTED: \_\_\_\_\_

ORDER DATE: Oct 10 2023  
COMPLETED DATE: Oct 15 2023  
JOB #: \_\_\_\_\_

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: US U-joint for slip yoke on #1 drive.

TECH COMMENTS: \_\_\_\_\_

| LABOUR DESCRIPTION:                   | HOURS     |
|---------------------------------------|-----------|
| <u>Pickup parts drive to location</u> |           |
| <u>install.</u>                       | <u>16</u> |
| <u>Grease grease unit</u>             |           |

LABOUR TOTAL \_\_\_\_\_

| PARTS & MATERIALS              | P.O. # | QUANTITY | PRICE | AMOUNT |
|--------------------------------|--------|----------|-------|--------|
| <u>1 18-10 U-Joint Fillard</u> |        |          |       |        |
| <u>1 slip yoke</u>             |        |          |       |        |
| <u>Invoice on CC statement</u> |        |          |       |        |

PARTS & MATERIALS TOTAL \_\_\_\_\_

WORK AUTHORIZED BY: Cory R. WORK COMPLETED BY: \_\_\_\_\_

UNIT RETURNED TO SERVICE: Oct 15 2023 OVERALL CONDITION OF UNIT: OK.

ADDITIONAL COMMENTS: Needs Adapter for Belly valve to handle  
Passenger side wiper Arm and Blade