



SEMI (PICKER)

H02-216
SEP

MAINTENANCE REQUEST FORM

UNIT# 804

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

SERVICE (COMPLETE)

REMOTE for PICKER (HOUSING, BATTERY,
CHARGER)

LEFT OUTRIGGER RAM ELBOW FITTING

NEW WED VIA HWY 9

REQUESTED BY:

DATE:



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEMI (TRUCK)

Maintenance Request / Report Form

Information



804



BHDD Shop



Thursday, December 18th 2025, 4:11 PM (MST -07:00)

Unit Information

Date:



December 18, 2025

Select Unit Number:



804

KMs:



133357

Hours:



9116

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.



Maintenance Report - Field completion of maintenance.




Repairs Required

Description of Repairs Required (attach photos):



Check brakes

- visually checked brakes, all slack adjuster angles are good
- tested park brake system, all good
- verified brakes function properly
- replaced dash air brake control valve

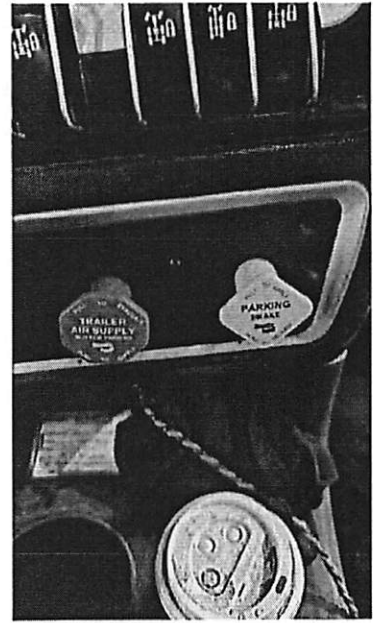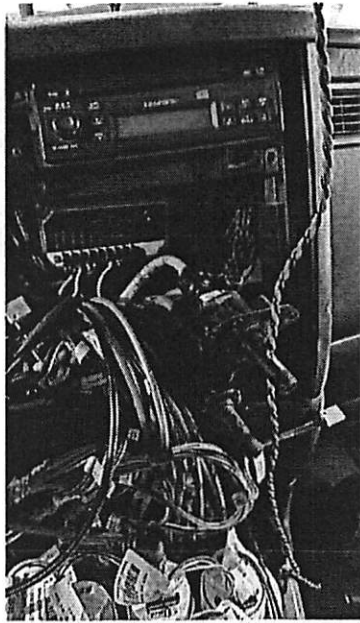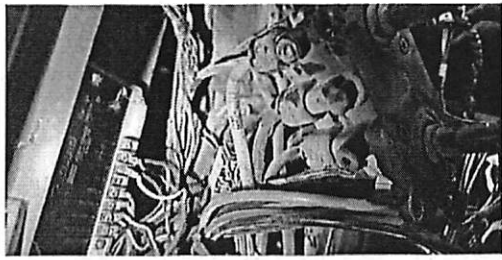

Serial/Part # if applicable:

☐ No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Completed

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Wainwright Shop

Requested By:

Worker Requesting Repairs:

 Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*

 December 18th 2025, 4:11 PM [MST -07:00]

 52.8513306, -110.8421375





5211 (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

Maintenance Request / Report Form

Information



804



Carbonex DL - 2511-005



Saturday, November 15th 2025, 9:35 AM (MST -07:00)

Unit Information

Date:



November 15, 2025

Select Unit Number:



804

KMs:



133256

Hours:



9028.9

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.



Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):





New flex pipe? Or something different?

FIELD REPAIR

ASKED FOR (PICTURES) MANY TIMES
OF CLAMPS / EXHAUST HOSE / SIZE.



All the flex pipe is broke on Exhaust

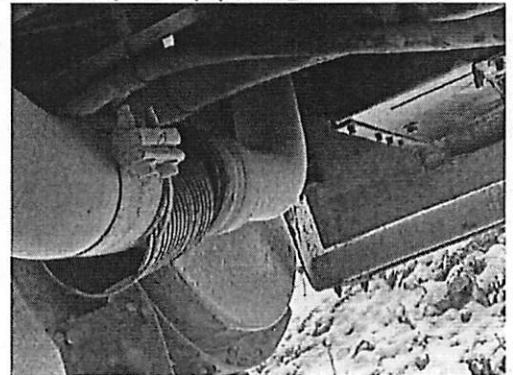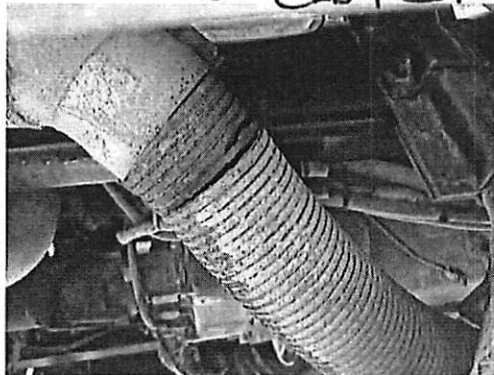

5" FLEX x 1'
5" FLEX x 3'

4 x CLAMPS

JA

Serial/Part # if applicable:



No Response

urgency of repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Field Repaired

Requested By:

Worker Requesting Repairs:



Derik Lynch

Signatures

Derik Lynch, *Locator*

 November 15th 2025, 9:35 AM (MST -07:00)



 54.5791397, -119.0092091

ARW TRUCK EQUIPMENT LTD.
9410 51 Avenue Edmonton, AB T6E 5A6
Ph: 780-436-1406 Fax: 780-436-9132
WWW.ARWTRUCK.COM

SOLD TO *** emailed ***
987207 BROTHERS HDD INC.
2002 23 AVENUE
WAINWRIGHT, AB T9W 0B8

SHIP TO

Sold By: BND PO #: Date 3/10/25 QUOTE PARTS KP09198
Ship By: Tax #: 766603732 12:30:50 PRT: 1 Open

Tax	D	Qty	Description	Price	Amount
Group: 01					
PARTS HIAB					
NK	N	1	HIB 9824529 ELBOW V2A05	99.26	99.26
NK	N	1	HIB 3786692 BATTERY V3D06	217.12	217.12
** TOTAL PARTS HIAB					316.38
MESSAGES					
STOCK					

ALL PARTS SALES ARE FINAL-NO RETURNS ACCEPTED.
TERMS:PARTS & SERVICE ARE NET 30 DAYS.
A SERVICE CHARGE OF 18% ANNUM(1 1/2% PER MONTH)WILL BE ADDED TO OVERDUE ACCOUNTS.
PROVINCIAL SALES TAX,WHERE APPLICABLE.IS THE CUSTOMER'S RESPONSIBILITY.

** SUBTOTAL 316.38

X _____ 88301 9176
Charge Sale

** GST 15.82

Phone: (780)214-7711

PAY THIS
AMOUNT



\$332.20



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

SEMI (PICKER)

Maintenance Request / Report Form

Information

 804

 BHDD Shop

 Wednesday, June 25th 2025, 7:44 AM [MDT -06:00]

Unit Information

Date:  June 9, 2025

Select Unit Number:  804

KMs:  126180

Hours:  8753

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

-  Cvip, checkover
- replaced picker outrigger steel lines
- replaced fan belts
- replaced frame fuel filter housing
- replaced rear mudflaps
- replaced POS air switch
- replaced turbo downpipe bellow
- replaced rear axle wheel seal
- replaced rear axle shock
- replaced pto
- filled transmission with new oil
- got driver side windshield replaced

Serial/Part # if applicable:  No Response

Urgency of Repairs:

Select priority level of repairs:
 Standard Priority - Required within 3-5 days

Location of repairs being completed:

Pick the location where the repairs were completed:
 Wainwright Shop

Requested By:

Worker Requesting Repairs:  Luke Jacobsen

Signatures

Luke Jacobsen, *Mechanic*

 June 25th 2025, 7:44 AM (MDT -06:00)

 52.851375, -110.8421117





SEMI (PICKER)

Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-771

Maintenance Request / Report Form

Information

804

Rocky Gas DL 2503-009

Monday, May 26th 2025, 10:49 AM (MDT -06:00)

Unit Information

Date: May 26, 2025

Select Unit Number: 804

KMs: # 1

Hours: # 1

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Request - Request shop assistance in facilitating repairs.

Repairs Required

Description of Repairs Required (attach photos):

Mic for radio, put mud flaps on

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Low Priority - Repair at earliest convenience

Location of repairs being completed:

Pick the location where the repairs were completed:

☒ Wainwright Shop

req by:

Worker requesting Repairs:



Derik Lynch

Signatures

Derik Lynch, *Locator*



May 26th 2025, 10:49 AM (MDT -06:00)



52.8520505, -110.842003

A handwritten signature in black ink, appearing to read 'Derik Lynch', located to the right of the printed name.

ARW TRUCK EQUIPMENT LTD.
 9410 51 Avenue Edmonton, AB T6E 5A6
 Ph: 780-436-1406 Fax: 780-436-9132
 WWW.ARWTRUCK.COM

SOLD TO *** emailed ***
 987207 BROTHERS HDD INC.
 2002 23 AVENUE
 WAINWRIGHT, AB T9W 0B8

SHIP TO
 BIGBORE
 RON
 2, REINHART IND PARK
 LLOYDMINSTER, AB .

Sold By: BND PO #: Date 3/04/25 QUOTE PARTS KP09169
 Ship By: Tax #: 766603732 10:20:17 PRI: 2 Open

Tax	D	Qty	Description	Price	Amount
Group: 01					
PARTS HIAB					
NK	N	1	HIB 387-1476 HSG P2G06	895.78	895.78
NK	N	1	HIB 3786692 BATTERY V3D06	217.12	217.12
NK	N	1	HIB 3787079 CHARGER V3D08	601.61	601.61
NK	N	1	HIB 3855601 CYL R1E03	3829.08	3829.08
** TOTAL PARTS HIAB					5543.59

MESSAGES
 STOCK ITEMS

ALL PARTS SALES ARE FINAL-NO RETURNS ACCEPTED.
 TERMS:PARTS & SERVICE ARE NET 30 DAYS.
 A SERVICE CHARGE OF 18% ANNUM(1 1/2% PER MONTH)WILL BE ADDED TO OVERDUE ACCOUNTS.
 PROVINCIAL SALES TAX,WHERE APPLICABLE.IS THE CUSTOMER'S RESPONSIBILITY.

** SUBTOTAL 5543.59

88301 9176
 Charge Sale

** GST 277.18

Phone: (780) 214-7711

PAY THIS
 AMOUNT

\$5820.77



MAINTENANCE WORK ORDER

Nº 3392

UNIT #: 824
ENGINE HOURS: 8560
MILEAGE: 123452
WORK LOCATION: Wahwaugh
WORK REQUESTED: _____

ORDER DATE: Mar 10 2025
COMPLETED DATE: Mar 11 2025
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Replace right outrigger cylinder

TECH COMMENTS: Coolant level low engine code. level sensor was hanging from harness, plugged in and cleared code

LABOUR DESCRIPTION:

HOURS

Removed covers, unhooked hyd cylinder, disconnected fittings, removed cylinder, transferred cylinder fittings. 5
Installed cylinder, connected lines, test function
Replaced cracked fitting on cylinder

LABOUR TOTAL

5

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
--------	----------	-------	--------

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: RonWORK COMPLETED BY: Luke JacksonUNIT RETURNED TO SERVICE: Mar 11 2025OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____



Brothers HDD Inc
2002 23 Avenue
Wainwright, Alberta
T9W 0B8
780-214-7711

PICKER TRUCK

Maintenance Request / Report Form

Information

804

w/o # 000136

BHDD Shop

Monday, March 10th 2025, 10:15 AM [MDT -06:00]

ENTERED
MAR 13 2025

Unit Information

Date: March 10, 2025

Select Unit Number: 804

CMs: # 123452

Hours: # 8560

Please choose from list to identify if this is a request for Maintenance? Or if you are Reporting on maintenance completed.

☒ Maintenance Report - Field completion of maintenance.

Repairs Required

Description of Repairs Required (attach photos):

Complete engine service:
Air filters, fuel filters, oil filter and engine oil
Repair remote for picker
Replace left out rigger hydraulic ram RAM

Serial/Part # if applicable: No Response

Urgency of Repairs:

Select priority level of repairs:

☒ Shop service/repair ASAP

Location of repairs being completed:

Pick the location where the repairs were completed:

Requested By:

Worker Requesting Repairs:



Derek Lynch

Signatures

Ron Jerome, *Supervisor*

A handwritten signature in black ink, appearing to be 'RJ' or similar initials, written over a faint grid background.

March 10th 2025, 10:15 AM (MDT -06:00)



SEM1

MAINTENANCE REQUEST FORM

UNIT# 804

HRS/KM

DESCRIPTION OF REPAIRS REQUIRED

- Pto leaking hydraulic and trans,
Feet. Fluid

- Oil Filter leaking

- Leak out of out Rigger on drivers side
CNIP

WEBASTO OPERATION?

REQUESTED BY: Derik Lynch

DATE: Nov. 26, 24



MAIN SERVICE WORK ORDER

Nº 3065

UNIT #: 804
ENGINE HOURS: 7563
MILEAGE: 70997 MILES
WORK LOCATION: _____
WORK REQUESTED: _____

ORDER DATE: AUGUST 14/2024
COMPLETED DATE: AUGUST 14/2024
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: _____

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

<u>ROUTING COOLANT LINES (DEF DELETE)</u>	<u>3</u>
<u>HELPING TONY WITH EXHAUST (REMOVED MUFFLER/</u>	
<u>DEF RESINATOR)</u>	

LABOUR TOTAL 3

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: COEN TC WORK COMPLETED BY: RON JUNIT RETURNED TO SERVICE: AUGUST 14/2024 OVERALL CONDITION OF UNIT: GOOD

ADDITIONAL COMMENTS: _____



Vehicle Sign-Out Sheet

Unit #: ~~804~~ 804 Description: Picker

KMs: 1350

OK - Acceptable • Meets the requirements of good use/operating condition - no causes for concern
RA - Requires Attention • Requires attention ASAP, but does not present imminent danger or component/part failure. Can proceed to use and/or operate.
UA - Unacceptable • Requires immediate repair and/or correction - imminent danger or component/part failure could occur.
NOTE: Cannot proceed to use or operate without Management approval.
N/A - Not Applicable • Has no application on this day

Item	OK	RA	UA	N/A	Comments
Fluids (motor oil, windshield washer fluid, radiator, power steering)	✓	✓			
Lights (Head lights, tail lights, signal lights, brake lights, hazard lights)	✓	✓			
Glass condition (Cleaned, cracked, missing)	✓	✓			
Fire extinguisher (Proper size, properly mounted, inspection current)	✓	✓			
Housekeeping (Cab and box/bed clean and free of debris)	✓	✓			
Gauges / Switches	✓	✓			
GeoTab Installed and Functional	✓	✓			
Back-up Alarm (if applicable)	✓	✓			
Horn (Functioning and audible)	✓	✓			
Positive Air shut-off (if applicable)	✓	✓			
Tire Pressure	✓	✓			
Brakes, Emergency Brakes	✓	✓			
Spare Tire, Jack, Tire Iron		✓		✓	
Load secured	✓	✓			
First Aid Kit	✓	✓			
Emergency Roadside Kit (Triangle, reflector/high visibility vest)	✓	✓			
Oil Change Required?		✓			Jan. 25, 2024 - 1375
Documentation: (Truck Binder: Insurance card, Registration, CAB card, Fitness Cert)	✓	✓			
CVIP Required?	✓	✓			
Base radio?	✓	✓			
Body Damage? (Dents, scratches, cracks)					Passenger side hood/picker cover

Additional Items or Comments

Supervisor: Derek Lijndel
Please Print Name

Date: May 22/24

Signature: _____

Management Shayne Macdonald

Date: May 23/24

Signature [Signature]

804
 UNIT #: ~~804~~
 ENGINE HOURS: 7385.2
 MILEAGE: 108794
 WORK LOCATION: Brothers HOD
 WORK REQUESTED:

ORDER DATE: Feb/5/24
 COMPLETED DATE: Feb/5/24
 JOB #: SHOP

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: new head lights fix Air leaks

TECH COMMENTS:

LABOUR DESCRIPTION: Put new head lights in replaced Air fittings HOURS 2

LABOUR TOTAL 2

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
head lights Shop head light	no-5106	2	\$29.38	
Air fittings Shop head	SHOP	3		

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: Cory WORK COMPLETED BY: Chase

UNIT RETURNED TO SERVICE: Yes OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS:

(B)



MAINTENANCE WORK ORDER

Nº 1744

ENTERED
JAN 25 2024

UNIT #: 804

ENGINE HOURS: 7375

MILEAGE: 108625

WORK LOCATION: Brothers HDD

WORK REQUESTED: full service

REPAIRS REQUIRED: put new tool box ~~door~~ full service
latch on

W.O. TYPE (Circle): PM CVIP Reactive

TECH COMMENTS:

LABOUR DESCRIPTION:

HOURS

changed all filters	put new tool box	4
latch, repaired air leaks, check air filter, mount		3
base radio, install tool box door latch		

LABOUR TOTAL

PARTS & MATERIALS

PO. #	QUANTITY	PRICE	AMOUNT
oil filter shop had	1		
fuel filters shop had	2		
coolant filter shop had	1		
picker filters shop had	2		
Hydraulic filters shop had	1		
Air filters	2		
owl/40 oil	442		

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: Shane

WORK COMPLETED BY: Chase

UNIT RETURNED TO SERVICE: yes

OVERALL CONDITION OF UNIT: good

ADDITIONAL COMMENTS:



MAINTENANCE REQUEST FORM

UNIT# 804

HRS/KM 108625

RE: WORK ORDER # 1744

DESCRIPTION OF REPAIRS REQUIRED

- * 1) MAJOR AIR LEAK - YOU CAN HEAR IT
BY DRIVERS SIDE FENDER
- * 2) FIRE EXT CHECK 'S MARKED OR REPLACED
- 3) TOOL BOX DOOR LATCH - ORDERED
FROM GREGG DIST (SHOP ON MONDAY 29TH)
- 4) INTERIOR CLEAN (TUES 30TH)
- 5) RADIO WIRING

REQUESTED BY: RON J

DATE: JAN 26/2024



MAINTENANCE WORK ORDER

Nº 2102

UNIT #: 804
ENGINE HOURS: 7285
MILEAGE: 106 298
WORK LOCATION: Shop
WORK REQUESTED: _____

ORDER DATE: Dec 12 23
COMPLETED DATE: Dec 12 23
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: will not stay running

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

<u>Test ACT OK</u>	
<u>Replaced Batteries</u>	

LABOUR TOTAL _____

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
<u>Bumper to Bumper</u>	<u>4512</u>			

PARTS & MATERIALS TOTAL 808.21

WORK AUTHORIZED BY: Con R. WORK COMPLETED BY: Con R.

UNIT RETURNED TO SERVICE: _____ OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 1683

UNIT #: 804
ENGINE HOURS: 7189
MILEAGE: 103854
WORK LOCATION: Shop
WORK REQUESTED: _____

ORDER DATE: Oct 20 23
COMPLETED DATE: Oct 20 23
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Power steering leak.
Right CL out
Change grease nipples on Pctbr.

TECH COMMENTS: _____

LABOUR DESCRIPTION:	HOURS
<u>Change Power steering code</u>	
<u>for Broken wire for CL.</u>	
<u>Change grease nipples</u>	
<u>Repair Broken Exhaust Pctbr</u>	

LABOUR TOTAL 12

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>Codes</u>				
<u>Green Pctbr Remote</u>				
<u>Exhaust pipe and Clamps Bumpers</u>	<u>4181</u>		<u>48.78</u>	

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Carl WORK COMPLETED BY: Carl

UNIT RETURNED TO SERVICE: Oct 24 OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____



MAINTENANCE WORK ORDER

Nº 1503

UNIT #: 804

ENGINE HOURS: 7604

MILEAGE: 103130

WORK LOCATION: Yard

WORK REQUESTED:

ORDER DATE: Sept. 15, 2023

COMPLETED DATE:

JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: Inner cooler leaking oil, Remote for picker-
hy cord.

TECH COMMENTS:

LABOUR DESCRIPTION: HOURS

Remote for Dike is from 801
needs to be switched back.

LABOUR TOTAL

PARTS & MATERIALS

Remote for picker ordered ARW
Sept 18 23

P.O. # 00-3747

QUANTITY PRICE AMOUNT

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: WORK COMPLETED BY:

UNIT RETURNED TO SERVICE: OVERALL CONDITION OF UNIT:

ADDITIONAL COMMENTS:



MAINTENANCE WORK ORDER

Nº 1100

UNIT #: 804
ENGINE HOURS: 6958
MILEAGE: 163125
WORK LOCATION: Shop
WORK REQUESTED: _____

ORDER DATE: Sept 14 23
COMPLETED DATE: Sept 14 23
JOB #: _____

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: outigger Right side oil leak

TECH COMMENTS: Cleaned Fard Fred Tested

LABOUR DESCRIPTION:	HOURS
<u>Repair hrs</u>	<u>1</u>

LABOUR TOTAL _____

PARTS & MATERIALS	P.O. #	QUANTITY	PRICE	AMOUNT
<u>Alu</u>	<u>3827</u>			

PARTS & MATERIALS TOTAL 903.97

WORK AUTHORIZED BY: _____ WORK COMPLETED BY: Chase / Coy

UNIT RETURNED TO SERVICE: _____ OVERALL CONDITION OF UNIT: OK

ADDITIONAL COMMENTS: _____

HIAB ARW TRUCK EQUIPMENT LTD.
9410 51 Avenue Edmonton, AB T6E 5A6
Ph: 780-436-1406 Fax: 780-436-9132
WWW.ARWTRUCK.COM

SOLD TO *** emailed ***
987207 BROTHERS HDD INC.
2002 23 AVENUE (780)
WAINWRIGHT, AB T9W 0B214-7711

SHIP TO
UNIT 804
HIAB 211.
S/N# 21101541

Sold By: FLT PO #: 3827 Date 9/01/23 PARTS INVOICE KI52543
Ship By: PICKUP Tax #: 766603732 14:01:25 PRT: 2

Tax	D	Qty	Description	Price	Amount
Group: 01					
PARTS HIAB					
NK	N	4	HIB 9859969 HOSE P4H04	98.83	395.32
NK	N	1	HIB 3764893 TUBE P3C12	233.85	233.85
NK	N	1	HIB 3764885 TUBE P3C12	231.75	231.75
** TOTAL PARTS HIAB					860.92

ALL PARTS SALES ARE FINAL-NO RETURNS ACCEPTED.
TERMS: PARTS & SERVICE ARE NET 30 DAYS.
A SERVICE CHARGE OF 18% ANNUM(1 1/2% PER MONTH) WILL BE ADDED TO OVERDUE ACCOUNTS.
PROVINCIAL SALES TAX, WHERE APPLICABLE, IS THE CUSTOMER'S RESPONSIBILITY.

X 

88301 9176
Charge Sale

** SUBTOTAL 860.92

** GST 43.05

PAY THIS
AMOUNT

\$903.97

MAINTENANCE WORK ORDER

Nº 1737

1005

UNIT #: 804
 ENGINE HOURS: 6998.7
 MILEAGE: 103084
 WORK LOCATION: Brother Hood
 WORK REQUESTED:

ORDER DATE: SEP/14/23
 COMPLETED DATE: SEP/14/23
 JOB #:

W.O. TYPE (Circle): PM CVIP Reactive

REPAIRS REQUIRED: picker hoses leaking

TECH COMMENTS:

LABOUR DESCRIPTION:	HOURS
replaced 2 picker hoses	5

LABOUR TOTAL

PARTS & MATERIALS

P.O. #	QUANTITY	PRICE	AMOUNT
1	2	1	1

PARTS & MATERIALS TOTAL

WORK AUTHORIZED BY: cory
 UNIT RETURNED TO SERVICE: YES
 ADDITIONAL COMMENTS:

WORK COMPLETED BY: chace
 OVERALL CONDITION OF UNIT: good



MAINTENANCE WORK ORDER

Nº 1085

UNIT #: 804ENGINE HOURS: 6579MILEAGE: 88667WORK LOCATION: Shop

WORK REQUESTED: _____

ORDER DATE: Jan 15 23COMPLETED DATE: Jan 15-23

JOB #: _____

W.O. TYPE (Circle): PM CVIP ReactiveREPAIRS REQUIRED: CVIP

TECH COMMENTS: _____

LABOUR DESCRIPTION:

HOURS

<u>CVIP</u>	<u>9</u>
<u>Pass windshield</u>	
<u>Air Drier</u>	

LABOUR TOTAL 9

PARTS & MATERIALS

	P.O. #	QUANTITY	PRICE	AMOUNT
<u>New windshield</u>	<u>Kw.</u>	<u>2492.</u>		

PARTS & MATERIALS TOTAL _____

WORK AUTHORIZED BY: Con R

WORK COMPLETED BY: _____

UNIT RETURNED TO SERVICE: 01-15-23OVERALL CONDITION OF UNIT: Good

ADDITIONAL COMMENTS: _____