

INTEGRITY

Oilfield Hauling Ltd

Repair Order

Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Carnduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Carnduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 17, 2024		IOH			1 / 6

WO005169

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 10325 HR	
Description 112 - BED TRUCK KW					
Make		Model		Year 2006	
License IOH 112		Last Cert. ()		Engine MXS50975	
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. SGI SAFETY		2.00 HR	130.0000	260.00	
SGI 1 YEAR - JIM D					
LH CENTER MIRROR LIGHTS					
LH AND RH FRONT CORNER BED CLEARANCE LIGHTS					
TACK AND SPEEDO LIGHT					
LH CENTER BED CLEARANCE LIGHT					
RH FRONT DRAG LINK					
AXLE #1 BRAKE POT LH					
AXLE #2 BRAKE POT RH					
AXLE #2 LH AND RH SLACK ADJUSTER					
AXLE #3 LH SLACK ADJUSTER					
CAB SHOCKS					
WINDSHIELD WASHER PUMP					
EXHAUST LEAK UNDER CAB LH					
BROKEN U BOLT AUX					
10TH CROSS MEMBER RH					
AXLE #2 RH AIR BAG MOUNT BROKE					
MISSING BOLT IN BELL HOUSING TO TRANS					
AXLE #1 LH AND RH KING PINS					
AXLE #2 LH AND RH KING PINS					
ENGINE OIL LEAK LH FRONT					
AXLE #3 LH AND RH SCAM BUSHINGS					
WALKING END BEAM PINS AND BUSHINGS					
AXLE #4 LH AND RH SCAM BUSHINGS					
SGI SAFETY STICKER	SGI SAFETY STICKER	1.00 EA	0.0000	0.00	
Activity Sub-Total:				260.00	

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 17, 2024		IOH			2 / 6
Activity Description					
Part #	Part Description	Quantity	Unit	Charge	Total
2.	Tires, Tubes, Liners & Valves	4.00	HR	130.0000	520.00
	FLAT REPAIR LH STEER - DANIEL				
	FLAT REPAIR LH REAR STEER, NEEDS NEW VALVE STEM AND O RING				
	WASH OUT RIM				
	CLEAN HUB				
	TOP UP ALL OTHER TIRES				
	TORQUE TO 550				
	S/S REAR STEER RH , VALVE STEM CHANGE, NEW O RING				
	CLEAN RIM PARTS				
	WASH OUT RIM				
	CLEAN HUB				
	TORQUE TO 550				
Activity Sub-Total:					520.00

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Camduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Camduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 17, 2024		IOH			3 / 6
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
3. Suspension		36.00 HR	130.0000	4680.00	
SOUTHERN BOLT INV 189672					
INLAND INV 30083ESP					
REPLACE SUSPENSION BUSHINGS					
CAB SHOCKS					
AXLE #2 RH AIR BAG MOUNT BROKE					
WALKING END BEAM PINS AND BUSHINGS					
83025HD	CAB SHOCK	2.00 EA	48.5900	97.18	
FRE	FREIGHT	1.00 EA	25.0000	25.00	
K066-95	SUSPENSION BUSHING	4.00 EA	500.0000	2000.00	
K066-113	BUSHING-TRUNNION SHAFT	2.00 EA	200.0000	400.00	
HNZ8F138	1-3/8 GR 8 NF	8.00 EA	4.6000	36.80	
FWZ8138	1-3/8 GR 8 FLATS	8.00 EA	1.5200	12.16	
CSZ8F1386	1-3/8 X 6 GR 8 NF	8.00 EA	25.2000	201.60	
SLNF114	1-1/4 NF STOVER LOCK NUT	8.00 EA	8.5100	68.08	
FWZ8114	1-1/4 GR 8 FLAT WASHER	8.00 EA	0.9500	7.60	
CSZ8F114512	1-1/4 X 5-1/2 GR 8 NF	8.00 EA	67.7300	541.84	
SLNF1	1 NF STOVER LOCK NUT	4.00 EA	2.7100	10.84	
FWZ81	1 GR 8 FLAT WASHER	4.00 EA	0.5500	2.20	
CSZ8F112	1 X 12 GR 8 NF	2.00 EA	33.0800	66.16	
CSZ8F14	1 X 4 GR 8 NF	2.00 EA	5.0200	10.04	
SLNF34	3/4 NF STOVER LOCK NUT	8.00 EA	0.7400	5.92	
FWZ834	3/4 GR 8 FLAT WASHER	8.00 EA	0.3800	3.04	
CSZ8F34612	3/4 6-1/2 GR 8 NF	8.00 EA	5.3200	42.56	
Activity Sub-Total:				8211.02	
4. Steering		0.00 HR	0.0000	0.00	
EDMONTON KENWORTH INV 04LP393086					
RH FRONT DRAG LINK					
12431-0000-01	DRAG LINK FORWARD RH	1.00 EA	662.0200	662.02	
Activity Sub-Total:				662.02	

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Carnduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Carnduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 17, 2024		IOH			4 / 6
Activity Description					
Part #	Part Description	Quantity	Unit	Charge	Total
5. Axle - Non-Driven, Front		0.00	HR	0.0000	0.00
AXLE #1 LH AND RH KING PINS					
AXLE #2 LH AND RH KING PINS					
811525	KING PIN	2.00	EA	388.3000	776.60
Activity Sub-Total:					776.60
6. Brakes		0.00	HR	0.0000	0.00
AXLE #1 BRAKE POT LH					
AXLE #2 BRAKE POT RH					
AXLE #2 LH AND RH SLACK ADJUSTER					
AXLE #3 LH SLACK ADJUSTER					
AXLE #3 LH AND RH SCAM BUSHINGS					
AXLE #4 LH AND RH SCAM BUSHINGS					
102189	AIR CHAMBER BRACKET BUSH	4.00	EA	27.9600	111.84
107739	CAM BUSHING	4.00	EA	42.8400	171.36
124310	CLARK SPEEDY SLEEVE	4.00	EA	27.1000	108.40
382-8064	WHEEL SEAL	4.00	EA	52.5200	210.08
179.SC20	TYPE 20 SERVICE POT	2.00	EA	39.3000	78.60
FS-5082A	BRAKE CLEVIS 5/8, 1/2 PIN	1.00	EA	0.9200	0.92
F400-D10155	AUTO SLACK	3.00	EA	81.0000	243.00
278035	CLARK SLACK	1.00	EA	123.1800	123.18
124429	CLARK HUB SEAL	4.00	EA	64.1300	256.52
247717	SNAP RING	8.00	EA	3.1300	25.04
126248	BRAKE SHOE BUSHING	8.00	EA	10.1100	80.88
109752	SCAM CLARK 86" TRACK	2.00	EA	312.5000	625.00
109751	SCAM CLARK 86" TRACK	2.00	EA	312.5000	625.00
67322	INNER BEARING CUP CLARK BD91	4.00	EA	58.3100	233.24
67390	INNER BEARING CONE CLARK BD91	4.00	EA	140.2600	561.04
67720	OUTER BEARING CONE CLARK BD91	4.00	EA	159.7500	639.00
67782	OUTER BEARING CUP CLARK BD91	4.00	EA	329.0000	1316.00
Activity Sub-Total:					5409.10

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 17, 2024		IOH			5 /6
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
7. GREASE AND CHECK LEVELS		1.00 HR	130.0000	130.00	
GREASE SEPT 5 - BRADEN					
Activity Sub-Total:				130.00	
8. Trim & Miscellaneous Hardware		0.00 HR	0.0000	0.00	
FAST INV 86515					
MACHINE AND WELD BED TRUCK AXLES					
LAB	LABOUR	2.00 EA	160.0000	320.00	
Activity Sub-Total:				320.00	
9. Lighting System		0.00 HR	0.0000	0.00	
LH CENTER MIRROR LIGHTS					
LH AND RH FRONT CORNER BED CLEARANCE LIGHTS					
TACK AND SPEEDO LIGHT					
LH CENTER BED CLEARANCE LIGHT					
45583	MILLENIUM 1, LED	2.00 EA	34.6000	69.20	
Activity Sub-Total:				69.20	
10 Trim & Miscellaneous Hardware		0.00 HR	0.0000	0.00	
WINDSHIELD WASHER PUMP					
BROKEN U BOLT AUX					
10TH CROSS MEMBER RH					
MISSING BOLT IN BELL HOUSING TO TRANS					
ENGINE OIL LEAK LH FRONT					
HLK7046K	W/W PUMP	1.00 EA	18.8800	18.88	
Activity Sub-Total:				18.88	
11 Exhaust System		0.00 HR	0.0000	0.00	
EXHAUST LEAK UNDER CAB LH					
EC50UZP	CLAMP-MUFFLER BAND ZINC 5IN	4.00 EA	7.5300	30.12	
EC50PLA	EXHAUST CLAMP	5.00 EA	10.7400	53.70	
40012	5" GAL FLEX PIPE 25' ROLL	1.00 EA	6.7100	6.71	
Activity Sub-Total:				90.53	

Technician: BRADEN-BRADEN
DAVIS-JIM
DANIEL ARMST-DANIEL
KIRBY-KEVIN

Authorized By:

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 17, 2024		IOH			6 /6
DEMI-DEMI					

Total Labor: 5,590.00

Total Parts: 10,877.35

Shop Supplies: 0.00

SGI STICKER: 15.75

Sub Total: 16,483.10

GST: 823.37

PST: 0.00

Proof Total: 17,306.47

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: June 17/24

Unit #: B112

License Plate #: 10H 112B

Odometer: ~~10325~~

Unit Hours: 10325

S/N:

Maintenance

☒

PMP

☒

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
2	45583	5th lug	greased truck	
23	F400-010155	Light's	Replaced Axle 2 RH slack adj	
1	F55082A	Left corner minor light	Replace top & Center light's	
2	179.5020 Brake pot	Left & Right Corner Bed	Replace light's	
2	B3025	Clearance light's	Replace light Repair wiring	
1	HLK7046K	Left Center Bed	Replace light	
		Clearance light's	Repair wiring	
		Tach & Speedo light's	Replace bulbs in tach w/ light in speedo	
		Windshield washer	Replace washer pump	

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

X	X	X	X
X	X	X	X

Wheels Off: Trailer

Tires have been torqued:

✓ 500

Work Completed By: Dennis, Kevin, Squak

Mechanic's Signature: _____

★ Torque tires } set brakes ✓
~~grease~~, grease ✓

Qty.	Part #	Repairs Required	Work Done	Hours
		Front End		
1	12431-0000-01 ✓	Right front drag	Installed new one	
2	K066-113 XU ✓	Coil Arm bent		
4	124429 ✓	Axle #1 left brake pot	Changed brake Pot / Slack Adjuster	
4	67390	Left & Right King pins		
4	67782 ✓	Axle #2 Right brake pot	Changed Pot	
		Left Slack adjuster	Changed SLACK Adjuster	
	382-8064	Left & Right King pins		
2 KITS	811525 ✓	Cab Shocks	Changed Cab Shocks	
1	40012 (5" flex pipe)	Exhaust leak under	changed flex pipe and 45	
5	EC 50PLA	Cab Left Side		
4	124310	ACK U-bolt broke	Replace with used U-bolt & Rubber's	
1	K140-2437 ✓	10th Cross member	Replaced	
4	67322	bottom bracket		
4	67720	Engine oil leak	lighten up oil line for compressor?	
4	EC 50U2P	Left front side		
4	107739	Axle #3		
4	102189	Left & Right S-Cam bushings		
8	6-327	End walking beam bushings pins		
2	751	Walking beam bushings		
2	752	Axle #4	Filled All hubs -75-90	
	278-035	Left & Right S-Cam bushings		
12	172-027	End walking beam pins		

Axle #5 Right Air bag bracket - welded.

Replaced Axle 3 L/H slack adj

Power Unit/Truck/Bus Inspection

1. Customer information

Name			
Address	City/town	Province	Postal code
Email address		Phone number	

2. Vehicle information

VIN number		Odometer km mi	
Make <i>Kenworth</i>	Model <i>C-500</i>	Year	Unit number <i>B11A</i>
Colour <i>White</i>	Fuel <i>Deisel</i>	Licence number <i>IOH103</i>	Province <i>SK</i>
Brake type ☐ Air brake ☐ Electric ☐ Hydraulic ☐ Not equipped ☐ No Brake		Is the GVWR of this vehicle greater than 4,536kg? ☐ Yes ☐ No	

3. Inspection information

Start date <i>June 17/24</i>	Completion date	Expiry date
☐ Inspection failed Reason ☐ Inspection passed ☐ FTR ☒ PMVI ☐ Police request ☐ Taxi/Rideshare ☐ TLV ☐ VSI request ☐ Other		
Station number	Station name	

☒ PMP Inspection

☐ Commercial Inspection

Brake Type:

☐ Disc ☒ SCAM

☐ Wedge ☐ NO

Brake Drum/SCAM Type:

- ☐ 15" Ext. Service Cam
- ☐ 15" Std. Service Cam
- ☐ 16.5 Ext. Service Cam
- ☐ 16.5" Std. Service Cam
- ☐ 16.5" Ext. Cam/Std Lining
- ☐ 12.25" Brake Drum
- ☐ 14" Brake Drum
- ☒ Other _____

Identify Rejected and REQATT Items by marking with an X. When item is Passed identify with marking with a P. P=PASS R=REJECTED RA=REQATT (comments required for REQATT)

No	P	R	RA	DRIVER COMPARTMENT	COMMENTS	No	P	R	RA		COMMENTS
01				Vehicle Identification		33					Reflex Reflectors
02				Sun Visor Interior		34					Retro Reflective Markings
03				Horn Operation		35					Body/Bumpers
04				Mirrors		36					Trailer Hitch
05				Windshield Wipers/Washers		37					Cab Grab Handles
06				Windshield Defroster/Heater		38					Attached Equipment
07				Windshield/Other Glass		39					Cargo Bodies/Vessels
08				Gear Position Indicator & Neutral Switch		40					Sun Visor Exterior
09				Instrument Lamps		41					Mudflaps/Fenders
10				Accessibility Features/Equip		42					Trailer Power Cord
11				Auxiliary Heaters		43					Chain/Headache Rack
12				Auxiliary Drive Controls		44					Auxiliary Compartments
13				Emergency Exits		45					Hybrid Vehicle Drive System
14				Floor/Step Wall Covering		46					Unitized Body Elements
15				Service/Exit Doors		No	P	R	RA	ENGINE COMPARTMENT	COMMENTS
16				Indicator Lamps		47					Cab/Hood Safety Catches
17				Instruments/Gauges		48					Power Steering System
18				Switches		49					Fuel System
19				Brake Pedal/Actuator		50					Battery/Wiring Condition
20				Clutch/Clutch Pedal		51					Air Suspended Cab
21				Fire Extinguisher/Hazard Kit		52					Cab Mounts
22				Seats/Seat Belts/SRS		53					Drive Belts
23				Steering Column/Components		No	P	R	RA	CHASSIS	COMMENTS
24				Auxiliary Controls/Equip		54					Hyd Brake System/Components
25				Speedometer/Odometer		55					Air Brake Systems/Components
26				Steering Lash/Travel		56					Wheel Bearings
27				Accelerator Pedal/Actuator		57					King Pins/Ball Joints
28				Engine Shut Down Control		58					Steering Linkage
29				Engine Start Feature		59					Tires/Wheels
30				Body Interior Fixtures		60					Self-Steering Axle
No	P	R	RA	BODY EXTERIOR	COMMENTS	61					Engine/Transmission Mounts
31				Lamps		62					Frame/Crossmembers/Mounts
32				Headlamp Aim		63					Suspension/Axles
						64					Drive Shaft/Universal Joints
						65					Exhaust/Emission System

Tire Tread Depth (in/mm)		Drum Size / Rotor Thickness (in/mm)		Brake Cam Rotation (degree°)		Wheel Position	
Front	Rear	Front	Rear	Front	Rear	Front	Rear
						☐ ☐ ☐ ☐ ☐ ☐	
						Vehicle Brake Lining Thickness (in/mm)	

Left center mirror lights ✓

Left + Right front corner bed clearance lights ✓

14 Center bed clearance light ✓

Right front drag hint vent ✓

Axle #1 brake pot left ✓

Axle #2 brake pot right ✓

Axle #2 left Slack adjuster ✓

Cab Shocks ✓

Exhaust heat under cab left side ✓

Dropper U bolt axle ✓

10th cross member ✓
Right side

Axle #2 Right air bag mount broke ✓

Missing bolt in bell housing to trans ✓

Axle #1 Left + Right King pin ✓

Axle #2 Left + Right King pin ✓

Engine oil leak left side front ✓

✓ Fuel + Speed light
Windshield washer

11/10

5/8

5/8

3/4

75 9/16 35 3/4 F

100 7/16 55 11/16 2027

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: <u>Sept 5, 24</u>	
Unit #: <u>112</u>	License Plate #: <u>LOH 112B</u>
Odometer:	Unit Hours:
S/N:	
☐	Maintenance
☐	PMP
☐	SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
			<u>Greased Truck</u>	

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Broaden

Mechanic's Signature: Broaden

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: June 24th 2024	
Unit #: 112	License Plate #: IOH 112 B
Odometer:	Unit Hours:
S/N: NA	
Maintenance	PMP
SGI Safety	

Qty.	Part #	Repairs Required	Work Done	Hours
		Flat repair D/S rear side	Needs new valve stem and O-ring	1.5

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

X			

Wheels Off: Trailer

Tires have been torqued: ☒

550

Work Completed By: Daniel Armstrong

Mechanic's Signature: Daniel Armstrong

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: July 26th 2024

Unit #: 112

License Plate #: 10H112B

Odometer:

Unit Hours:

S/N: NA

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
	S/S rear steer	Valve stem change	Done	1
		new oring	Done	
		clean rim parts	Done	
		wash out rim	Done	
		clean hub	Done	

Changed Winch Line: ☐

Slipped Line: ☐

550

Wheels Off: Truck

X			

Wheels Off: Trailer

Tires have been torqued: ☒

Work Completed By:

Daniel Armstrong

Mechanic's Signature:

Daniel Armstrong

INTEGRITY

Oilfield Hauling Ltd.

SHOP WORK ORDER

Date: June 17th 2024	
Unit #: 112	License Plate #: IOH 112B
Odometer: Batteries dead	Unit Hours: 10365.7
S/N: NA	
Maintenance	PMP
SGI Safety	

Qty.	Part #	Repairs Required	Work Done	Hours
		Flat repair	Needs new valve stem	1.5
		wash out rim	Done	
		cleaning hub	Done	
		Top up all other tires	Done	

Changed Winch Line: ☐

Slipped Line: ☐

550

Wheels Off: Truck

X			

Wheels Off: Trailer

Tires have been torqued: ☒

Work Completed By: Daniel Armstrong

Mechanic's Signature: Daniel Armstrong

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Camduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Camduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
May 15, 2024		IOH			1 / 1

WO005004

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 10325 HR	
Description 112 - BED TRUCK KW				ODOMETER 915 KM	
Make	Model	Year 2006			
License IOH 112	Last Cert. ()	Engine MXS50975			
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. Winch		3.00 HR	130.0000	390.00	
REPLACE FRICTION DISC, STATOR PLATES AND SPRINGS AND SEAL KIT - MICHEAL SLIPED 3' WINCH LINE					
42230	Brake Spring RN130	12.00 EA	7.6600	91.92	
42148	STATOR PLATE RUFNEK	7.00 EA	8.2500	57.75	
32765-RN	FRICTION DISC RUFNEK	6.00 EA	19.8500	119.10	
LEN1246	Tulsa RN Brake Piston O-Ring Kit	1.00 EA	38.9700	38.97	
Activity Sub-Total:				697.74	

Technician: JEROME-JEROME
 MICHEAL-MICHEAL

Authorized By:

Total Labor: 390.00
Total Parts: 307.74
Shop Supplies: 0.00
Sub Total: 697.74
GST: 34.89
PST: 0.00
Proof Total: 732.63

M
E

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date:	May 15/2024	
Unit #:	101 112B	
License Plate #:		
Odometer:	9155	
Unit Hours:	10325	
S/N:		
Maintenance	PMP	SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
6	3276SRW			
7	42148			
12	42230			
1	LEN 1246			
			Slipped 3Ft line - Junior	

Changed Winch Line:

☐

Slipped Line:

☒

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued:

☐

Work Completed By: _____

Mechanic's Signature: _____

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Camduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Camduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jan 31, 2024		IOH			1 / 1

WO004586

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ODOMETER 0 KM		
Description 112 - BED TRUCK KW						
Make		Model		Year 2006		
License IOH 112		Last Cert. ()		Engine MXS50975		
Activity Description						
Part #	Part Description			Quantity	Unit Charge	Total
1. Trim & Miscellaneous Hardware				0.50 HR	130.0000	65.00
INLAND INV - 27035ESP						
REPLACE SPEEDO HEAD - BONNER						
GSB11105ATK	SPEEDO GAUGE			1.00 EA	846.4700	846.47
					Activity Sub-Total:	911.47

Technician: BONNER-BONNER

Authorized By:

Total Labor:	65.00
Total Parts:	846.47
Shop Supplies:	0.00
Sub Total:	911.47
GST:	45.57
PST:	0.00
Proof Total:	957.04

M
R.

#111

284535
9260

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: JAN 31 2024

Unit #: 112

License Plate #:

Odometer: 0

Unit Hours: 10325

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	GSB11105ATK		Replace Speedometer head unit	

Changed Winch Line:

☐

Slipped Line:

☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued:

☐

Work Completed By:

Bomer

Mechanic's Signature:

[Signature]

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order

Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Camduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Camduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jan 29, 2024		IOH			1 / 2

WO004583

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 469 HR	
Description 112 - BED TRUCK KW				ODOMETER 157098 KM	
Make		Model		Year 2006	
License IOH 112		Last Cert. ()		Engine MXS50975	
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. Axles - Driven, Rear		4.00 HR	130.0000	520.00	
REPLACE REAR INPUT YOKE USED AND SEAL - BONNER					
6-4-3021U	INPUT YOKE USED	1.00 EA	0.0000	0.00	
415389	INPUT SEAL CLARK BD91000	1.00 EA	23.1100	23.11	
Activity Sub-Total:				543.11	
2. Brakes		0.00 HR	0.0000	0.00	
REPLACE BRAKE POT LH AXLE #4					
REPLACE BRAKE POT RH AXLE #1					
SET UP ALL BRAKES					
SBT30	TYPE 30 SERVICE BRAKE POT	1.00 EA	29.1900	29.19	
179.SB3636S	3636 MAXI POT	1.00 EA	254.2200	254.22	
Activity Sub-Total:				283.41	
3. Hydraulic Systems		0.00 HR	0.0000	0.00	
REPLACE O RING ON FLAT FACE FITTING OFF PUMP					
920	O RING	1.00 EA	0.2500	0.25	
Activity Sub-Total:				0.25	

Technician: CARTER-HANSON
BONNER-BONNER

Authorized By:

M
E

INTEGRITY
Oilfield Hauling Ltd

**Repair Order
Customer Proof**

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Camduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Camduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jan 29, 2024		IOH			2 /2

Total Labor:	520.00
Total Parts:	306.77
Shop Supplies:	0.00
Sub Total:	826.77
GST:	41.34
PST:	0.00
Proof Total:	868.11

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date:	Jan 23
Unit #:	112 Bed
License Plate #:	112 Bed
Odometer:	157098
Unit Hours:	469
S/N:	

☒	Maintenance		PMP		SGI Safety
-------------------------------------	-------------	--	-----	--	------------

Qty.	Part #	Repairs Required	Work Done	Hours
1	415389	axle #4 input seal	replace input seal axle #4	
1	920 O-ring	Hyd oil leak off Pump	replace O-ring on flat face fitting off pump	
1	179-SB36365	Set all Brakes	replace Brake pot D/S axle #4	
1	SRT30		Replace Axle # P/S Brake Pot	
1	used Yolk			

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Carter Bower

Mechanic's Signature: Carter Hanson

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order

Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Camduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Camduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jan 23, 2024		IOH			1 / 1

WO004551

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 469 HR	
Description 112 - BED TRUCK KW				ODOMETER 157098 KM	
Make		Model		Year 2006	
License IOH 112		Last Cert. ()		Engine MXS50975	
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. Drive Shafts		4.00 HR	130.0000	520.00	
REPLACE DRIVE SHAFT FROM AUX TO AXLE #3 DIFF - CARTER, MIKE					
#66 DRIVE SHAFT					
HAD A WORN SLIP					
REPLACE U JOINTS					
5-281X	U JOINT	2.00 EA	83.9500	167.90	
Activity Sub-Total:				687.90	
2. GREASE AND CHECK LEVELS		0.00 HR	0.0000	0.00	
GREASED					
Activity Sub-Total:				0.00	

Technician: CARTER-HANSON
 MIKE DOTTEN-MIKE

Authorized By:

Total Labor: 520.00
Total Parts: 167.90
Shop Supplies: 0.00
Sub Total: 687.90
GST: 26.00
PST: 0.00
Proof Total: 713.90

M
E.

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Jan 23

Unit #: 112 Bed

License Plate #:

Odometer: 157098

Unit Hours: 469

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	Drive shaft #66	replace Drive shaft	replace Drive shaft from Aux to axle #3 Diff	
2	5-28/X		had a worn Slip	
		Grease	replace u-joints	
			Grease on tire truck	

Changed Winch Line:

Slipped Line:

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued:

Work Completed By:

Carter Mike

Mechanic's Signature:

Carter / Hansen

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order

Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jan 15, 2024		IOH			1 / 1

WO004505

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479	ENGINE 450 HR
Description 112 - BED TRUCK KW		ODOMETER 157001 KM
Make	Model	Year 2006
License IOH 112	Last Cert. ()	Engine MXS50975
Activity Description		
Part #	Part Description	Quantity Unit Charge Total
1. Winch		1.00 HR 130.0000 130.00
SLIP 10' WINCH LINE - BARRET, JUNIOR ✕		
NEW SLING		
LS 1-1/8-30N	1-1/8 X 30 LOADING SLING ✕	1.00 EA 213.1300 213.13
Activity Sub-Total:		343.13

Technician: JEROME-JEROME
BARETT-BARETT

Authorized By:

Total Labor: 130.00
Total Parts: 213.13
Shop Supplies: 0.00
Sub Total: 343.13
GST: 17.16
PST: 0.00
Proof Total: 360.29

M
P

SHOP WORK ORDER

[illegible]

Slipped Line:

Wheels Off: Trailer

Tires have been torqued:

Work Completed By: Brexit Senior

Mechanic's Signature:

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Dec 6, 2023		IOH			1 / 1

WO004364

INTEGRITY OILFIELD HAULING

Unit 112

VIN 1NKCLBTX26R986479

Description 112 - BED TRUCK KW

Make

Model

Year 2006

License IOH 112

Last Cert. ()

Engine MXS50975

Activity Description				
Part #	Part Description	Quantity	Unit Charge	Total
1. Drive Shafts		2.00 HR	130.0000	260.00
REPLACE DRIVE SHAFT - CARTER, MIKE, KILEY				
GREASE DRIVE SHAFT				
5-281X	U JOINT	2.00 EA	83.9500	167.90
GCB210875-1X	HANGER BEARING	2.00 EA	58.7800	117.56
6.5-4-2531X	STEADY BEARING YOKE	1.00 EA	187.5500	187.55
			Activity Sub-Total:	733.01

Technician: CARTER-HANSON

Authorized By:

KILEY-KILEY

MIKE DOTTEN-MIKE

Total Labor: 260.00

Total Parts: 473.01

Shop Supplies: 0.00

Sub Total: 733.01

GST: 28.26

PST: 0.00

Proof Total: 761.27

ME

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Dec 6th

Unit #: 112 Bed

License Plate #: 10H 112B

Odometer:

Unit Hours:

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	6.5-4-2531X	twisted drive line	replace Drive Shaft	2
2	GCB2108751X		Grease drive line	
3	5-281X			

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Carter Mike Kylie

Mechanic's Signature: Carter Hansen

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Nov 2, 2023		IOH			1 / 2

WO004197

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 403 HR	
Description 112 - BED TRUCK KW				ODOMETER 155870 KM	
Make		Model		Year 2006	
License IOH 112		Last Cert. ()		Engine MXS50975	
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. Engine / Motor Systems Group		8.00 HR	130.0000	1040.00	
INLAND INV 25136ESP					
LOW OIL/HIGH WATER LIGHT SHORTING OUT					
REPLACE OIL PRESURE SENSOR - BONNER					
274-6719	SENSOR PRESSURE	1.00 EA	348.2100	348.21	
Activity Sub-Total:				1388.21	
2. GREASE AND CHECK LEVELS		0.00 HR	0.0000	0.00	
GREASE AND CHECK ALL FLUIDS - BONNER, TRISTAN, DANIEL					
FUEL TANKS NOT EQUALIZING, OPEN VALVE FOR CROSS OVER					
AIR UP ALL TIRES					
TIRE CHAINS RH					
Activity Sub-Total:				0.00	
3. Axles - Driven, Rear		0.00 HR	0.0000	0.00	
OIL LEAK BACK DIFF					
PULL AXLE #4 DIFF AND RESEAL					
Activity Sub-Total:				0.00	

Technician: TRISTAN-TRISTAN
DANIEL ARMST-DANIEL
BONNER-BONNER

Authorized By:

m.
E -

**Repair Order
Customer Proof**

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Camduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Camduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Nov 2, 2023		IOH			2 / 2

Total Labor:	1,040.00
Total Parts:	348.21
Shop Supplies:	0.00
Sub Total:	1,388.21
GST:	69.41
PST:	0.00
Proof Total:	1,457.62

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Nov 2 2023

Unit #: 112

License Plate #: IOH 112

Odometer: 155870

Unit Hours: 403

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	274-6219	Low oil / high water	Replace Oil Pressure Sensor	
		light Shorting out	Grease	
			check All Fluids	
		Fuel tanks not Equalizing	open valve for Cross over	
			Air up All Tires	8
		Oil leak Back diff	Pull Axle #4 diff and Reseal	
		Tire Chains P/S		

Changed Winch Line: ☐

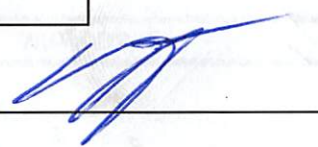
Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Bonner Trusten Daniel

Mechanic's Signature: 

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Oct 3, 2023		IOH			1 / 1

WO004039

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479	ENGINE 345 HR
Description 112 - BED TRUCK KW		ODOMETER 154299 KM
Make	Model	Year 2006
License IOH 112	Last Cert. ()	Engine MXS50975

Activity Description				
Part #	Part Description	Quantity	Unit Charge	Total
1. Cooling System		10.00 HR	130.0000	1300.00
WEST END RAD				
CUSTOM CORE ON RAD - KEVINE				
REPLACE COOLANT LEVEL SENSOR				
56048	3" RAD HOSE	24.00 EA	5.5700	133.68
S291203	SENSOR-COOLANT LEVE	1.00 EA	299.9600	299.96
619RA5859-RC	RAD C500 WIDE HOOD	1.00 EA	3188.1400	3188.14
Activity Sub-Total:				4921.78

Technician: KIRBY-KEVIN

Authorized By:

Total Labor:	1,300.00
Total Parts:	3,621.78
Shop Supplies:	0.00
Sub Total:	4,921.78
GST:	246.09
PST:	0.00
Proof Total:	5,167.87

m.
E.

Oilfield Hauling Ltd

Date: Oct 3/23

License Plate #:

Unit Hours: 345

S/N:

Maintenance

PMP

SGI Safety

Kevin	10th
-------	------

Changed Winch Line:

Slipped Line:

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued:

Work Completed By:

Mechanic's Signature: _____

[illegible]

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Carnduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Carnduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Sep 11, 2023		IOH			1 / 2

WO003986

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479	ENGINE 338 HR
Description 112 - BED TRUCK KW		ODOMETER 154085 KM
Make	Model	Year 2006
License IOH 112	Last Cert. ()	Engine MXS50975

Activity Description					
Part #	Part Description	Quantity	Unit Charge		Total
1. PM A Service		3.00 HR	130.0000		390.00
CHANGE OIL AND FILTER - DEMI					
CHANGE FUEL FILTERS					
CHANGE AIR FILTERS					
338 HOURS ON SAMPLE					
320271103	OIL SAMPLE KIT	1.00 EA	23.8000		23.80
500010131D	15W40 ROTELLA T3 BULK	38.00 EA	4.7500		180.50
AF25247	AIR FILTER	2.00 EA	60.9000		121.80
3406	FUEL FILTER CAT FS1000	1.00 EA	28.8800		28.88
FF5319	FUEL FILTER	1.00 EA	11.4800		11.48
LF691A	OIL FILTER CAT	1.00 EA	15.1300		15.13
Activity Sub-Total:					771.59
2. GREASE AND CHECK LEVELS		0.00 HR	0.0000		0.00
GREASE AND CHECK LEVELS					
DRAINED AND REFILLED REAR DIFF					
REPLACE LH REAR MUDFLAP					
75W90 CHEVRON SYN	75W90 CHEVRON SYN GEAR OIL	20.00 EA	13.6800		273.60
Activity Sub-Total:					273.60

Technician: DEMI-DEMI

Authorized By:

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Sep 11, 2023		IOH			2 / 2

Total Labor:	390.00
Total Parts:	655.19
Shop Supplies:	0.00
Sub Total:	1,045.19
GST:	52.26
PST:	0.00
Proof Total:	1,097.45

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Sept 11, 2023

Unit #: 112B

License Plate #: 10H 112B

Odometer: 154085

Unit Hours: 338.5

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
			Replaced LH rear mudflap	
1	LE691A	Full service	greased	
1	ES 34DL			
1	FF 5319		deaired/refilled rear diff	
2	AF25247			
38L	15-40			
1 pair	75-90			

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Demi

Mechanic's Signature: _____

[illegible]

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Carnduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Carnduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Sep 6, 2023		IOH			1 / 1

WO003936

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479	ODOMETER 153656 KM
Description 112 - BED TRUCK KW		
Make	Model	Year 2006
License IOH 112	Last Cert. ()	Engine MXS50975
Activity Description		
Part #	Part Description	Quantity Unit Charge Total
1. Tires, Tubes, Liners & Valves		2.00 HR 130.0000 260.00
FIX FLAT RH FRONT - TRISTAN, BONNER AIR UP ALL TIRES TORQUE TO 550 100 PSI		
Activity Sub-Total:		260.00

Technician: TRISTAN-TRISTAN
 BONNER-BONNER

Authorized By:

Total Labor:	260.00
Total Parts:	0.00
Shop Supplies:	0.00
Sub Total:	260.00
GST:	13.00
PST:	0.00
Proof Total:	273.00

m.

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Sept 10. 2023

Unit #: 112

License Plate #: LOH 112B

Odometer: 153656

Unit Hours: 10328.7

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	25" Michelin O-Ring	Rx Flat	Air up All Tires 1 Repair	

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

	X		

Wheels Off: Trailer

Tires have been torqued: ☒

550
100psi

Work Completed By:

Tristan Bonnet

Mechanic's Signature: _____

[illegible]

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Camduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Camduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Aug 1, 2023		IOH			1 / 1

WO003785

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 321 HR	
Description 112 - BED TRUCK KW				ODOMETER 153655 KM	
Make		Model		Year 2006	
License IOH 112		Last Cert. ()		Engine MXS50975	
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. Cooling System		1.00 HR	130.0000	130.00	
REPLACE COOLANT LEVEL HARNESS - DANIEL					
K068-5794-0500	HARNESS-COOLANT LEVEL	1.00 EA	137.1500	137.15	
Activity Sub-Total:				267.15	

Technician: BONNER-BONNER

Authorized By:

Total Labor:	130.00
Total Parts:	137.15
Shop Supplies:	0.00
Sub Total:	267.15
GST:	13.36
PST:	0.00
Proof Total:	280.51

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Aug 1 2023

Unit #: 112

License Plate #:

Odometer: 153 655

Unit Hours: 321

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
			Replace coolant level	
			Sensor harness	1

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By:

Borne daniel

Mechanic's Signature:



[illegible]

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Camduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Camduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 7, 2023		IOH			1 / 1

WO003613

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 236 HR	
Description 112 - BED TRUCK KW				ODOMETER 152085 KM	
Make	Model	Year 2006			
License IOH 112	Last Cert. ()	Engine MXS50975			
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
1. Engine / Motor Systems Group		8.00 HR	130.0000	1040.00	
REPLACE WATER PUMP 1 DAY AFTER NEW WATER PUMP FAILED - MICHEAL					
RW1017X	WATER PUMP 10R-8660	1.00 EA	570.7900	570.79	
Activity Sub-Total:				1610.79	

Technician: MICHEAL-MICHEAL

Authorized By:

Total Labor: 1,040.00
Total Parts: 570.79
Shop Supplies: 0.00
Sub Total: 1,610.79
GST: 80.54
PST: 0.00
Proof Total: 1,691.33

05

ME

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 6, 2023		IOH			1 / 4

WO003455

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479	ODOMETER 152064 KM
Description 112 - BED TRUCK KW		ENGINE 235 HR
Make	Model	Year 2006
License IOH 112	Last Cert. ()	Engine MXS50975

Activity Description

Part #	Part Description	Quantity	Unit Charge	Total
1. Engine / Motor Systems Group		10.00 HR	130.0000	1300.00
INLAND INV 21910ESP WESTRANS INV REPLACE WATER PUMP ON LOCATION - LANE, DEMI REPLACE WATER PUMP NEXT DAY SEND ONE BACK FOR CORE AND WARRANY REPLACE COOLANT HOSES				
RW1017X	WATER PUMP 10R-8660	1.00 EA	570.7900	570.79
247-0266	HOSE TO COOLANT DIVERter VALVE	1.00 EA	84.7400	84.74
247-0055	COOLANT HOSE TO DIVERter	1.00 EA	107.7400	107.74
Activity Sub-Total:				2063.27
2. SGI SAFETY		1.50 HR	130.0000	195.00
SGI 1 YEAR - BONNER AXLE #3 RH BRAKE WORE OUT AXLE #3 RH BRAKE SEIZED CROSS MEMBER BRACKET BROKEN REAR LH LOWER ANCHOR PIN ON BRAKES SEIZED NO WINDSHIELD WASHER, WIPERS DONT MOVE INSTRUMENT LAMPS DONT WORK MIRROR LIGHT LH SGI SAFETY STICKER SGI SAFETY STICKER				
		1.00 EA	0.0000	0.00
Activity Sub-Total:				195.00
3. Brakes		0.00 HR	0.0000	0.00
AXLE #3 RH BRAKE WORE OUT AXLE #3 RH BRAKE SEIZED ANCHOR PIN ON BRAKES SEIZED				
Activity Sub-Total:				0.00
4. Lighting System		0.00 HR	0.0000	0.00
INSTRUMENT LAMPS DONT WORK MIRROR LIGHT LH				
Activity Sub-Total:				0.00

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 6, 2023		IOH			2 / 4
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
5. Trim & Miscellaneous Hardware		0.00	HR	0.0000	0.00
CROSS MEMBER BRACKET BROKEN REAR LH LOWER NO WINDSHIELD WASHER, WIPERS DONT MOVE					
				Activity Sub-Total:	0.00
6. Winch		2.00	HR	130.0000	260.00
NEW WINCH LINE ✓					
WGB7-3000-N	1-1/4 6X36 WINCH LINE	160.00	EA	4.8000	768.00
				Activity Sub-Total:	1028.00
7. GREASE AND CHECK LEVELS		0.00	HR	0.0000	0.00
GREASE AND CHECK LEVELS GREASE BRAKES AND DRIVE LINE SET BRAKES					
				Activity Sub-Total:	0.00

Proof To:

INTEGRITY OILFIELD HAULING
 #5 Hwy 18 East
 Camduff SK S0C 0S0
 Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
 Camduff, SK S0C 0S0
 Tel: 3064823386
 Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 6, 2023		IOH			3 /4
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
8. Clutch		0.00 HR	0.0000	0.00	
	REPLACE CLUTCH				
	REPLACE CLUTCH BRAKE				
	REPLACE REAR ENGINE SEAL				
	REPLACE TRANNY COOLER				
SB200	2" CLUCH BRAKE	1.00 EA	36.9500	36.95	
308925-25	CLUTCH	1.00 EA	989.9900	989.99	
81504	BALL BEARING INPUT SHAFT	1.00 EA	57.6200	57.62	
K3288	GSK KIT RTLO18918B	2.00 EA	55.4200	110.84	
1425868CAT	REAR CRANK SHAFT SEAL	1.00 EA	44.5200	44.52	
18025FUL	OIL COOLER	1.00 EA	299.7000	299.70	
S1659	INPUT SHAFT RTLO18918B	1.00 EA	142.0700	142.07	
20550	BRG FRONT COVER RTLO18918B	1.00 EA	36.9600	36.96	
6306LLU	PILOT BEARING CLUTCH	1.00 EA	13.9800	13.98	
5-281X	U JOINT	3.00 EA	83.9500	251.85	
4308226	GASKET,CLUTCH HOUSING	1.00 EA	26.8800	26.88	
16861	GSK FRONT BEARING COVER	1.00 EA	2.2500	2.25	
Activity Sub-Total:				2013.61	

Technician: JEROME-JEROME
 MICHEAL-MICHEAL
 CHANCE BAYLI-CHANCE
 BONNER-BONNER
 DEMI-DEMI

Authorized By:

Total Labor: 1,755.00
Total Parts: 3,544.88
Shop Supplies: 0.00
 SGI STICKER: 15.75
Sub Total: 5,315.63
 GST: 252.40
 PST: 0.00
Proof Total: 5,568.03

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Carnduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Carnduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Jun 6, 2023		IOH			4 /4

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date:	June 13 2023	
Unit #:	112B	
License Plate #:	10H112B	
Odometer:		
Unit Hours:		
S/N:		
Maintenance	PMP	SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	SB 200			
1	81504		Agree 25' drive line ✓	
1	K52101			
1	M-1425-668			
3	5 281X			
1	308925-25			
2	K-3288			
1	18025FUL			

Changed Winch Line:

☐

Slipped Line:

☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued:

☐

Work Completed By:

Mechanic's Signature:

[illegible]

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date:	June 6, 2023	
Unit #:	IOH 112	
License Plate #:	IOH 112	
Odometer:	152064 km	
Unit Hours:	23.5 hr	
S/N:		
Maintenance	PMP	SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1		New winch line	✓	
			Check fluid levels	
			Grease brakes and drive shaft	
			Sp1 brakes	

Changed Winch Line: ☒

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Chance Boylston
Jeram-6161

Mechanic's Signature: _____

[illegible]

This Certificate is issued under the authority of the Province of Saskatchewan

VOID WITHOUT
DECAL



Vehicle Standards and Inspection

Date Inspection Started 06 06 2023 day month year		INSPECTING STATION Station Number Signing Officer Number Technician Number Station Name Signing Officer Signature Technician Signature 		
Date Inspection Completed day month year		PMP STATION DECAL ISSUED TO: PMP Station # PMP Technician # Station Name City 		
Inspection Expiry Date day month year		PMP MAINTENANCE USE ONLY (Non Inspecting Stations)		
Truck (12 months) ☒ Power Unit (6 months) ☐ Bus ☐ PMP Power Unit (12 months) ☐ Motorcoach ☐ Brake Type Air ☐ Hydraulic ☐ Vehicle Owner: 				
Pass ☐ Fail ☐ Out-of-Service Condition ☐ FTR ☐ TLV ☐ PMVI ☐		Address Licence Number Odometer Reading City Prov Make 		
		Postal Code Phone 		

Circle Items Requiring Attention
R = Item Rejected C = Item Corrected

No.	R	C	DRIVER'S COMPARTMENT	Ref #
01			Vehicle Identification Number	5 ✓
02			Sun Visor Interior	8 ✓
03			Horn Operation	5 ✓
04			Mirrors	8 ✓
05	✓	✓	Windshield Wipers/Washers	8 ✓
06			Windshield Defroster/Heater	8 ✓
07			Windshield/Other Glass	8 ✓
08			Gear Position Indicator	1 ✓
09	✓	✓	Instrument Lamps	6 ✓
10			Accessibility Features/Equip	5 ✓
11			Auxiliary Heaters	5 ✓
12			Auxiliary Drive Controls	5 ✓
13			Emergency Exits	8 ✓
14			Floor/Step Well Covering	8 ✓
15			Service/Exit Doors	8 ✓
16			Indicator Lamps	5 ✓
17			Instruments/Gauges	5 ✓
18			Switches	7 ✓
19			Brake Pedal/Actuator	3 ✓
20			Clutch/Clutch Pedal	1 ✓
21			Fire Extinguisher/Hazard Kit	5 ✓
22			Seats/Seat Belts/SRS	8 ✓
23			Steering Column/Components	4 ✓

No.	R	C	BODY EXTERIOR	Ref #
24			Auxiliary Controls/Equip	5 ✓
25			Speedometer/Odometer	5 ✓
26			Steering Lash/Travel	5 ✓
27			Accelerator Pedal/Actuator	1 ✓
28			Engine Shut Down Control	1 ✓
29			Engine Start Interlock	1 ✓
30			Body Interior/Fixtures	8 ✓
31	✓	✓	Lamps	6 ✓
32			Headlamp Aim	6 ✓
33			Reflex Reflectors	6 ✓
34			Retro Reflective Markings	6 ✓
35			Body/Bumpers	8 ✓
36			Trailer Hitch	10 ✓
37			Cab Grab Handles/Steps	8 ✓
38			Attached Equipment	8 ✓
39			Cargo Bodies/Vessels	8 ✓
40			Sun Visor Exterior	8 ✓
41			Mud Flaps /Fenders	8 ✓
42			Trailer Power Cord	7 ✓
43			Chain/Headache Rack	5 ✓
44			Auxiliary Compartments	8 ✓
45			Hybrid Vehicle Drive Systems	1 ✓

No.	R	C	ENGINE COMPARTMENT	Ref #
46			Cab/Hood Safety Catches	8 ✓
47			Power Steering System	4 ✓
48			Fuel System	1 ✓
49			Battery/Wiring Condition	7 ✓
50			Air Suspended Cab	8 ✓
51			Cab Mounts	8 ✓
52			Drive Belts	✓
No.	R	C	CHASSIS	Ref #
53			Hyd Brake System/Components	3.1 ✓
54	✓	✓	Air Brake System/Components	3.2 ✓
55			Wheel Bearings	9 ✓
56			King Pins/Ball Joints	4 ✓
57			Steering Linkage	4 ✓
58			Tires/Wheels	9 ✓
59			Self-Steering Axle	4 ✓
60			Engine/Transmission Mounts	1 ✓
61	✓	✓	Frame/Crossmembers/Mounts	8 ✓
62			Suspension/Axles	2 ✓
63			Drive Shaft/Universal Joints	1 ✓
64			Exhaust/Emission System	1 ✓

An "X" placed in the box(es) below indicates a full brake inspection was performed with wheel(s) removed.

An "X" placed in the box(es) below indicates a full brake inspection was performed with wheel(s) removed.

[illegible]

Record final accepted measurements in all areas above.

Remarks:

Vehicle received without repairs by:

Signature _____ This inspection is not an authorization for repairs.
Permission from the owner must be obtained.

Axle H4 P/S Brakes worked ✓
Axle H3 P/S Brakes Seized ✓
C/S member Bracket Broken Rear O/S Lower
Another pin on Brakes seized
No wind shield washer, wipers don't move ✓
Instrument lamps don't work ✓
When light d/s

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Camduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Camduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Feb 15, 2023		IOH			1 / 1

WO003047

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ODOMETER 152064 KM		
Description 112 - BED TRUCK KW						
Make		Model		Year 2006		
License IOH 112		Last Cert. ()		Engine MXS50975		
Activity Description						
Part #	Part Description			Quantity	Unit Charge	Total
1. Tires, Tubes, Liners & Valves				4.00 HR	130.0000	520.00
REPLACE ALL STEER TIRES - TRISTAN						
AIR UP ALL TIRES						
TORQUE TO 550						
15" MICH O RING	25" MICH O RING			4.00 EA	22.0000	88.00
17.5-25 BOLO STEER	17.5-25 BOLO STEER			4.00 EA	900.0000	3600.00
Activity Sub-Total:						4208.00

Technician: TRISTAN-TRISTAN

Authorized By:

Total Labor:	520.00
Total Parts:	3,688.00
Shop Supplies:	0.00
Sub Total:	4,208.00
GST:	210.40
PST:	0.00
Proof Total:	4,418.40

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Feb 15/23

Unit #: 112B

License Plate #: JCH112B

Odometer: 152064

Unit Hours: 10325

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
4	1750-25	Replace all 4	New steers	4
	Bolt steer	steer trees		
	trees	Air up all		
4	25" @ - Rings	Tires		

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

	X		
X			
X			
	X		

Wheels Off: Trailer

Tires have been torqued: ☒

Work Completed By: Mr. Stan

Mechanic's Signature: _____

[illegible]

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Camduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Camduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Feb 22, 2023		IOH			1 / 2

WO003066

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479
Description 112 - BED TRUCK KW	
Make	Model
Year 2006	
License IOH 112	Last Cert. ()
Engine MXS50975	

Activity Description		Quantity	Unit Charge	Total
Part #	Part Description			
1. SGI SAFETY		1.50 HR	130.0000	195.00
	SGI 1 YEAR - BONNER, CARTER, SULLY			
	UNSEIZE AXLE #4 RH BRAKES			
	REPLACE AXLE #3 RH BRAKE SHOES AND HARDWARE			
	REPLACE CRACKED CROSS MEMBER BRACKET			
	FIX LOOSE WIRE FOR INSTRUMENT LIGHTS			
	FIX WIPER/WASHER STICKY HANDLE			
	FIX WIRE FOR LH MIRROR			
	SGI SAFETY STICKER SGI SAFETY STICKER	1.00 EA	0.0000	0.00
	Activity Sub-Total:			195.00
2. Brakes		12.00 HR	130.0000	1560.00
	UNSEIZE AXLE #4 RH BRAKES			
	REPLACE AXLE #3 RH BRAKE SHOES AND HARDWARE			
124310	CLARK SPEEDY SLEEVE	3.00 EA	27.1000	81.30
124429	CLARK HUB SEAL	3.00 EA	64.1300	192.39
4630	SHOE LINER	0.50 EA	312.5000	156.25
126246	BRAKE CAM ROLLER	1.00 EA	14.6200	14.62
126247	BRAKE CAM ROLLER PIN	1.00 EA	11.2500	11.25
126248	BRAKE SHOE BUSHING	1.00 EA	10.1100	10.11
112213G	ANCHOR PIN GREASEABLE	1.00 EA	44.0200	44.02
109597	ANCHOR PIN SET SCREW	1.00 EA	9.7700	9.77
112216	SPRING ANCHOR PIN	1.00 EA	11.1800	11.18
119650	RETURN SPRING	1.00 EA	14.2600	14.26
	Activity Sub-Total:			2105.15
3. Trim & Miscellaneous Hardware		0.00 HR	0.0000	0.00
	REPLACE CRACKED CROSS MEMBER BRACKET			
	FIX LOOSE WIRE FOR INSTRUMENT LIGHTS			
	FIX WIPER/WASHER STICKY HANDLE			
	FIX WIRE FOR LH MIRROR			
	Activity Sub-Total:			0.00
4. Trim & Miscellaneous Hardware		0.00 HR	0.0000	0.00

INTEGRITY

Oilfield Hauling Ltd

Repair Order Customer Proof

Proof To:

INTEGRITY OILFIELD HAULING

#5 Hwy 18 East

Carnduff SK S0C 0S0

Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East

Carnduff, SK S0C 0S0

Tel: 3064823386

Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Feb 22, 2023		IOH			2 / 2
Activity Description					
Part #	Part Description	Quantity	Unit Charge	Total	
FAST INV 84486					
MACHINIST TO MAKE 4 BUSHINGS					
LAB	LABOUR	1.00 EA	160.0000	160.00	
				Activity Sub-Total:	160.00

Technician: SULLY-SULLY
CARTER-HANSON
BONNER-BONNER

Authorized By:

705.15
15.75

720.90

Total Labor: 1,755.00
Total Parts: 705.15
Shop Supplies: 0.00
SGI STICKER: 15.75
Sub Total: 2,475.90
GST: 123.01
PST: 0.00
Proof Total: 2,598.91

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Feb 28 2023

Unit #: 112

License Plate #:

Odometer:

Unit Hours:

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
3	124310	Safety	UNseize Axle #4 P/S Brakes	
3	124429		Replace Axle #3 P/S Brake shoes and hard ware	
1	Used Cross member Bracket		Replace Cracked Cross member Bracket	12
1	Set Shoes	For 91 Clarks		
1	Set hardware		Fix loose wire for Instrument lights	
	4630		Fix wiper/washer (Sticky handle)	
	126 246		Fix wire for DIS mirror	
	126 247			
	126 248			

1122136

Changed Winch Line:

Slipped Line:

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued:

Work Completed By:

Sally Barner, Carter

Mechanic's Signature:

[Signature]

[illegible]

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Mar 8, 2022		IOH			1 / 1

RO WO001692

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		ENGINE 211 HR	
Description 112 - BED TRUCK KW				ODOMETER 151775 KM	
Make		Model		Year 2006	
License IOH 112		Last Cert. ()		Engine MXS50975	
Activity Description					
Part No.	Part Description	Quantity	Unit Charge	Total	
1. GREASE AND CHECK LEVELS		3.00 HR	100.0000	300.00	
GREASE AND CHECK LEVELS - BRIAN , MICHEAL REPLACE AIR DRYER CART SET CLUTCH					
AC1001	AIR DRYER CART	1.00 EA	38.7400	38.74	
Activity Sub-total:				338.74	
2. Winch		0.00 HR	0.0000	0.00	
SLIP 1' WINCH LINE					
Activity Sub-total:				0.00	

Technician: MICHEAL-MICHEAL
BRIAN-BRIAN

Authorized By:

Total Labor: 300.00
Total Parts: 38.74
Shop Supplies: 0.00
SubTotal: 338.74
GST: 16.94
PST: 0.00
Proof Total: 355.68

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: MAR 8 / 22

Unit #: 20H 112

License Plate #:

Odometer: 151775

Unit Hours: 211

S/N:

Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
		- GREASE JOB	GREASE TRUCK	
		- CHECK FLUIDS	CHECK FLUIDS	
		- SLIP LINE	SLIP W 1 FOOT WINCH LINE MAN	
1	AC1001 FILTER	- REPLACE AIR DRYER	REPLACE AIR DRYER	
	ARY DRYER	CARTRAGE	CARTRAGE	3
			SET CLUTCH	

Changed Winch Line: ☐

Slipped Line: ☒ 1 FOOT

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By: Brian MICHEAL

Mechanic's Signature: [Signature]

[illegible]

REPAIR ORDER CUSTOMER PROOF

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Feb 28, 2022		IOH			1 / 1

RO WO001663

INTEGRITY OILFIELD HAULING

Unit 112		VIN 1NKCLBTX26R986479		
Description 112 - BED TRUCK KW				
Make		Model		Year 2006
License IOH 112		Last Cert. ()		Engine MXS50975
Activity Description				
Part No.	Part Description	Quantity	Unit Charge	Total
1. Hydraulic Systems		0.00 HR	0.0000	0.00
TK INV 7881				
MAKE HOSES				
1/2 HYD HOSE	1/2 HYD HOSE	7.00 EA	5.6600	39.62
A-FJX-08-08	HYD FITTING	2.00 EA	14.1000	28.20
A-FJX-08-10-W	HYD FITTING	2.00 EA	15.9600	31.92
1/4 HYD HOSE	1/4 HYD HOSE	1.00 EA	2.9100	2.91
A-FJX-04-04	HYD FITTING	1.00 EA	9.6000	9.60
A-FJX90-04-04-W	HYD FITTING	1.00 EA	19.3400	19.34
1 HYD HOSE	1 HYD HOSE	2.00 EA	8.6400	17.28
A-FJX-16-16W	FEMALE JIC 37	2.00 EA	47.5200	95.04
Activity Sub-total:				243.91

Technician:

Authorized By:

Total Labor:	0.00
Total Parts:	243.91
Shop Supplies:	0.00
SubTotal:	243.91
GST:	12.20
PST:	0.00
Proof Total:	256.11

REPAIR ORDER CUSTOMER PROOF

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Feb 25, 2022		IOH			1 / 1

RO WO001631

INTEGRITY OILFIELD HAULING

Unit 112

VIN 1NKCLBTX26R986479

Description 112 - BED TRUCK KW

Make

Model

Year 2006

License IOH 112

Last Cert. ()

Engine MXS50975

Activity Description

Part No.	Part Description	Quantity	Unit Charge	Total
1. Winch		2.00 HR	100.0000	200.00
LENNOX INV 32657				
REPLACE WINCH BRAKE AND SPRAG - BONNER				
4387	SPRAG RN130, 100, 80	1.00 EA	1987.7600	1987.76
32765-RN	FRICTION DISC RUFNEK	6.00 EA	19.8500	119.10
42148	STATOR PLATE RUFNEK	7.00 EA	8.2500	57.75
42230	Brake Spring RN130	12.00 EA	4.9500	59.40
LEN1246	Tulsa RN Brake Piston O-Ring Kit	1.00 EA	38.9700	38.97
Activity Sub-total:				2462.98

Technician: BONNER-BONNER

Authorized By:

Total Labor: 200.00
Total Parts: 2,262.98
Shop Supplies: 0.00
SubTotal: 2,462.98
GST: 123.15
PST: 0.00
Proof Total: 2,586.13

REPAIR ORDER CUSTOMER PROOF

Proof To:

INTEGRITY OILFIELD HAULING
#5 Hwy 18 East
Carnduff SK S0C 0S0
Phone: 3064823386

Integrity Oilfield Hauling

#5 Hwy 18 East
Carnduff, SK S0C 0S0
Tel: 3064823386
Tel: 3064823030

Date	Vendor Code	A/C	Customer PO	Payment Term	Page
Feb 18, 2022		IOH			1 / 1

RO WO001602

INTEGRITY OILFIELD HAULING

Unit 112	VIN 1NKCLBTX26R986479	ODOMETER 149635 KM
Description 112 - BED TRUCK KW		
Make	Model	Year 2006
License IOH 112	Last Cert. ()	Engine MXS50975
Activity Description		
Part No.	Part Description	Quantity Unit Charge Total
1. Engine / Motor Systems Group		4.00 HR 100.0000 400.00
RESEAL COMPRESOR , P/S PUMP, AND ADAPTER - BONNER REPLACE ALL LINES GOING TO P/S PUMP		
2233505CAT	COMPRESSOR O RING RIBBED	1.00 EA 10.5400 10.54
1075769CAT	SEAL O RING	1.00 EA 4.2700 4.27
4988280	GSK	1.00 EA 4.9000 4.90
Activity Sub-total:		419.71

Technician: LANE -LANE
BONNER-BONNER

Authorized By:

Total Labor:	400.00
Total Parts:	19.71
Shop Supplies:	0.00
SubTotal:	419.71
GST:	20.99
PST:	0.00
Proof Total:	440.70

INTEGRITY

Oilfield Hauling Ltd

SHOP WORK ORDER

Date: Feb 18 2022

Unit #: 112

License Plate #:

Odometer: 149635

Unit Hours: 10325

S/N:



Maintenance

PMP

SGI Safety

Qty.	Part #	Repairs Required	Work Done	Hours
1	Compressor O-Ring	Oil leak	- Reseal Compressor, Power steering Pump and Adapter	4
1	Power Steering O-Ring			
1	Adapter o-ring		- Replace all lines going to Power Steering Pump	

Changed Winch Line: ☐

Slipped Line: ☐

Wheels Off: Truck

Wheels Off: Trailer

Tires have been torqued: ☐

Work Completed By:

Banner Lane

Mechanic's Signature:

[Signature]

[illegible]