

D32-2
Nov



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 072624-238

Date: 07/26/2024

Performed B Service.

Replaced engine oil filters
Replaced fuel filters
Replaced Air Filter
Replaced Cabin Filter.
Replaced Engine Oil
Topped up all fluids
Greased all grease points

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.		DATE: 07/26/2024	
LOCATION: GP Shop		WORK ORDER # 072624-238	
UNIT # 238	HOURS 8378	ODOMETER 73451	
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS			
REPAIR CODES: X= OK R= REPAIR REQUIRED C = REPAIR COMPLETED			
	A	B	
Body, doors, bumpers, fenders, mud flaps	☒	☒	Driveshaft u-joints, hanger brackets, guards
Sun visor, latches, door releases, seats	☒	☒	Breathers diffs, transmission, hydraulic, hubs
Heating and defrosting	☒	☒	Transmission fluid level, condition (auto at idle)
Neutral starting shift switch (if equipped)	☒	☒	Differential fluid level, condition
Windshield, windows, mirrors	☒	☒	Hydraulic fluid level, condition
Lamps, lights, reflectors	☒	☒	Hydraulic hoses (rubs, bulges, condition, leaks)
Horn, windshield wipers and washers	☒	☒	Suspension (springs, air bags, bushings, shocks)
Engine controls, instrumentation, switch's	☒	☒	Torque arms (bolts, bushings, mounts)
Change engine oil, filters #	☒	☒	Brake friction, mechanical components
change fuel filters #	☒	☒	Parking, emergency, service brake operation
Inspect air filter (change if needed) #	☒	☒	5th wheel operation, condition, lubrication (jaws)
Coolant level, strength	☒	☒	Pintle hitch operation, cracks
Air intake piping	☒	☒	Electrical cables (tears, bulges, corroded, pinched)
Clamps on turbo and mounting	☒	☒	
All belts, pulleys idler bearings	☒	☒	
All rad and heater hoses (rubs, bulges)	☒	☒	
Exhaust system for leaks, mounting	☒	☒	
Fuel tanks, filler caps, and lines	☒	☒	
Engine , rad, transmission mounts	☒	☒	
Check for leaks while running	☒	☒	
Power steering hose and fluid condition	☒	☒	
Steering box, column u-joints	☒	☒	
Wheel alignment, steering linkage	☒	☒	
Fan hub condition, operation	☒	☒	
Emergency kill, rig saver	☒	☒	
Auxiliary heater engine, bunk	☒	☒	
Rims, tires (wear, cuts, tread depth)	☒	☒	
Tire pressure	☒	☒	
Wheel nutz, studs (condition and torque)	☒	☒	
Front wheel hubs (fluid, breathers)	☒	☒	
Wheel seals	☒	☒	
Batteries (condition)	☒	☒	
Chassis frame, underbody (cracks)	☒	☒	
PTO (leaks, operating noise)	☒	☒	
Auxiliary equipment mounts	☒	☒	
Grease complete unit	☒	☒	
Air brake system	☒	☒	
Operation of slack adjusters	☒	☒	

Notes:	
INSPECTED BY (print): Chris Harding	
INSPECTED BY (sign):	



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 061524-238

Date: 06/15/2024

Performed A Service.

Greased all grease points.
Topped up fluids

See attached inspection form.

INSPECTED BY (sign):



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 021924-238

Date: 02/19/2024

Performed B Service.

Replaced engine oil filters
Replaced fuel filters
Replaced Air Filter
Replaced Cabin Filter.
Replaced Engine Oil
Topped up all fluids
Greased all grease points

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.		DATE: 02/19/2024			
LOCATION: GP Shop		WORK ORDER # 021924-238			
UNIT # 238	HOURS 7454	ODOMETER 42854			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R= REPAIR REQUIRED C= REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps		X	Driveshaft u-joints, hanger brackets, guards		X
Sun visor, latches, door releases, seats		X	Breathers diffs, transmission, hydraulic, hubs		X
Heating and defrosting		X	Transmission fluid level, condition (auto at idle)		X
Neutral starting shift switch (if equipped)		X	Differential fluid level, condition		X
Windshield, windows, mirrors		X	Hydraulic fluid level, condition		X
Lamps, lights, reflectors		X	Hydraulic hoses (rubs, bulges, condition, leaks)		X
Horn, windshield wipers and washers		X	Suspension (springs, air bags, bushings, shocks)		X
Engine controls, instrumentation, switch's		X	Torque arms (bolts, bushings, mounts)		X
Change engine oil, filters #		X	Brake friction, mechanical components		X
change fuel filters #		X	Parking, emergency, service brake operation		X
Inspect air filter (change if needed) #		X	5th wheel operation, condition, lubrication (jaws)		X
Coolant level, strength		X	Pintle hitch operation, cracks		N/A
Air intake piping		X	Electrical cables (tears, bulges, corroded, pinched)		X
Clamps on turbo and mounting		X			
All belts, pulleys idler bearings		X			
All rad and heater hoses (rubs, bulges)		X			
Exhaust system for leaks, mounting		X			
Fuel tanks, filler caps, and lines		X			
Engine , rad, transmission mounts		X			
Check for leaks while running		X			
Power steering hose and fluid condition		X			
Steering box, column u-joints		X			
Wheel alignment, steering linkage		X			
Fan hub condition, operation		X			
Emergency kill, rig saver		X			
Auxiliary heater engine, bunk		X			
Rims, tires (wear, cuts, tread depth)		X			
Tire pressure		X			
Wheel nutz, studs (condition and torque)		X			
Front wheel hubs (fluid, breathers)		X			
Wheel seals		X			
Batteries (condition)		X			
Chassis frame, underbody (cracks)		X			
PTO (leaks, operating noise)		X			
Auxiliary equipment mounts		X			
Grease complete unit		X			
Air brake system		X			
Operation of slack adjusters		X			

Notes:

KMS reset from new ecu being installed.

INSPECTED BY (print): Chris Harding

INSPECTED BY (sign):

Chris Harding



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 122723-238

Date: 12/27/2023

Performed A Service.

Greased all grease points.
Topped up fluids

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.			DATE: 12/27/2023		
LOCATION: GP Shop			WORK ORDER # 122723-238		
UNIT # 238	HOURS 6990	ODOMETER 35701			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R= REPAIR REQUIRED C = REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps	X		Driveshaft u-joints, hanger brackets, guards	X	
Sun visor, latches, door releases, seats	X		Breathers diffs, transmission, hydraulic, hubs		
Heating and defrosting	X		Transmission fluid level, condition (auto at idle)		
Neutral starting shift switch (if equipped)	X		Differential fluid level, condition		
Windshield, windows, mirrors	X		Hydraulic fluid level, condition	X	
Lamps, lights, reflectors	X		Hydraulic hoses (rubs, bulges, condition, leaks)		
Horn, windshield wipers and washers	X		Suspension (springs, air bags, bushings, shocks)		
Engine controls, instrumentation, switch's	X		Torque arms (bolts, bushings, mounts)		
Change engine oil, filters #			Brake friction, mechanical components	X	
change fuel filters #			Parking, emergency, service brake operation	X	
Inspect air filter (change if needed) #			5th wheel operation, condition, lubrication (jaws)	X	
Coolant level, strength	X		Pintle hitch operation, cracks	N/A	
Air intake piping	X		Electrical cables (tears, bulges, corroded, pinched)	X	
Clamps on turbo and mounting	X				
All belts, pulleys idler bearings	X				
All rad and heater hoses (rubs, bulges)	X				
Exhaust system for leaks, mounting	X				
Fuel tanks, filler caps, and lines					
Engine , rad, transmission mounts					
Check for leaks while running	X				
Power steering hose and fluid condition	X				
Steering box, column u-joints					
Wheel alignment, steering linkage					
Fan hub condition, operation	X				
Emergency kill, rig saver	X				
Auxiliary heater engine, bunk					
Rims, tires (wear, cuts, tread depth)	X				
Tire pressure	X				
Wheel nutz, studs (condition and torque)	X				
Front wheel hubs (fluid, breathers)					
Wheel seals	X				
Batteries (condition)					
Chassis frame, underbody (cracks)					
PTO (leaks, operating noise)					
Auxiliary equipment mounts					
Grease complete unit	X				
Air brake system	X				
Operation of slack adjusters	X				

Notes:

INSPECTED BY (print): Sean Critch	
INSPECTED BY (sign):	

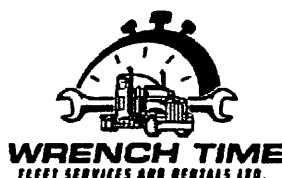
**Wrench Time Fleet Services and
Rentals Ltd.**

9415 158 Ave

Grande Prairie, AB T8X 0B9, CA

devon@wrenchtimefleet.ca

780-380-4011

Invoice: **1580**Date: **10/18/2023****Bill To**

Energi Transport Ltd

158 ave

Grande Prairie, AB T8X 0B9, CA

P: 780-532-0575

Remit Payment ToWrench Time Fleet Services and Rentals
Ltd

9415 158 Ave

Grande Prairie, AB T8X 0B9, CA

Service Order

1605

Terms

Net 60

Due Date

12/17/2023

Authorizer

Rick Dowe

Customer PO**Unit #**

238

Item	Description	Quantity	Rate	Amount
PM: Full Service and Inspection				
Cause: Customer request				
(PM)				
Labor	Correction: Engine / Lubrication / 600 hour service - Completed: 10/13/2023	2.50000	\$0.00	\$0.00
Subtotal				\$0.00
Unit: 238 VIN: 5KJJBHDV2LLLX4585				Pre-Charge Subtotal \$0.00
2020 Western Star Trucks 5700				Exempt \$0.00
Engine: 6,227 Hours				(0% of \$0.00)
Truck/Tractor Chassis: 268,962 Kilometers				Total \$0.00
				Payments & Credits \$0.00
				Balance Due \$0.00

Any warranties on the parts and accessories sold hereby are made by the manufacturer. You understand and agree that we make no warranties of any kind unless expressed in writing. You hereby authorize us to perform the repair work herein set forth and to purchase the necessary material and parts to perform such repair work. You agree that we are not responsible for loss or damage to your vehicle or articles left in your vehicle in case of fire, theft, or any other cause beyond our control or for any delays caused by unavailability of parts or delays in part shipments by the supplier or transporter. In addition, you agree that we are not responsible for damages to your vehicle from freezing due to lack of antifreeze. You hereby grant our employees permission to operate your vehicle on streets, highways, or elsewhere for the purpose of testing and/or inspection. You acknowledge and agree that an express mechanic's lien on your vehicle is granted to secure payment of this invoice for the repair work detailed in this invoice.

Customer Signature: _____**Printed Name:** _____ **Date:** _____**GST#769367269RT0001**

Wrench Time Fleet Services and Rentals Ltd.

9415 158 Ave

Grande Prairie, AB T8X 0B9, CA

devon@wrenchtimefleet.ca

780-380-4011

Invoice: **1568**Date: **10/10/2023****Bill To**

Energi Transport Ltd

158 ave

Grande Prairie, AB T8X 0B9, CA

P: 780-532-0575

Remit Payment To

Wrench Time Fleet Services and Rentals

Ltd

9415 158 Ave

Grande Prairie, AB T8X 0B9, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
1586	Net 60	12/9/2023	Rick Dowe		238

Item	Description	Quantity	Rate	Amount
PM: Grease Service and Inspection				
Cause: Customer request				
(PM)				

Labor	Correction:	1.50000	\$0.00	\$0.00
	Engine / Lubrication / unit has to go to westernstar for programming - Completed: 10/4/2023			
Subtotal				\$0.00

Unit: 238 VIN: 5KJJBHDV2LLLX4585

2020 Western Star Trucks 5700

Engine: 6,134 Hours**Truck/Tractor Chassis: 268,961 Kilometers****Pre-Charge Subtotal** \$0.00**Exempt**
(0% of \$0.00) \$0.00**Total** \$0.00**Payments & Credits** \$0.00**Balance Due** \$0.00

Any warranties on the parts and accessories sold hereby are made by the manufacturer. You understand and agree that we make no warranties of any kind unless expressed in writing. You hereby authorize us to perform the repair work herein set forth and to purchase the necessary material and parts to perform such repair work. You agree that we are not responsible for loss or damage to your vehicle or articles left in your vehicle in case of fire, theft, or any other cause beyond our control or for any delays caused by unavailability of parts or delays in part shipments by the supplier or transporter. In addition, you agree that we are not responsible for damages to your vehicle from freezing due to lack of antifreeze. You hereby grant our employees permission to operate your vehicle on streets, highways, or elsewhere for the purpose of testing and/or inspection. You acknowledge and agree that an express mechanic's lien on your vehicle is granted to secure payment of this invoice for the repair work detailed in this invoice.

Customer Signature: _____**Printed Name:** _____ **Date:** _____

GST#769367269RT0001



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 081223-238

Date: 08/12/2023

Performed B Service.

Replaced engine oil filters
Replaced fuel filters
Replaced Air Filter
Replaced Cabin Filter.
Replaced Engine Oil
Topped up all fluids
Greased all grease points

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.			DATE: 08/12/2023		
LOCATION: GP Shop			WORK ORDER # 081223-238		
UNIT # 238	HOURS 6512	ODOMETER 23459			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R = REPAIR REQUIRED C = REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps		X	Driveshaft u-joints, hanger brackets, guards		X
Sun visor, latches, door releases, seats		X	Breathers diffs, transmission, hydraulic, hubs		X
Heating and defrosting		X	Transmission fluid level, condition (auto at idle)		X
Neutral starting shift switch (if equipped)		X	Differential fluid level, condition		X
Windshield, windows, mirrors		X	Hydraulic fluid level, condition		X
Lamps, lights, reflectors		X	Hydraulic hoses (rubs, bulges, condition, leaks)		X
Horn, windshield wipers and washers		X	Suspension (springs, air bags, bushings, shocks)		X
Engine controls, instrumentation, switch's		X	Torque arms (bolts, bushings, mounts)		X
Change engine oil, filters #		X	Brake friction, mechanical components		X
change fuel filters #		X	Parking, emergency, service brake operation		X
Inspect air filter (change if needed) #		X	5th wheel operation, condition, lubrication (jaws)		X
Coolant level, strength		X	Pintle hitch operation, cracks		N/A
Air intake piping		X	Electrical cables (tears, bulges, corroded, pinched)		X
Clamps on turbo and mounting		X			
All belts, pulleys idler bearings		X			
All rad and heater hoses (rubs, bulges)		X			
Exhaust system for leaks, mounting		X			
Fuel tanks, filler caps, and lines		X			
Engine, rad, transmission mounts		X			
Check for leaks while running		X			
Power steering hose and fluid condition		X			
Steering box, column u-joints		X			
Wheel alignment, steering linkage		X			
Fan hub condition, operation		X			
Emergency kill, rig saver		X			
Auxiliary heater engine, bunk		X			
Rims, tires (wear, cuts, tread depth)		X			
Tire pressure		X			
Wheel nutz, studs (condition and torque)		X			
Front wheel hubs (fluid, breathers)		X			
Wheel seals		X			
Batteries (condition)		X			
Chassis frame, underbody (cracks)		X			
PTO (leaks, operating noise)		X			
Auxiliary equipment mounts		X			
Grease complete unit		X			
Air brake system		X			
Operation of slack adjusters		X			

Notes:

KMS reset from new ecu being installed.

INSPECTED BY (print): Chris Harding

INSPECTED BY (sign):



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 042723-238

Date: 04/27/2023

Performed A Service.

Greased all grease points.
Topped up fluids

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.		DATE: 04/27/2023			
LOCATION: GP Shop		WORK ORDER # 042723-238			
UNIT # 238	HOURS 6067	ODOMETER 224345			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R= REPAIR REQUIRED C= REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps	X		Driveshaft u-joints, hanger brackets, guards	X	
Sun visor, latches, door releases, seats	X		Breathers diffs, transmission, hydraulic, hubs		
Heating and defrosting	X		Transmission fluid level, condition (auto at idle)		
Neutral starting shift switch (if equipped)	X		Differential fluid level, condition		
Windshield, windows, mirrors	X		Hydraulic fluid level, condition	X	
Lamps, lights, reflectors	X		Hydraulic hoses (rubs, bulges, condition, leaks)		
Horn, windshield wipers and washers	X		Suspension (springs, air bags, bushings, shocks)		
Engine controls, instrumentation, switch's	X		Torque arms (bolts, bushings, mounts)		
Change engine oil, filters #			Brake friction, mechanical components	X	
change fuel filters #			Parking, emergency, service brake operation	X	
Inspect air filter (change if needed) #			5th wheel operation, condition, lubrication (jaws)	X	
Coolant level, strength	X		Pintle hitch operation, cracks	N/A	
Air intake piping	X		Electrical cables (tears, bulges, corroded, pinched)	X	
Clamps on turbo and mounting	X				
All belts, pulleys idler bearings	X				
All rad and heater hoses (rubs, bulges)	X				
Exhaust system for leaks, mounting	X				
Fuel tanks, filler caps, and lines					
Engine , rad, transmission mounts					
Check for leaks while running	X				
Power steering hose and fluid condition	X				
Steering box, column u-joints					
Wheel alignment, steering linkage					
Fan hub condition, operation	X				
Emergency kill, rig saver	X				
Auxiliary heater engine, bunk					
Rims, tires (wear, cuts, tread depth)	X				
Tire pressure	X				
Wheel nutz, studs (condition and torque)	X				
Front wheel hubs (fluid, breathers)					
Wheel seals	X				
Batteries (condition)					
Chassis frame, underbody (cracks)					
PTO (leaks, operating noise)					
Auxiliary equipment mounts					
Grease complete unit	X				
Air brake system	X				
Operation of slack adjusters	X				

Notes:

INSPECTED BY (print): Sean Critch	
INSPECTED BY (sign):	



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 011723-238
Date: 01/17/2023

Performed B Service.

Replaced engine oil filters
Replaced fuel filters
Replaced Air Filter
Replaced Cabin Filter.
Replaced Engine Oil
Topped up all fluids
Greased all grease points

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.		DATE: 01/17/2023	
LOCATION: GP Shop		WORK ORDER # 011723-238	
UNIT # 238	HOURS 5584	ODOMETER 211321	
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS			
REPAIR CODES: X= OK R= REPAIR REQUIRED C = REPAIR COMPLETED			
	A	B	
Body, doors, bumpers, fenders, mud flaps		X	X
Sun visor, latches, door releases, seats		X	X
Heating and defrosting		X	X
Neutral starting shift switch (if equipped)		X	X
Windshield, windows, mirrors		X	X
Lamps, lights, reflectors		X	X
Horn, windshield wipers and washers		X	X
Engine controls, instrumentation, switch's		X	X
Change engine oil, filters #		X	X
change fuel filters #		X	X
Inspect air filter (change if needed) #		X	X
Coolant level, strength		X	X
Air intake piping		X	X
Clamps on turbo and mounting		X	X
All belts, pulleys idler bearings		X	X
All rad and heater hoses (rubs, bulges)		X	X
Exhaust system for leaks, mounting		X	X
Fuel tanks, filler caps, and lines		X	X
Engine , rad, transmission mounts		X	X
Check for leaks while running		X	X
Power steering hose and fluid condition		X	X
Steering box, column u-joints		X	X
Wheel alignment, steering linkage		X	X
Fan hub condition, operation		X	X
Emergency kill, rig saver		X	X
Auxiliary heater engine, bunk		X	X
Rims, tires (wear, cuts, tread depth)		X	X
Tire pressure		X	X
Wheel nutz, studs (condition and torque)		X	X
Front wheel hubs (fluid, breathers)		X	X
Wheel seals		X	X
Batteries (condition)		X	X
Chassis frame, underbody (cracks)		X	X
PTO (leaks, operating noise)		X	X
Auxiliary equipment mounts		X	X
Grease complete unit		X	X
Air brake system		X	X
Operation of slack adjusters		X	X

Notes:

INSPECTED BY (print): Chris Harding	
INSPECTED BY (sign):	



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 092522-238

Date: 09/25/2022

Performed A Service.

Greased all grease points.
Topped up fluids

See attached inspection form.

Notes:	
INSPECTED BY (print): Curtis Dowhan	
INSPECTED BY (sign): <i>Curtis Dowhan</i>	



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 070922-238

Date: 07/09/2022

Performed B Service.

Replaced engine oil filters
Replaced fuel filters
Replaced Air Filter
Replaced Cabin Filter.
Replaced Engine Oil
Topped up all fluids
Greased all grease points

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.			DATE: 07/09/2022		
LOCATION: GP Shop			WORK ORDER # 070922-238		
UNIT # 238	HOURS 4651	ODOMETER 176891			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R= REPAIR REQUIRED C = REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps		X	Driveshaft u-joints, hanger brackets, guards		X
Sun visor, latches, door releases, seats		X	Breathers diffs, transmission, hydraulic, hubs		X
Heating and defrosting		X	Transmission fluid level, condition (auto at idle)		X
Neutral starting shift switch (if equipped)		X	Differential fluid level, condition		X
Windshield, windows, mirrors		X	Hydraulic fluid level, condition		X
Lamps, lights, reflectors		X	Hydraulic hoses (rubs, bulges, condition, leaks)		X
Horn, windshield wipers and washers		X	Suspension (springs, air bags, bushings, shocks)		X
Engine controls, instrumentation, switch's		X	Torque arms (bolts, bushings, mounts)		X
Change engine oil, filters #		X	Brake friction, mechanical components		X
change fuel filters #		X	Parking, emergency, service brake operation		X
Inspect air filter (change if needed) #		X	5th wheel operation, condition, lubrication (jaws)		X
Coolant level, strength		X	Pintle hitch operation, cracks		N/A
Air intake piping		X	Electrical cables (tears, bulges, corroded, pinched)		X
Clamps on turbo and mounting		X			
All belts, pulleys idler bearings		X			
All rad and heater hoses (rubs, bulges)		X			
Exhaust system for leaks, mounting		X			
Fuel tanks, filler caps, and lines		X			
Engine , rad, transmission mounts		X			
Check for leaks while running		X			
Power steering hose and fluid condition		X			
Steering box, column u-joints		X			
Wheel alignment, steering linkage		X			
Fan hub condition, operation		X			
Emergency kill, rig saver		X			
Auxiliary heater engine, bunk		X			
Rims, tires (wear, cuts, tread depth)		X			
Tire pressure		X			
Wheel nutz, studs (condition and torque)		X			
Front wheel hubs (fluid, breathers)		X			
Wheel seals		X			
Batteries (condition)		X			
Chassis frame, underbody (cracks)		X			
PTO (leaks, operating noise)		X			
Auxiliary equipment mounts		X			
Grease complete unit		X			
Air brake system		X			
Operation of slack adjusters		X			

Notes:

INSPECTED BY (print): Chris Harding	
INSPECTED BY (sign):	



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 032322-238

Date: 03/23/2022

Performed A Service.

Greased all grease points.
Topped up fluids

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.			DATE: 03/23/2022		
LOCATION: GP Shop			WORK ORDER # 032322-238		
UNIT # 238	HOURS 4209	ODOMETER 155223			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R = REPAIR REQUIRED C = REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps	X		Driveshaft u-joints, hanger brackets, guards	X	
Sun visor, latches, door releases, seats	X		Breathers diffs, transmission, hydraulic, hubs		
Heating and defrosting	X		Transmission fluid level, condition (auto at idle)		
Neutral starting shift switch (if equipped)	X		Differential fluid level, condition		
Windshield, windows, mirrors	X		Hydraulic fluid level, condition	X	
Lamps, lights, reflectors	X		Hydraulic hoses (rubs, bulges, condition, leaks)		
Horn, windshield wipers and washers	X		Suspension (springs, air bags, bushings, shocks)		
Engine controls, instrumentation, switch's	X		Torque arms (bolts, bushings, mounts)		
Change engine oil, filters #			Brake friction, mechanical components	X	
change fuel filters #			Parking, emergency, service brake operation	X	
Inspect air filter (change if needed) #			5th wheel operation, condition, lubrication (jaws)	X	
Coolant level, strength	X		Pintle hitch operation, cracks	N/A	
Air intake piping	X		Electrical cables (tears, bulges, corroded, pinched)	X	
Clamps on turbo and mounting	X				
All belts, pulleys idler bearings	X				
All rad and heater hoses (rubs, bulges)	X				
Exhaust system for leaks, mounting	X				
Fuel tanks, filler caps, and lines					
Engine , rad, transmission mounts					
Check for leaks while running	X				
Power steering hose and fluid condition	X				
Steering box, column u-joints					
Wheel alignment, steering linkage					
Fan hub condition, operation	X				
Emergency kill, rig saver	X				
Auxiliary heater engine, bunk					
Rims, tires (wear, cuts, tread depth)	X				
Tire pressure	X				
Wheel nutz, studs (condition and torque)	X				
Front wheel hubs (fluid, breathers)					
Wheel seals	X				
Batteries (condition)					
Chassis frame, underbody (cracks)					
PTO (leaks, operating noise)					
Auxiliary equipment mounts					
Grease complete unit	X				
Air brake system	X				
Operation of slack adjusters	X				

Notes:

INSPECTED BY (print): Curtis Dowhan

INSPECTED BY (sign): *Curtis Dowhan*



Energi Transport Ltd
9415 158th Ave
Grande Prairie AB T8X 0B9
Work: 587-299-9336

Equipment: 238

Work Order #: 011122-238
Date: 01/11/2022

Performed B Service.

Replaced engine oil filters
Replaced fuel filters
Replaced Air Filter
Replaced Cabin Filter.
Replaced Engine Oil
Topped up all fluids
Greased all grease points

See attached inspection form.



Tractor Inspection

A Service

B Service

(circle appropriate inspection)

CUSTOMER: Energi Transport Ltd.			DATE: 01/11/2022		
LOCATION: GP Shop			WORK ORDER # 011122-238		
UNIT # 238	HOURS 3725	ODOMETER 141345			
INSPECT ALL THE COMPONENTS BELOW AND MAKE NECESSARY CORRECTIONS					
REPAIR CODES: X= OK R= REPAIR REQUIRED C= REPAIR COMPLETED					
	A	B		A	B
Body, doors, bumpers, fenders, mud flaps		X	Driveshaft u-joints, hanger brackets, guards		X
Sun visor, latches, door releases, seats		X	Breathers diffs, transmission, hydraulic, hubs		X
Heating and defrosting		X	Transmission fluid level, condition (auto at idle)		X
Neutral starting shift switch (if equipped)		X	Differential fluid level, condition		X
Windshield, windows, mirrors		X	Hydraulic fluid level, condition		X
Lamps, lights, reflectors		X	Hydraulic hoses (rubs, bulges, condition, leaks)		X
Horn, windshield wipers and washers		X	Suspension (springs, air bags, bushings, shocks)		X
Engine controls, instrumentation, switch's		X	Torque arms (bolts, bushings, mounts)		X
Change engine oil, filters #		X	Brake friction, mechanical components		X
change fuel filters #		X	Parking, emergency, service brake operation		X
Inspect air filter (change if needed) #		X	5th wheel operation, condition, lubrication (jaws)		X
Coolant level, strength		X	Pintle hitch operation, cracks		N/A
Air intake piping		X	Electrical cables (tears, bulges, corroded, pinched)		X
Clamps on turbo and mounting		X			
All belts, pulleys idler bearings		X			
All rad and heater hoses (rubs, bulges)		X			
Exhaust system for leaks, mounting		X			
Fuel tanks, filler caps, and lines		X			
Engine, rad, transmission mounts		X			
Check for leaks while running		X			
Power steering hose and fluid condition		X			
Steering box, column u-joints		X			
Wheel alignment, steering linkage		X			
Fan hub condition, operation		X			
Emergency kill, rig saver		X			
Auxiliary heater engine, bunk		X			
Rims, tires (wear, cuts, tread depth)		X			
Tire pressure		X			
Wheel nutz, studs (condition and torque)		X			
Front wheel hubs (fluid, breathers)		X			
Wheel seals		X			
Batteries (condition)		X			
Chassis frame, underbody (cracks)		X			
PTO (leaks, operating noise)		X			
Auxiliary equipment mounts		X			
Grease complete unit		X			
Air brake system		X			
Operation of slack adjusters		X			

Notes:

INSPECTED BY (print): Chris Harding	
INSPECTED BY (sign):	