



Farleys Truck & Auto Addictions
14735 119 Avenue Northwest
Edmonton, AB T5L 2N9
(780) 488-3883
www.farleystruckandauto.com
GST# 835247057RT0001

J17-9
NOV

Invoice #16676

Created: 09/24/2026 at 10:02AM
Invoiced: 09/25/2026 at 2:10PM
Payment Term: On Receipt
Payment Due: 09/25/2026
Service Writer: Steve Villeneuve
PO #: WS193

M.A.P Water & Sewer
14303 116 Ave
Edmonton, AB T5M 4G2

2022 Chevrolet Silverado 1500 RST (#WS-T93)
VIN: 3GCUDEET5NG507128
License Plate: CLH-5513
Mileage In: 290,848 km
Mileage Out: 290,851 km

Oil Change + Fuel Filter

Description	Price	QTY	HRS	Subtotal
1 Oil Change			0.5	\$67.50
2 Engine Air Filter Element R&R			0.5	\$67.50
3 Replace Fuel Filter			1	\$135.00
4 OIL FILTER Part #: PZF-8-WL10351 OIL FILTER	\$12.41	1		\$12.41
5 Fuel Filter - WF10451	\$63.25	1		\$63.25
6 TLU-228317 0W20 Oil Dexos D 1L Part #: TLU-228317	\$22.05	2		\$44.10
7 TLU-228318 0W20 Oil Dexos D 5L Part #: TLU-228318	\$105.21	1		\$105.21
8 PG-9-10942 Engine Air Filter Part #: PG-9-10942	\$43.30	1		\$43.30

Shop Supplies (10%): \$27.00 GST (5%): \$28.26 Subtotal: \$593.53

Noise In Front End

Description	Price	QTY	HRS	Subtotal
1 Rotate Tires			0.5	\$67.50
2 Replace Lower Ball Joints			5.6	\$756.00
3 Replace Right Upper Ball Joint			2	\$270.00
4 MEV-MS50589 Ball Joint Part #: MEV-MS50589	\$63.89	2		\$127.78
5 MOG-K500340 Ball Joint Part #: MOG-K500340 BALL JOINT	\$66.63	1		\$66.63

Shop Supplies (10%): \$109.35 GST (5%): \$69.86 Subtotal: \$1,467.12

Tire Light On

Description	Price	QTY	HRS	Subtotal
1 Replace TPMS Sensor			0.5	\$67.50
2 T33560 Schrader EZ Sensor GO Blue T33560 Schrader EZ Sensor GO Blue	\$65.00	1		\$65.00

POSTED



9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0086553 Tag# : 7128

Check-in: Mon Aug 17, 2026 14:43 PM

Promise Time: Mon Aug 17, 2026 15:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
281,234 Km In / 281,234
Km Out
In Service Date:
04/28/2022

Service Advisor
James Coffee
6543
+1 - (780) 435 - 4000

Approved Jobs

1. FORM INSPECTION FORM ONLY


Job added by James Coffee on Mon Aug 17, 2026 14:43 PM

2. LOFDEXD LUBE, OIL AND OIL FILTER SERVICE ON
DIESEL VEHICLES WITH DEXOS D

Job added by James Coffee on Mon Aug 17, 2026 14:43 PM

Internal Pay \$0.00

Customer Pay \$194.95

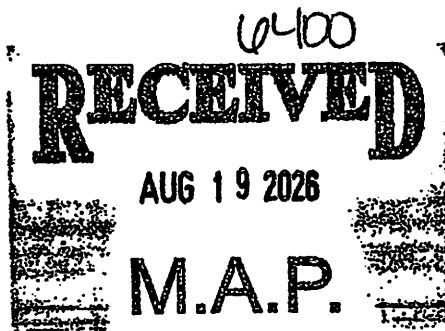

POSTED

Labor	\$43.76
Parts	\$146.19
Sublet	\$0.00
Sublet Labor	\$0.00
Sublet Parts	\$0.00
Fees	\$11.56
Discounts	-\$15.00
Tax - GST	\$9.32
Deductible	\$0.00
Insurance/Warranty	\$0.00
Invoice Total	\$195.83



\$0.00

Services (0)

Inspections (0)





9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0086553 Tag# : 7128

Check-in: Mon Aug 17, 2026 | 4:43 PM
Promise Time: Mon Aug 17, 2026 | 5:00 PM

Customer

M.A.P. WATER AND
SEWER SERVICES LTD

Billing-Customer

Same as Customer

Vehicle

2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor


James Coffee
6543
+1 - (780) 435 - 4000

Multi-Point Inspection


Under Hood

Battery

Battery Condition




Battery, Cables and Connections



Under Vehicle

Steering/Suspension

Front Suspension Components - Visual inspection



Rear Suspension Components - Visual Inspection



Check For Fluid Leaks


Engine Oil Leaks




Cooling System Leaks



Brake System Leaks



Transmission System Leaks



Steering System Leaks



Driveline Service Leaks



Other Services

Exhaust system components



OnStar Diagnostics

OnStar Active



Enrolled in Advanced Diagnostics Report



Enrolled in Dealer Maintenance Notification



Service History/Recall Check





Wolfe Chevrolet Edmonton

10145 178th Street NW | Edmonton, AB T5S 1E4

Phone: (780) 483-3320 | Fax: (780) 483-8068

Toll Free: 1-877-483-3320

reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO # WG207589

Status

Printed 07/07/2026 11:30:17 AM

SERVICE ORDER CUSTOMER COPY



User C403 Page 1

Customer No	
M.A.P. Water And Sewer Services Ltd.	
14303 - 116 Avenue NW	
Edmonton, AB T5M 4G2	
Home	Bus (780) 453-6996
Cell	Today
Email	
Type	
Term	Cash

Advisor	Bruce Kobylnyk	Promised	07/07/2026 5:30 PM	Tag#	7128
Shop	S1	Opened	07/07/2026 8:27 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	272120	272120	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET		05/03/2022	
Engine	DURAMAX 3.0L TURBO-DIESEL I6		WS193	

Request	Description	Job	CSR	Status
LOF/DURAMA	Duramax Diesel Oil Change:	1	C403	Original

Change engine oil and filter, lube chassis, top up fluids and perform complimentary visual health inspection.

Labour	Description	Type	Amount
LOF/DURAMA	Duramax Diesel Oil Change:	CS	59.95

Change engine oil and filter, lube chassis, top up fluids and perform complimentary visual health inspection.

Part	Description	Shp	SL	Bin	Type	Price	Amount
19370139	0W20 DEXOS D	7		400402	CQS	23.02	161.14
ENVIRO	HNDL CHG	14			CQS	0.05	0.70
12816268	FILTER PF66	1		400205	CQS	18.38	18.38
ENVIRO	HNDL CHG	10			CQS	0.05	0.50
Technician	C8349 -						
Cause	GM CDA LOF oil service				Parts Total		180.72
					Labour Total		59.95
Correction	oil service completed. removed old oil filter installed new oil filter filled with 6.6L of 0w20 oil life reset to 100% oil life before reset: 22%				Request Sub-total		240.67

Request	Description	Job	CSR	Status
FORMMPVI	Multipoint Vehicle Health Check as required by your Owners Manual every 12,000 km - a comprehensive assessment of your vehicle including: Tires Rotation and Inspection; Brake Inspection; Systems, Fluids & Visible Leak Inspection; Battery Condition and voltage test; Visible & Functional Inspections including: exhaust, driveline, steering and suspension components, belts and hoses; Lubrication of Chassis, Weatherstripping, Door Hinges, Lock Cylinders	2	C403	Original
Labour	Description	Type	Amount	
MPVI	Multipoint Vehicle Health Check as required by your Owners Manual every 12,000 km - a comprehensive assessment of your vehicle including: Tires Rotation and Inspection; Brake Inspection; Systems, Fluids & Visible Leak Inspection; Battery Condition and voltage test; Visible & Functional Inspections including: exhaust, driveline, steering and suspension components, belts and hoses; Lubrication of Chassis, Weatherstripping, Door Hinges, Lock Cylinders.	CS	89.95	
Technician	C8349 -			
		Labour Total	89.95	

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 90 DAYS OR SPECIAL ORDERS.

NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE:



Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320

reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO # WG207589

Status

Printed 07/07/2026 11:30:18 AM

SERVICE ORDER CUSTOMER COPY



User C403 Page 2

Customer No M.A.P. Water And Sewer Services Ltd. 14303 - 116 Avenue NW Edmonton, AB T5M 4G2		Advisor Bruce Kobylnyk Shop S1 Priority 4	Promised 07/07/2026 5:30 PM Opened 07/07/2026 8:27 AM Cashiered	Tag# 7128 Location PO # WS193
Home Cell Email	Bus (780) 453-6996 Today	License TBA Year 2022 Make CHEVROLET Vehicle ID No 3GCUDEET5NG507128 Engine DURAMAX 3.0L TURBO-DIESEL I6	Odom In 272120 Odom Out 272120 Model SILVERADO 1500 Selling Dealer WOLFE CHEVROLET	In Service Date 05/03/2022 Model Number CK10543 Extended Warranty WS193 Stock No CU507128 Colour Delivery Date 05/03/2022
Type Term Cash				

Cause mpvi
Correction tire pressure set to (36 psi), front tread depth (14/32nds) rear tread depth (15/32nds)
rotated tires, all fluids good, all lights good,
windshield washer fluid topped up
battery measured at 12.39v 628CCA
completed MPVI form
found a large oil leak recommend further diagnosis
found front right lower ball joint torn recommend replacing

Request Sub-total 89.95

Request	Description	Job	CSR	Status			
MENU/CABIN	Replace Cabin Air Filter If Needed - Replace Cabin Air Filter If Needed	3	C403	Original			
Labour	Description		Type	Amount			
MENU/CABIN	Replace Cabin Air Filter If Needed - Replace Cabin Air Filter If Needed		CS				
Part	Description	Shp	SL	Bin	Type	Price	Amount
19363960	FILTER	1		250203	CQS		
Technician	C8349 -						
Cause	replaced cabin air filter						
Correction	removed and replaced cabin air filter						
Request Sub-total							79.95

Labour	187.85
Parts	222.72
Supplies	0.00
Sub-Total	410.57
GST	20.53
Total Invoice	431.10

RECEIVED

JUL 09 2026

M.A.P.

POSTED

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____



9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000
Gst#823102777RT0001

Customer Pay Invoice

\$195.83

RO# : 0081249 Tag# : 7128

Check-in: Thu May 28, 2026 | 8:45 AM
Ready for Pickup: Thu May 28, 2026 | 9:09 AM
Promise Time: Thu May 28, 2026 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
262,644 Km In / 262,644
Km Out
In Service Date:
04/28/2022

Service Advisor
James Coffee
6543
+1 - (780) 435 - 4000

1. FORM INSPECTION FORM ONLY

Job added by James Coffee on Thu May 28, 2026 | 8:45 AM

1. INSPECTION FORM

Op.1 FORM -INSPECTION FORM ONLY

WS-193.
Internal Pay

\$0.00

Labor: \$0.00

2. LOFDEXD LUBE, OIL AND OIL FILTER SERVICE ON
VEHICLES TO 6L DEXOS

Customer Pay

\$194.95

Job added by James Coffee on Thu May 28, 2026 | 8:45 AM

Op.1 LOFDEXD -LUBE, OIL AND OIL FILTER SERVICE ON DIESEL VEHICLES WITH
DEXOS D

1. PERFORMED BY: JOSH/JOSH//AK

2. Oil Life - 0 %

3. Oil Used - PF66 0W20 DEXD


4. UNIT WS193

5. UNIT NUMBER WS193 DRIVER NAME JOHN ENGINE HOURS 5910

Parts

12735608 - FILTER 1 - \$12.00

19432118 - OIL 7 - \$134.19

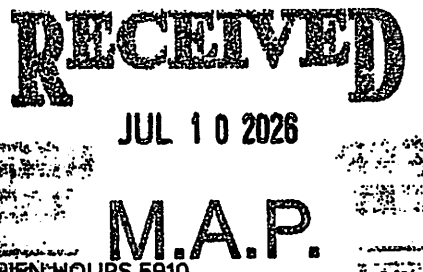

Labor: \$43.76

Fees

GOG - Gas oil - \$5.00

Discount

Fleetoilchange promo - -\$15.00

POSTED

\$5.00

-\$15.00



Farleys Truck & Auto Addictions
14735 119 Avenue Northwest
Edmonton, AB T5L 2N9
(780) 488-3883
www.farleystruckandauto.com
GST# 835247057RT0001

Invoice #15955

Created: 05/25/2026 at 1:14PM
Invoiced: 05/26/2026 at 4:22PM
Payment Term: On Receipt
Payment Due: 05/26/2026
Service Writer: Brady Kerscher

M.A.P Water & Sewer
14303 116 Ave
Edmonton, AB T5M 4G2

2022 Chevrolet Silverado 1500 RST (#WS-193)
VIN: 3GCUDEET5NG507128
License Plate: CLH-5513
Mileage In: 262,428 km
Mileage Out: 262,428 km

Customer Comments

Code
P24DA CEL
U0198
U0499

Inspect Brakes & Codes

Inspect brakes and read codes .5 hr

Description

1 Read Codes & Brake Diag

HRS Subtotal

0.5 \$67.50

Shop Supplies (10%): \$6.75 GST (5%): \$3.71 Total: \$77.96

Front & Rear Brake Pads & Rotors

Replace front pads and rotors 1.5 hr
Replace rear pads and rotors 1.5 hr
Reset brake pad minder

Description

1 R&I Front Brake Pads and Rotors

2 R&I Rear Brake Pads & Rotors

3 WSF-WSD2174CH Ceramic Rear Disc Brake Pad Kit
WSF-WSD2174CH Ceramic Rear Disc Brake Pad Kit

4 WPS-WS1-155285 Rear Disc Brake Rotor
WPS-WS1-155285 Rear Disc Brake Rotor

5 WPS-WS1-155286 Brake Rotor
WPS-WS1-155286 Brake Rotor

6 WSF-WSD2173CH Ceramic Pad Set
WSF-WSD2173CH Ceramic Pad Set

Price QTY HRS Subtotal

1.5 \$202.50

1.5 \$202.50

\$73.16 1 \$73.16

\$128.81 2 \$257.62

\$193.42 2 \$386.84

\$96.77 1 \$96.77

Shop Supplies (10%): \$40.50 GST (5%): \$62.99 Total: \$1,322.88

POSTED



Farleys Truck & Auto Additions
14735 119 Avenue Northwest
Edmonton, AB T5L 2N9
(780) 488-3883
www.farleystruckandauto.com
GST# 835247057RT0001

Invoice #15746

Created: 04/23/2026 at 9:20AM
Invoiced: 04/24/2026 at 1:35PM
Payment Term: On Receipt
Payment Due: 04/24/2026
Service Writer: Steve Villeneuve
PO #: WS193

M.A.P Water & Sewer
14303 116 Ave
Edmonton, AB T5M 4G2

2022 Chevrolet Silverado 1500 RST (#WS-193)
VIN: 3GCUDEET5NG507128
License Plate: CLH-5513
Mileage Out: 256,123 km

Swap Tires

Install Supplied BFG Tires

Description

1 Mount & Balance

HRS Subtotal

4 \$180.00

Shop Supplies (10%): \$18.00 GST (5%): \$9.90 Total: \$207.90

Check Front End

Replace upper and lower ball joints 8.6 hr

Description

1 Replace Upper & Lower Ball Joints

Price QTY HRS Subtotal

8.6 \$1,161.00

2 MEV-MS50589 Ball Joint

\$63.91 2 \$127.82

Part #: MEV-MS50589

3 MOG-K500340 Ball Joint

\$66.33 2 \$132.66

Part #: MOG-K500340 BALL JOINT

Shop Supplies (10%): \$116.10 GST (5%): \$76.88 Total: \$1,614.46

Estimates provided are an approximation of timing and charges to you for the services requested. They are based on the anticipated work to be done. It is possible for unexpected complications to cause some deviation from the original quote. You hereby authorize the repair work described in this estimate to be done along with the procurement of the necessary material(s), including permission to operate the vehicle for on-road testing or inspection. If any additional repairs are required, we will prepare a revised work order providing the cost of additional parts and labor and total revised cost. All parts are new unless specified otherwise.

Deposits are non-refundable. No returns or refunds on special ordered items or electrical parts. There is no warranty for used parts or customer supplied parts.

You agree that we are not responsible for loss or damage to your vehicle, including loss of articles left in the vehicle, including, without limitation, in case of fire, theft, or any other cause(s) beyond our control. We are not responsible for any delays caused by unavailability of parts or delays in delivery of parts by the supplier or transporter.

You have the right to know before authorizing any additional repairs what those repairs will be and what they will cost. If required repairs exceed the authorized estimated amount, we must obtain your approval to perform the repairs. We will keep you informed and perform only repairs authorized by you.

PAYMENT OPTIONS:

- Credit card (A credit card fee of 3% will be charged on all orders paid with credit card)
- E-transfer payments can be made to greg@farleystruckaccessories.com
- Debit and cash

Labor \$1,341.00
Parts \$260.48
Subtotal \$1,601.48
Shop Supplies \$134.10
EPA \$0.00
GST \$86.78
Grand Total \$1,822.36
Paid to Date (\$0.00)

REMAINING BALANCE \$1,822.36

CAPITAL

GMC • BUICK

9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
252,669 Km In / 252,669
Km Out
In Service Date:
04/28/2022

Vehicle Health Report

RO# : 0077112 Tag# : 7128

Check-in: Wed Mar 18, 2026 | 11:25 AM

Promise Time: Wed Mar 18, 2026 | 5:00 PM

Service Advisor
James Coffee
6543
+1 - (780) 435 - 4000

Approved Jobs

- | | | | | |
|--|-----------|---|--------------|----------|
| 1. | FORM | INSPECTION FORM ONLY | Internal Pay | \$0.00 |
| Job added by James Coffee on Wed Mar 18, 2026 11:25 AM | | | | |
| 2. | LOFDEXD | LUBE, OIL AND OIL FILTER SERVICE ON
DIESEL VEHICLES WITH DEXOS D | Customer Pay | \$194.95 |
| Job added by James Coffee on Wed Mar 18, 2026 11:25 AM | | | | |
| 3. | 22GMZZ136 | DIESEL DURAMAX FUEL FILTER
REPLACEMENT (17+) | Customer Pay | \$192.89 |
| Job added by Quick Service Tech on Wed Mar 18, 2026 11:53 AM | | | | |

General Motors is going
to email you our report card.
If for any reason you cannot fill
it out "Completely Satisfied" Please
contact our service management
team at 780-435-4000 or
service@capitalgmcbuick.ca

POSTED

RECEIVED

MAR 28 2026

MAR 6400

Labor	\$152.81
Parts	\$225.03
Sublet	\$0.00
Sublet Labor	\$0.00
Sublet Parts	\$0.00
Fees	\$32.92
Discounts	\$0.00
Tax - GST	\$20.53
Deductible	\$0.00
Insurance/Warranty	\$0.00
Invoice Total	\$431.29





9751 34th Avenue NW
Edmonton, Alberta T6E5X9

Promise Time: Wed Mar 18, 2026 | 5:00 PM

Service Advisor
James Coffee
6543
+1 - (780) 435 - 4000

Vehicle Health Report v1 | Page 3 of 4
Wed Mar 18, 2026 | 12:03 PM



Wolfe Chevrolet Edmonton
 10145 178th Street NW | Edmonton, AB T5S 1E4
 Phone: (780) 483-3320 | Fax: (780) 483-8068
 Toll Free: 1-877-483-3320

reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO # WG200961

**SERVICE ORDER
CUSTOMER COPY**



Status
 Printed 01/12/2026 1:30:49 PM

User C403 Page 1

Customer No
 M.A.P. Water And Sewer Services Ltd.
 14303 - 116 Avenue NW
 Edmonton, AB T5M 4G2

Home **Bus** (780) 453-6996
Cell **Today**
Email

Type
Term Cash

Advisor Bruce Kobyluk **Promised** 01/12/2026 5:30 PM **Tag#** 7128
Shop S1 **Opened** 01/12/2026 10:32 AM **Location**
Priority 14 **Cashiered** **PO #** WS193

License **Odom In** **Odom Out** **In Service Date** **Stock No**
 TBA 244804 244805 05/03/2022 CU507128
Year **Make** **Model** **Model Number** **Colour**
 2022 CHEVROLET SILVERADO 1500 CK10543
Vehicle ID No **Selling Dealer** **Extended Warranty** **Delivery Date**
 3GCUDEET5NG507128 WOLFE CHEVROLET WS193 05/03/2022
Engine DURAMAX 3.0L TURBO-DIESEL I6

Request	Description						Job	CSR	Status
LOF/DEXOS	DEXOS OIL CHANGE						1	C403	Original
Labour	Description							Type	Amount
LOF/DEXOS	DEXOS OIL CHANGE							CS	54.95
Part	Description	Shp	SL	Bin	Type	Price			Amount
19370139	0W20 DEXOS D	7		400402	CQS	23.02			161.14
ENVIRO	HNDL CHG	14			CQS	0.05			0.70
12735608	PF66 FILTER	1		400205	CQS	15.89			15.89
ENVIRO	HNDL CHG	10			CQS	0.05			0.50
Technician	C8279 -								
Cause	GM CDA LOF				Parts Total				178.23
	Oil Service				Labour Total				54.95
Correction	Oil service complete.				Request Sub-total				233.18
	Removed old oil filter.								
	Installed new oil filter								
	Filled with 6.6 L of 0W20 (DIESEL)								
	Oil life was reset to: 100%								
	Oil life before reset: 22%								

Request	Description	Job	CSR	Status
FORMQUICK	Certified Service - Visual Quick Health Check	2	C403	Original
Labour	Description	Type	Amount	
FORMQUICK	VEHICLE QUICK HEALTH CHECK - No Charge	IHEALTH		
Technician	C8279 -			
Cause	Completed Vehicle Health Check			
Correction	Tires filled to psi spec (40 psi) Front tire treads measured (7 /32"), Rear tire treads measured (7 /32"). All lights are good. All fluids are good. Windshield washer fluid topped up Completed vehicle health check inspection form.			

Request	Description	Job	CSR	Status
MENU/AIRPK	Replace Both Engine and Cabin Filters - Replace Both Engine and Cabin Filters	3	C403	Original
Labour	Description	Type	Amount	
MENU/AIRPK	Replace Both Engine and Cabin Filters	CS		

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OW'NG FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THE INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE:



9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO#: 0064931 Tag#: 7128

Check-in: Thu Aug 7, 2025 10:20 AM
Promise Time: Thu Aug 7, 2025 11:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
217,918 Km In / 217,918
Km Out
In Service Date:
04/28/2022

Service Advisor
James
6543
+1 (780) 435 - 4000



Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 228000 kilometers (OEM Recommended)

\$0.00


Services (0)

Inspections (0)

Approved Jobs

- | | | | | |
|---|---------|--|--------------|----------|
| 1. | FORM | INSPECTION FORM ONLY | Internal Pay | \$0.00 |
| Job added by Quick Service Tech on Thu Aug 7, 2025 10:20 AM | | | | |
| 2. | LOFDEXD | LUBE, OIL AND OIL FILTER SERVICE ON DIESEL VEHICLES WITH DEXOS D | Customer Pay | \$194.95 |
| Job added by Quick Service Tech on Thu Aug 7, 2025 10:20 AM | | | | |
| 3. | CABIN | REPLACE CABIN AIR FILTER | Customer Pay | \$60.00 |
| Job added by Quick Service Tech on Thu Aug 7, 2025 10:24 AM | | | | |

POSTED

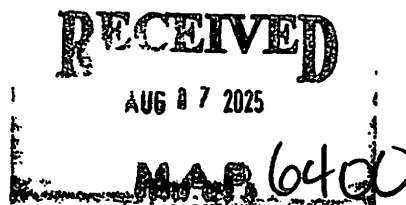



9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO#: 0064931 Tag#: 7128

Check-in: Thu Aug 7, 2025 10:20 AM
Promise Time: Thu Aug 7, 2025 5:00 PM

Customer

M.A.P. WATER AND
SEWER SERVICES LTD

Billing-Customer

Same as Customer

Vehicle

2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor

James
6543
+1 - (780) 435 - 4000

Multi-Point Inspection

Under Hood

Fluid Levels

Engine Oil Level

Engine Cooling System

Power Steering Fluid

Brake Reservoir Fluid

Transmission Fluid

Front Differential Fluid

Rear Differential Fluid

Transfer case

Diesel Exhaust Fluid (DEF)

Diesel Fuel Filter

Windshield Washer Fluid

Reset Oil Life Monitor

Filters & Cooling Systems














Passenger Compartment Air Filter

Engine Air Filter

Battery

Battery Condition

Battery, Cables and Connections



Under Vehicle

Check For Fluid Leaks




Transmission System Leaks

Steering System Leaks

Driveline Service Leaks

Other Services

Exhaust system components



OnStar Diagnostics

OnStar Active

Enrolled in Advanced Diagnostics Report

Enrolled in Dealer Maintenance Notification

Service History/Recall Check



Under Vehicle

Steering/Suspension

Front Suspension Components - Visual Inspection



Rear Suspension Components - Visual Inspection

Check For Fluid Leaks

Engine Oil Leaks

Cooling System Leaks

Brake System Leaks





9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0062984 Tag# : 7128

Check-in: Thu Jul 3, 2025 | 4:24 PM
Promise Time: Thu Jul 3, 2025 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
208,884 Km In / 208,884
Km Out
In Service Date:
04/28/2022

Service Advisor
James
6543
+1 - (780) 435 - 4000



Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 216000 kilometers (OEM Recommended)

\$0.00


Services (0)

Inspections (0)

Approved Jobs

POSTED

- | | | | | |
|--|-------------|--|--------------|----------|
| 1. | FORM | INSPECTION FORM ONLY | Internal Pay | \$0.00 |
| Job added by Quick Service Tech on Thu Jul 3, 2025 4:24 PM | | | | |
| 2. | LOFDEXD | LUBE, OIL AND OIL FILTER SERVICE ON DIESEL VEHICLES WITH DEXOS D | Customer Pay | \$194.95 |
| Job added by Quick Service Tech on Thu Jul 3, 2025 4:24 PM | | | | |
| 3. | DIESELFUEL1 | DIESEL 1/2 TON FUEL FILTER REPLACEMENT | Customer Pay | \$204.64 |
| Job added by Quick Service Tech on Thu Jul 3, 2025 4:30 PM | | | | |

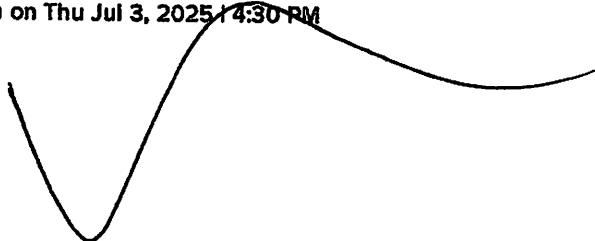



9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0062984 Tag# : 7128

Check-in: Thu Jul 3, 2025 | 4:24 PM

Promise Time: Thu Jul 3, 2025 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor
James
6543
+1 - (780) 435 - 4000

Multi-Point Inspection

Under Hood

Fluid Levels

Engine Oil Level

Engine Cooling System

Power Steering Fluid

Brake Reservoir Fluid

Transmission Fluid

Front Differential Fluid

Rear Differential Fluid

Transfer case

Diesel Exhaust Fluid (DEF)

Diesel Fuel Filter

Windshield Washer Fluid

Reset Oil Life Monitor

Filters & Cooling Systems











Passenger Compartment Air Filter

Engine Air Filter





Battery

Battery Condition

Battery, Cables and Connections



100 %



Under Vehicle

Check For Fluid Leaks





Transmission System Leaks

Steering System Leaks

Driveline Service Leaks

Other Services

Exhaust system components



OnStar Diagnostics

OnStar Active

Enrolled in Advanced Diagnostics Report

Enrolled in Dealer Maintenance Notification

Service History/Recall Check



Under Vehicle

Steering/Suspension

Front Suspension Components - Visual Inspection





Rear Suspension Components - Visual Inspection

Check For Fluid Leaks

Engine Oil Leaks

Cooling System Leaks

Brake System Leaks





9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO#: 0060485 Tag#: 7128

Check-in: Thu May 22, 2025 | 2:35 PM

Promise Time: Thu May 22, 2025 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
198,576 Km In / 198,576
Km Out
In Service Date:
04/28/2022

Service Advisor
Jamie
6538
+1 - (780) 435 - 4000



Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 204000 kilometers (OEM Recommended)

Services (0)

Inspections (0)

41
WS 193
77

\$0.00

Approved Jobs

1.	MPVI	INSPECTION FORM ONLY	Internal Pay	\$0.00
----	------	----------------------	--------------	--------

Job added by Quick Service Tech on Thu May 22, 2025 | 2:35 PM

2.	LOFDEXD	LUBE, OIL AND OIL FILTER SERVICE ON DIESEL VEHICLES WITH DEXOS D	Customer Pay	\$194.95
----	---------	---	--------------	----------

Job added by Quick Service Tech on Thu May 22, 2025 | 2:35 PM

POSTED

RECEIVED

MAY 23 2025

M.A.P. 6100





9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0060485 Tag# : 7128

Check-in: Thu May 22, 2025 | 2:35 PM
Promise Time: Thu May 22, 2025 | 5:00 PM

Customer

M.A.P. WATER AND
SEWER SERVICES LTD
+1 - (780) 777 - 1823

Billing-Customer

Same as Customer

Vehicle

2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor

Jamie
6538
+1 - (780) 435 - 4000

Multi-Point Inspection

Under Hood

Fluid Levels

Engine Oil Level

Engine Cooling System

Power Steering Fluid

Brake Reservoir Fluid

Transmission Fluid

Front Differential Fluid

Rear Differential Fluid

Transfer case

Diesel Exhaust Fluid (DEF)

Diesel Fuel Filter

Windshield Washer Fluid

Reset Oil Life Monitor

Filters & Cooling Systems



















Passenger Compartment Air Filter

Engine Air Filter

Battery

Battery Condition

Battery, Cables and Connections



Under Vehicle

Check For Fluid Leaks





Transmission System Leaks

Steering System Leaks

Driveline Service Leaks

Other Services

Exhaust system components



OnStar Diagnostics

OnStar Active

Enrolled in Advanced Diagnostics Report

Enrolled in Dealer Maintenance Notification

Service History/Recall Check



Under Vehicle

Steering/Suspension

Front Suspension Components - Visual Inspection



Rear Suspension Components - Visual Inspection

Check For Fluid Leaks

Engine Oil Leaks

Cooling System Leaks

Brake System Leaks





Vehicle Health Report

0057143 | Tag# : Q128

Check-in: Tue Mar 25, 2025 | 12:16 PM

Promise Time: Tue Mar 25, 2025 | 5:00 PM

9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Customer
M.A.P. WATER AND
SEWER SERVICES LTDPickup-Customer
Same as CustomerBilling-Customer
Same as Customer14303 116 AVE NW
EDMONTON, AB T6M4G2Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
137,683 Km In / 137,683
Km Out
In Service Date:
04/26/2022Service Advisor
Colin
6786
+1 - (780) 435 - 4000

WS 193

AC

Next Appointment

Please contact the service department to schedule an appointment.

Next Required Maintenance

Recommended Vehicle Maintenance at 192000 kilometers (OEM Recommended)

\$0.00

Services (0)

Inspections (0)

Approved Jobs

POSTED

1. MPVI INSPECTION (FORM ONLY) Internal Pay \$0.00

Job added by Quick Service Tech on Tue Mar 25, 2025 | 12:16 PM

2. LOFDEKD LUBE, OIL AND OIL FILTER SERVICE ON DIESEL
VEHICLES WITH DEXOS D PO# WS193 Customer Pay \$194.95

Job added by Quick Service Tech on Tue Mar 25, 2025 | 12:16 PM

3. LIGHTBULB INSTALL LIGHT BULB PASSENGER PLATE LIGHT Customer Pay \$10.45

Job added by Quick Service Tech on Tue Mar 25, 2025 | 12:16 PM

4. CABIN REPLACE CABIN AIR FILTER Customer Pay \$60.00

Job added by Quick Service Tech on Tue Mar 25, 2025 | 12:23 PM

RECEIVED

MAR 26 2025

M.A.P. 6403





Vehicle Health Report

0057143 | Tag# : Q128

9751 34th Avenue NW
Edmonton, Alberta T6E5X9

Check-in: Tue Mar 25, 2025 | 12:16 PM
Promise Time: Tue Mar 25, 2025 | 5:00 PM

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Customer
M.A.P. WATER AND
SEWER SERVICES LTD
+1 - (780) 777 - 1823

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor
Colin
6786
+1 - (780) 435 - 4000

Multi-Point Inspection

Under Hood

Fluid Levels	☒ ☐ ☐ ☐
Engine Cooling System	☒ ☐ ☐ ☐
Power Steering Fluid	☒ ☐ ☐ ☐
Brake Reservoir Fluid	☒ ☐ ☐ ☐
Transmission Fluid	☒ ☐ ☐ ☐
Front Differential Fluid	☒ ☐ ☐ ☐
Rear Differential Fluid	☒ ☐ ☐ ☐
Transfer Case	☒ ☐ ☐ ☐
Diesel Exhaust Fluid (DEF)	☒ ☐ ☐ ☐
Diesel Fuel Filter	☒ ☐ ☐ ☐
Windshield Washer Fluid	☐
Reset Oil Life Monitor	☐
Filters & Cooling Systems	
Passenger Compartment Air Filter	☒ ☐ ☐ ☐
Engine Air Filter	☒ ☐ ☐ ☐
Battery	
Battery Condition	☒ ☐ ☐ ☐
Battery Cables and Connections	☒ ☐ ☐ ☐

Under Vehicle

Steering/Suspension	
Front Suspension Components	☒ ☐ ☐ ☐
Rear Suspension Components	☒ ☐ ☐ ☐
Check For Fluid Leaks	
Engine Oil Leaks	☒ ☐ ☐ ☐
Cooling System Leaks	☒ ☐ ☐ ☐
Brake System Leaks	☒ ☐ ☐ ☐
Transmission System Leaks	☒ ☐ ☐ ☐
Steering System Leaks	☒ ☐ ☐ ☐

Under Vehicle

Check For Fluid Leaks	☒ ☐ ☐ ☐
Driveline Service Leaks	☒ ☐ ☐ ☐
Other Services	
Exhaust system components	☒ ☐ ☐ ☐

OnStar Diagnostics

OnStar Active	☒ ☐
Enrolled In Advanced Diagnostics Report	☒ ☐
Enrolled In Dealer Maintenance Notification	☒ ☐
Service History/Recall Check	☐



9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

WS 193

XC

Vehicle Health Report

0053214 | Tag# : 7128

Check-in: Tue Jan 7, 2025 | 9:55 AM
Promise Time: Tue Jan 7, 2025 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
177,396 Km In / 177,396
Km Out
In Service Date:
04/28/2022

Service Advisor
Colin
6786
+1 - (780) 435 - 4000



Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 180000 kilometers (OEM Recommended)

RECEIVED
JAN 8 7 2025

\$0.00

Services (0)

Inspections (0)

Approved Jobs

6400.

1. MPVI

INSPECTION FORM ONLY

Internal Pay

\$0.00

Job added by Quick Service Tech on Tue Jan 7, 2025 | 9:55 AM

2. LOFDEXD

LUBE, OIL AND OIL FILTER SERVICE ON DIESEL
VEHICLES WITH DEXOS D

Customer Pay

\$191.14

Job added by Quick Service Tech on Tue Jan 7, 2025 | 9:55 AM

POSTED

Tan



9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

0053214 | Tag# : 7128

Check-in: Tue Jan 7, 2025 | 9:55 AM
Promise Time: Tue Jan 7, 2025 | 5:00 PM

Customer

M.A.P. WATER AND
SEWER SERVICES LTD
+1 - (780) 777 - 1823

Billing-Customer

Same as Customer

Vehicle

2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor

Colin
6786
+1 - (780) 435 - 4000

Multi-Point Inspection

Under Hood

Fluid Levels

Engine Cooling System



Power Steering Fluid



Brake Reservoir Fluid



Transmission Fluid



Front Differential Fluid



Rear Differential Fluid



Transfer case



Diesel Exhaust Fluid (DEF)



Diesel Fuel Filter



Windshield Washer Fluid



Reset Oil Life Monitor



Filters & Cooling Systems

Passenger Compartment Air Filter




Engine Air Filter




Battery

Battery Condition



Battery, Cables and Connections



Under Vehicle

Steering/Suspension

Front Suspension Components



Rear Suspension Components



Check For Fluid Leaks

Engine Oil Leaks



Cooling System Leaks



Brake System Leaks



Transmission System Leaks



Steering System Leaks



Under Vehicle


Check For Fluid Leaks -

Driveline Service Leaks



Other Services

Exhaust system components



OnStar Diagnostics

OnStar Active



Enrolled in Advanced Diagnostics Report



Enrolled in Dealer Maintenance Notification



Service History/Recall Check





Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320
reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO# WG184532

Status
Printed 10/30/2024 6:46:42 AM

SERVICE ORDER CUSTOMER COPY



User C403 Page 1

Customer No	
M.A.P. Water And Sewer Services Ltd. 14303 - 116 Avenue NW Edmonton, AB T5M 4G2	
Home	Bus (780) 453-6996
Cell	Today
Email	
Type	
Term Cash	

Advisor	Bruce Kobylnyk	Promised	10/28/2024 5:30 PM	Tag#	7128
Shop	S1	Opened	10/28/2024 7:31 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	166155	166155	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET GM		05/03/2022	
Engine	DURAMAX 3.0L TURBO-DIESEL I6		WS193	

Request	Description	Job	CSR	Status
LOF/WOLFE	Wolfe Pack Advantage LOF	1	C403	Original

Change engine oil and filter, lube chassis, top up fluids and perform complimentary 15 point visual health inspection

Labour	Description	Type	Amount
LOF/WOLFE	Wolfe Pack Advantage LOF	IWPA	

Change engine oil and filter, lube chassis, top up fluids and perform complimentary 15 point visual health inspection

Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
19370139	0W20 DEXOS D	7		400402	IQS			
ENVIRO	HNDL CHG	14			IQS			
12735608	PF66 FILTER	1		400103	IQS			
ENVIRO	HNDL CHG	10			IQS			
Technician	C91 -							
Cause	lof							
Correction	Change engine oil and filter, lube chassis, top up fluids and perform 15 point inspection - includes up to 6L.							

Request	Description	Job	CSR	Status
FORMCCI	Complete Care Inspection	2	C403	Original
Labour	Description	Type	Amount	
76POINT	76 POINT INSPECTION	CMAP	149.95	
Technician	C91 -			
Cause	Complete Care Inspection			
Correction	Completed inspection, only item found was radiator leaking, front brakes at 7mm, rears at 9mm. Torque wheels to 140 lb ft			
		Labour Total	149.95	
		Request Sub-total	149.95	

Request	Description	Job	CSR	Status				
DFUELFILT	DIESEL FUEL FILTER	3	C403	Original				
Labour	Description	Type	Amount					
DFUELFILT	DIESEL FUEL FILTER	CS	124.85					
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
13539108	FILTER KI	1		290207	CQS	84.30	74.60	74.60
ENVIRO	HNDL CHG	10			CQS	0.05	0.05	0.50

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

TERMS
NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 750585713RT00C1



Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320
reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO# WG184532

Status
Printed 10/30/2024 6:46:43 AM

SERVICE ORDER CUSTOMER COPY



User C403 Page 2

Customer No	
M.A.P. Water And Sewer Services Ltd. 14303 - 116 Avenue NW Edmonton, AB T5M 4G2	
Home	Bus (780) 453-6996
Cell	Today
Email	
Type	Term Cash

Advisor	Bruce Kobylnyk	Promised	10/28/2024 5:30 PM	Tag#	7128
Shop	S1	Opened	10/28/2024 7:31 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	166155	166155	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET GM		05/03/2022	
Engine	DURAMAX 3.0L TURBO-DIESEL I6			

Technician	C91 -	Parts Total	75.10
Cause	DIESEL FUEL FILTER	Labour Total	124.85
Correction	replaced diesel fuel filter and bled system, reset filter life and test, operation ok	Request Sub-total	199.95

Request	Description	Job	CSR	Status
CABIN	REPLACE CABIN AIR FILTER IF NEEDED -if needed	4	C403	Original
Labour	Description		Type	Amount
CABIN	REPLACE CABIN AIR FILTER IF NEEDED -if needed		CMAP	49.95
Part	Description	Shp	SL	Bin
19363960	FILTER	1		250203
Technician	C91 -	Type	Retail	Price
		CG13R	33.84	23.01
Cause	REPLACE CABIN AIR FILTER IF NEEDED -if needed	Parts Total		23.01
Correction	replaced cabin air filter	Labour Total		49.95
		Request Sub-total		72.96

Request	Description	Job	CSR	Status
AIR	REPLACE ENGINE AIR FILTER IF NEEDED. -if needed	5	C403	Original
Labour	Description		Type	Amount
AIR	REPLACE ENGINE AIR FILTER IF NEEDED. -if needed		CMAP	19.95
Part	Description	Shp	SL	Bin
84121219	ELEMENT	1		240202
Technician	C91 -	Type	Retail	Price
		CG13R	68.30	46.44
Cause	REPLACE ENGINE AIR FILTER IF NEEDED. -if needed	Parts Total		46.44
Correction	replaced engine air filter and reset filter life	Labour Total		19.95
		Request Sub-total		66.39

Request	Description	Job	CSR	Status
N242435631	Added Operation/ C8231 Dmac/ 10-28-2024 7:45 Am/ Missed At Write Up/ Serial Data Gateway Module & Radio	6	C8231	Approved
Labour	Description		Type	Amount
N242435631	Added Operation/ C8231 Dmac/ 10-28-2024 7:45 Am/ Missed At Write Up/ Serial Data Gateway Module & Radio		W	
Technician	C185 -			
Cause	80YZ242414546 0SYY242417378			
Correction	Reprogrammed serial data gateway module as well as radio (USB and SPS). 9107386 (1.0)			

Request	Description	Job	CSR	Status
GENERAL	found radiator leaking	7	C403	Approved

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

TERMS
NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE


ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 750585713RT0001

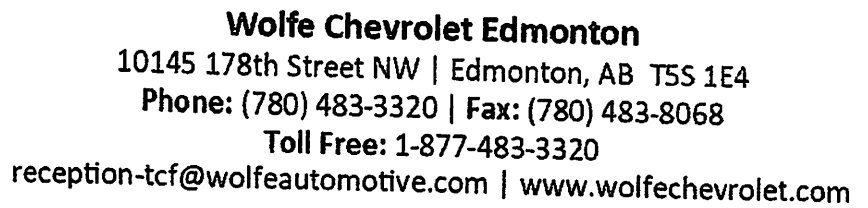

Status
Printed 10/30/2024 6:46:43 AM

(S) [REDACTED]

Customer No

M.A.P. Water And Sewer Services Ltd.
14303 - 116 Avenue NW
Edmonton, AB T5M 4G2

Home **Bus** **(780) 453-6996**
Cell **Today**
Email

Type
Term Cash

Advisor	Bruce Kobylnyk	Promised	10/28/2024 5:30 PM	Tag#	7128
Shop	S1	Opened	10/28/2024 7:31 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	166155	166155	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET GM			
Engine	DURAMAX 3.0L TURBO-DIESEL I6	WS193		05/03/2022

Labour	Description	Shp	SL	Bin	Type	Retall	Type CMAP	Amount
GENERAL	found radiator leaking							1,466.25
Part	Description	Shp	SL	Bin	Type	Retall	Price	Amount
86785339	RADIATOR	1			CG13R	607.42	413.05	413.05
EDM								
10953464	COOLANT	2		320101	CG13R		29.28	58.56
STK								
Technician	C91 -							
Cause	found radiator leaking				Parts Total			471.61
Correction	Disassemble vehicle in order to access radiator. (had to cut wires for lights in front grille). replace leaking radiator and reassemble entire vehicle including splicing cut wires together for grille lights, add coolant to engine cooling system as well as intercooler system and bleed air from both systems, recharge r1234yf system with removed charge and torque front wheels to 140 lb ft. Wash off repair area and start engine. No more coolant leak observed, coolant levels ok. Road test, vehicle operation ok at this time				Labour Total			1,466.25
					Request Sub-total			1,937.86

Labour	1,810.95
Parts	616.16
Supplies	100.00
Sub-Total	2,527.11
GST	126.36
Total Invoice	2,653.47


POSTED

TERMS

**NO REFUNDS WITHOUT
THIS INVOICE.**

DEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

G.S.T # 750585713RT00CL



Certified Service Complete Care Inspection

NAME: M.A.P. Water And Sewer Services YEAR/MODEL: 2022 SILVERADO 1500 DATE: 10/28/2024 7:31:57 AM
Ltd.
CO #: WG184532 VIN (LAST 8) 3GCUDEET5NG507128 ODOMETER: 166155 LIC. PLATE #: TBA

SERVICE ADVISOR: Bruce Kobylnyk TECHNICIAN: Andrew Carson

GREEN: CHECKED AND OK YELLOW: FUTURE ATTENTION REQUIRED RED: IMMEDIATE ATTENTION REQUIRED

ROADTEST

ENGINE NOISE	☒	☐	☐	N/A	BRAKES NOISE	☒	☐	☐	N/A
ENGINE PERFORMANCE	☒	☐	☐	N/A	BRAKE PERFORMANCE	☒	☐	☐	N/A
DRIVELINE VIBRATION	☒	☐	☐	N/A	CRUISE CONTROL FUNCTION	☒	☐	☐	N/A
DRIVELINE NOISE	☒	☐	☐	N/A					

LEFT FRONT

RIGHT FRONT

☒ ☐ ☐	BRAKE LINING	7 /MM	☒ ☐ ☐	BRAKE LINING	7 /MM
☒ ☐ ☐	ROTOR/DRUM		☒ ☐ ☐	ROTOR/DRUM	
☒ ☐ ☐	TREAD DEPTH	10 /32NDS	☒ ☐ ☐	TREAD DEPTH	10 /32NDS
☒ ☐ ☐	WEAR PATTERN		☒ ☐ ☐	WEAR PATTERN	

LEFT REAR

RIGHT REAR

☒ ☐ ☐	BRAKE LINING	9 /MM	☒ ☐ ☐	BRAKE LINING	9 /MM
☒ ☐ ☐	ROTOR/DRUM		☒ ☐ ☐	ROTOR/DRUM	
☒ ☐ ☐	TREAD DEPTH	10 /32NDS	☒ ☐ ☐	TREAD DEPTH	10 /32NDS
☒ ☐ ☐	WEAR PATTERN		☒ ☐ ☐	WEAR PATTERN	

GREEN: 6MM OR MORE YELLOW: 5MM - 4MM RED: 3MM OR LESS

GREEN: 6/32NDS + YELLOW: 5/32NDS - 4/32NDS RED: 3/32NDS OR LESS OR UNEVEN WEAR / DAMAGE

TIRES


ALIGNMENT	☒	☐	☐	N/A	LUG NUTS	☒	☐	☐	N/A
TPMS SENSORS	☒	☐	☐	N/A	SPARE TIRE HOIST	☒	☐	☐	N/A

BRAKES

POWER ASSIST OPERATION	☒	☐	☐	N/A	BRAKE FLUID (LEAKS)	☒	☐	☐	N/A
BRAKE LINES AND CABLES	☒	☐	☐	N/A	- CONDITION	☒	☐	☐	N/A
BRAKE CALIPER OPERATION	☒	☐	☐	N/A	EMERGENCY / PARK BRAKE	☒	☐	☐	N/A

STEERING AND SUSPENSION

ALL JOINTS - LEFT	☒	☐	☐	N/A	SHOCKS / STRUTS - FRONT	☒	☐	☐	N/A
ALL JOINTS - RIGHT	☒	☐	☐	N/A	SHOCKS / STRUTS - REAR	☒	☐	☐	N/A
CONTROL ARM BUSHINGS	☒	☐	☐	N/A	STEERING GEAR (LEAKS)	☒	☐	☐	N/A
STEERING ROD ENDS	☒	☐	☐	N/A	P/S PUMP / HOSE (LEAKS)	☒	☐	☐	N/A
STEERING MAN / IDLER ARM	☒	☐	☐	N/A	SWAY BAR FASTENER - FRONT	☒	☐	☐	N/A
SWAY BAR BUSHINGS	☒	☐	☐	N/A	SWAY BAR FASTENER - REAR	☒	☐	☐	N/A

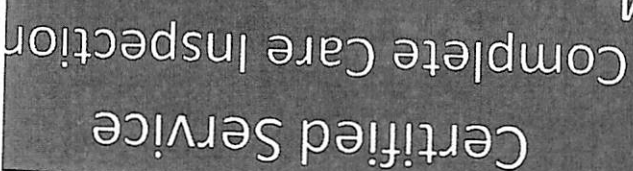

OFFLER	☒	☐	☐	N/A	HANGERS / CLAMPS	☒	☐	☐	N/A	EXHAUST LEAKS	☒	☐	☐	N/A
(HAUST PIPES	☒	☐	☐	N/A	HANGERS / CLAMPS	☒	☐	☐	N/A	EXHAUST LEAKS	☒	☐	☐	N/A

[illegible][illegible]

N/A	●	○	●	N/A	INTERIOR LIGHT	N/A	●	○	●	HEADLIGHT - LOW BEAM
N/A	●	○	●	N/A	INTERIOR LIGHT	N/A	●	○	●	HEADLIGHT - LOW BEAM

ATER MOTOR	☒	☐	☐	N/A	MODE DOORS	☐	☐	☐	N/A
CENTRAL CONTROL									

N SPEED					N/A	COMPRESSOR OPERATION				N/A
---------	--	--	--	--	-----	----------------------	--	--	--	-----

ADDITIONAL SERVICES

N/A			BEAN AND LUBRICATE SUNROOF TRACKS AND CHECK OPERATION
N/A			REPLACE WEAR STRIPS, CHASSIS COMPONENTS

N/A			CHECK FOR OPEN RECALLS
N/A		X	WASH STATE TIRES
N/A		X	AN FOR CURRENT DIAGNOSTIC TROUBLE CODES



Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320
reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO# WG182658

Status
Printed 10/28/2024 4:05:32 PM

SERVICE ORDER CUSTOMER COPY



User C403 Page 1

Customer No	
M.A.P. Water And Sewer Services Ltd. 14303 - 116 Avenue NW Edmonton, AB T5M 4G2	
Home	Bus (780) 453-6996
Cell	Today
Email	
Type	Cash

Advisor	Bruce Kobylnyk	Promised	09/11/2024 5:30 PM	Tag#	7128
Shop	S1	Opened	09/11/2024 6:21 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	154212	154214	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET GM		05/03/2022	
Engine	DURAMAX 3.0L TURBO-DIESEL I6		WS193	

Request	Description	Job	CSR	Status
LOF/WOLFE	Wolfe Pack Advantage LOF	1	C403	Original

Change engine oil and filter, lube chassis, top up fluids and perform complimentary 15 point visual health inspection

Labour	Description	Type	Amount
LOF/WOLFE	Wolfe Pack Advantage LOF	IWPA	

Change engine oil and filter, lube chassis, top up fluids and perform complimentary 15 point visual health inspection

Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
19370139	0W20 DEXOS D	7		400402	IQS			
ENVIRO	HNDL CHG	14			IQS			
12735608	PF66 FILTER	1		400103	IQS			
ENVIRO	HNDL CHG	10			IQS			
Technician	C8098 -							
Cause	Oil and Filter Change							
Correction	Changed oil and filter, reset oil life monitor. Verified proper fill level							

Request	Description	Job	CSR	Status
FORMMPVI	Certified Service - Multipoint Vehicle Health Inspection	2	C403	Original
Labour	Description	Type	Amount	
MPVI	Multipoint Vehicle Health Check as required by your Owners Manual every 12,000 km - a comprehensive assessment of your vehicle including: Tires Rotation and Inspection; Brake Inspection; Systems, Fluids & Visible Leak Inspection; Battery Condition and voltage test; Visible & Functional Inspections including: exhaust, driveline, steering and suspension components, belts and hoses; Lubrication of Chassis, Weatherstripping, Door Hinges, Lock Cylinders.	CMAP	89.95	
Technician	C8098 -			
Labour Total				89.95
Request Sub-total				89.95

Request	Description	Job	CSR	Status				
MENU/DRIVE	DRIVELINE- Replace Driveline Fluid including: Front Differential, Rear Differential and Transfer Case	3	C403	Original				
Labour	Description	Type	Amount					
DRIVELINE		CS						
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

TERMS
NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 750585713RT0001



Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320
reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO# WG182658

Status
Printed 10/28/2024 4:05:32 PM

SERVICE ORDER CUSTOMER COPY



User C403 Page 2

Customer No	
M.A.P. Water And Sewer Services Ltd. 14303 - 116 Avenue NW Edmonton, AB T5M 4G2	
Home	Bus (780) 453-6996
Cell	Today
Email	
Type	Term Cash

Advisor	Bruce Kobylnyk	Promised	09/11/2024 5:30 PM	Tag#	7128
Shop	S1	Opened	09/11/2024 6:21 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	154212	154214	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET GM		05/03/2022	
Engine	DURAMAX 3.0L TURBO-DIESEL I6		WS193	

19421425	DEX6 ATF X 1L	2	400401	CQS	WS193	
ENVIRO	HNDL CHG	4		CQS		
89021678	75W90 LUBE	5	400302	CQS		
ENVIRO	HNDL CHG	10		CQS		
Technician	C8098 -			CQS		
Cause	REPLACE WORN OUT, OXIDIZED DIFFERENTIAL AND TRANSFER CASE				Request Sub-total	599.95

Request	Description	Job	CSR	Status
GENERAL	inspect and report engine oil leak cust was told leak around oil pan	4	C403	Original
Labour	Description	Type	Amount	
GENERAL	inspect and report engine oil leak cust was told leak around oil pan	C403		
Technician	C8098 -	C403		
Cause	Inspected underside of vehicle, no signs of engine oil leaking around pan. Inspected the rest of underside for any other leaks, none found.	C403		
Correction	No fault found	C403		

Request	Description	Job	CSR	Status
AIR	REPLACE ENGINE AIR FILTER -if needed	5	C403	Original
Labour	Description	Type	Amount	
AIR	REPLACE ENGINE AIR FILTER -if needed	C403		
Technician	C8098 -	C403		
Cause	Inspect engine air filter	C403		
Correction	Inspected filter, filter does not require replacement at this time	C403		

Request	Description	Job	CSR	Status
CABIN	REPLACE CABIN AIR FILTER -if needed	6	C403	Original
Labour	Description	Type	Amount	
CABIN	REPLACE CABIN AIR FILTER -if needed	C403		
		C403	49.95	

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

TERMS
NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 750585713RT0001



Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320
reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO# WG182658

Status
Printed 10/28/2024 4:05:32 PM

SERVICE ORDER CUSTOMER COPY



User C403 Page 3

Customer No
M.A.P. Water And Sewer Services Ltd.
14303 - 116 Avenue NW
Edmonton, AB T5M 4G2

Home **Bus** (780) 453-6996
Cell **Today**
Email

Type
Term Cash

Advisor	Bruce Kobylnyk	Promised	09/11/2024 5:30 PM	Tag#	7128
Shop	S1	Opened	09/11/2024 6:21 AM	Location	
Priority	4	Cashiered		PO #	WS193

License	Odom In	Odom Out	In Service Date	Stock No
TBA	154212	154214	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GCUDEET5NG507128	WOLFE CHEVROLET GM	WS193	05/03/2022	
Engine	DURAMAX 3.0L TURBO-DIESEL I6			

Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
19363960	FILTER	1		250203	CG13R	33.84	23.01	23.01
Technician	C8098 -				Parts Total			23.01
Cause	Inspect cabin filter				Labour Total			49.95
Correction	Inspected cabin filter, cabin filter has large amounts of dust. Replaced cabin filter				Request Sub-total			72.96

Request	Description	Job	CSR	Status
ALIGN/4W	4 WHEEL ALIGNMENT	7	C403	Approved
Labour	Description	Type	Amount	
ALIGN/4W	4 WHEEL ALIGNMENT	CS	199.95	
Technician	C8098 -			
Cause	4 Wheel Alignment			
Correction	Inspected alignment, found front end outside of spec. Adjusted front camber, caster, and toe back into spec to reduce tire wear. Verified straight driving on short road test			
			Labour Total	199.95
			Request Sub-total	199.95

Request	Description						Job	CSR	Status
TRIM	REPLACE MLD DR'S FRT DOOR						8	C403	Approved
Labour	Description							Type	Amount
TRIM	REPLACE MLD DR'S FRT DOOR							C403	76.50
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount	
84842462	MOLDING	1		#182588	CG13R	95.69	75.07	75.07	
Technician	C8057 -								75.07
Cause	Replaced drivers door window belt molding.							Parts Total	75.07
Correction	Installed new drivers front side door window belt reveal molding.							Labour Total	76.50
								Request Sub-total	151.57
vehicle has gmpp									

vehicle has gmp

POSTED

Labour 731.35
Parts 383.03
Supplies 0.00
Sub-Total 1,114.38
GST 55.72
Total Invoice 1,170.10

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

TERMS
NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE


ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 750585713RT0001

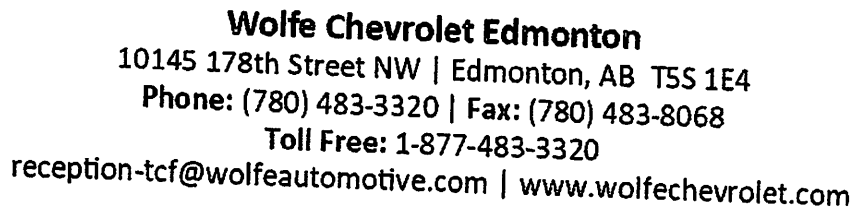

Printed 05/21/2024 1:48:29 PM

SECRET

License	Odom In	Odom Out	In Service Date	Stock No
TBA	129480	129481	05/03/2022	CU507128
Year	Make	Model	Model Number	Colour
2022	CHEVROLET	SILVERADO 1500	CK10543	NORTHSKY
Vehicle ID No	Selling Dealer	Extended Warranty		Delivery Date
3GCUDEET5NG507128	WOLFE CHEVROLET GM			05/03/2022
Engine	DURAMAX 3.0L TURBO-DIESEL I6		WS193	

Request	Description	Job	CSR	Status
TRIM	inspect and report radio volume increases while driving	3	C403	Original
Labour	Description		Type	Amount
TRIM	inspect and report radio volume increases while driving		WGMPPT	
Technician	C8057 -			
Cause	Checked radio for updates. Radio USB transfer is required. Has current version W158E-W164.4.2.			

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

**NO REFUNDS WITHOUT
THIS INVOICE.**

DEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

G S T # 7505867135 TC CC:



Wolfe Chevrolet Edmonton
10145 178th Street NW | Edmonton, AB T5S 1E4
Phone: (780) 483-3320 | Fax: (780) 483-8068
Toll Free: 1-877-483-3320
reception-tcf@wolfeautomotive.com | www.wolfechevrolet.com

SO# WG178347

Printed 05/21/2024 1:48:40 PM

SERVICE ORDER CUSTOMER COPY



User C403 Page 2

Customer No	
M.A.P. Water And Sewer Services Ltd. 14303 - 116 Avenue Edmonton, AB T5M 4G2	
Home	Bus 453-6996
Cell	Today
Email	
Term Cash	

Advisor Bruce Kobyluk	Promised 05/16/2024 5:30 PM	Tag# 7128
Shop S1	Opened 05/16/2024 1:12 PM	Location
Priority 4	Cashiered	PO # WS193

License TBA	Odom In 129480	Odom Out 129481	In Service Date 05/03/2022	Stock No CU507128
Year 2022	Make CHEVROLET	Model SILVERADO 1500	Model Number CK10543	Colour NORTHSKY
Vehicle ID No 3GCUDEET5NG507128	Selling Dealer WOLFE CHEVROLET GM	Extended Warranty WS193	Delivery Date 05/03/2022	
Engine DURAMAX 3.0L TURBO-DIESEL I6				

Correction Updated radio USB using SPS.
Warranty claim code - 80YZ216541508
Version is up to date with W206E-Y171.4.2

Request	Description	Job	CSR	Status				
N232426400	Tailgate may open unexpectedly 9107323 Exterior Release Switch Replacement - .3 Standard tailgate - .4 Multipro tailgate	4	C403	Approved				
Labour	Description	Type	Amount					
N232426400	Tailgate may open unexpectedly 9107323 Exterior Release Switch Replacement - .3 Standard tailgate - .4 Multipro tailgate	W						
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
85734717	SWITCH	1		270501	W			
Technician	C8057 -							
Cause	Completed							
Correction	Replaced tailgate exterior switch. Verified tailgate is operating.							

Request	Description						Job	CSR	Status
CABIN	REPLACE CABIN AIR FILTER						5	C403	Approved
Labour	Description							Type	Amount
CABIN	REPLACE CABIN AIR FILTER							CMAP	49.95
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount	
19363960	FILTER	1		250203	CG13R	33.43	22.73	22.73	
Technician	C8075 -								
Cause	REPLACE CABIN AIR FILTER							Parts Total	22 73
Correction	Replaced dirty cabin air filter.							Labour Total	49.95
					Request Sub-total				72.68

Labour	245.63
Parts	96.95
Supplies	0.00
Warr Deductible	99.00
Sub-Total	441.58
GST	22.08
Total Invoice	463.66

POSTED

Westgate Chevrolet (2018) Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

ALL CHARGES DUE UPON
RECEIPT OF STATEMENT.

NO REFUNDS OR EXCHANGE ON STOCKED
PARTS AFTER 30 DAYS OR SPECIAL ORDERS.

TERMS
NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR
SPECIAL ORDERS.

20% HANDLING CHARGE ON ALL
ACCEPTABLE RETURNS.

NO REFUNDS WITHOUT
THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S
(EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER
DETAILS.

INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF MONEY BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS &
ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE
CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 750385712 (27000)

9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0042062 | Tag# : 7128

Check-in: Tue Jun 11, 2024 | 11:15 AM

Promise Time: Tue Jun 11, 2024 | 5:00 PM

Customer M.A.P. WATER AND SEWER SERVICES LTD 7 - 14303 116 AVE NW EDMONTON, AB T5M4G2	Pickup-Customer Same as Customer Billing-Customer Same as Customer	Vehicle 2022 Chevrolet Silverado 1500 3GCUDEET5NG507128 134,356 Km In / 134,356 Km Out In Service: 2022-04-28	Service Advisor Colin 6786 (780) 435 - 4000
---	---	--	---

Post WSA 93
AL

Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 144000 kilometers (OEM Recommended)

Services (0)

Inspections (0)

General Motors is going
to email you our report card.
If for any reason you cannot fill
it out "Completely Satisfied" Please
contact our service management
team at 780-435-4000 or
service@capitalgmcbuick.ca

Approved Jobs

POSTED

1.	MPVI	INSPECTION FORM ONLY	Internal Pay	\$0.00
Job added by Quick Service Tech on Tue Jun 11, 2024 11:15 AM				
2.	LOFDEXD	LUBE, OIL AND OIL FILTER SERVICE ON VEHICLES TO 8L DEXOS	Customer Pay	\$194.95
Job added by Quick Service Tech on Tue Jun 11, 2024 11:15 AM				
3.	CABIN	REPLACE CABIN AIR FILTER	Customer Pay	\$60.00
Job added by Quick Service Tech on Tue Jun 11, 2024 11:22 AM				
4.	DRIVE	FULL DRIVELINE SERVICE	Customer Pay	\$384.95
Job added by Quick Service Tech on Tue Jun 11, 2024 11:27 AM				





General Motors of Canada Company
500 Wentworth Street W
Oshawa, Ontario L1J 0C5



May 2024



SAFETY RECALL / RAPPEL DE SÉCURITÉ

N232426400 3GCUDEET5NG507128 14 0023956
M A P WATER AND SEWER SERVICES LTD
14303 116 AVE NW
EDMONTON AB T5M 4G2



WJ193
Done
MAY 14/24
(70)

This notice applies to your vehicle, **VIN: 3GCUDEET5NG507128**.

Your vehicle is involved in **SAFETY RECALL N232426400**.
Transport Canada Recall # 2024-061

Dear M A P Water And Sewer Services Ltd:

This notice is sent to you in accordance with the requirements of the *Motor Vehicle Safety Act*. This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2022 model year Chevrolet Silverado vehicles equipped with power-unlatching tailgates. As a result, GM is conducting a safety recall.

Previously, you were notified that your 2022 model year Chevrolet Silverado vehicle was involved in GM Recall N232426400. This letter is to inform you that parts are now available to repair your vehicle.

IMPORTANT

- Your vehicle is involved in GM recall N232426400.
- Schedule an appointment with your General Motors dealer.
- This service will be performed for you at **no charge**.
- Until the recall is completed, owners should check that the tailgate closed and latched before driving.

Why is your vehicle being recalled?

Under certain conditions water may intrude into these vehicles' tailgates and come into contact with the electronic gate-release switch, potentially causing a short circuit. The gate may inadvertently unlatch while the vehicle is in Park. If the driver does not manually close the gate before beginning a drive, cargo in the bed of the truck may exit the vehicle and become a road hazard, increasing the risk of a crash. Until the recall is completed, owners should check that the tailgate closed and latched before driving.

What will we do?

Your General Motors dealer will replace the exterior touchpad switch assemblies. This service will be performed for you at **no charge**. Because of service scheduling requirements, it is likely that your dealer will need your vehicle longer than the actual service correction time of approximately 30 minutes.

9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

RO# : 0039443 | Tag# : 7128

Check-in: Mon Apr 22, 2024 | 1:29 PM

Promise Time: Mon Apr 22, 2024 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
124,256 Km In / 124,256
Km Out
In Service: 2022-04-28

Service Advisor
Colin
6786
(780) 435 - 4000



Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 132000 kilometers (OEM Recommended)

Services (0)

Inspections (0)

RECEIVED
APR 24 2024

MAR 6400

WS 173
XL

\$0.00

Approved Jobs

1. MPVI INSPECTION FORM ONLY

Internal Pay \$0.00

Job added by Quick Service Tech on Mon Apr 22, 2024 | 1:29 PM

2. LOFDEXD LUBE, OIL AND OIL FILTER SERVICE ON VEHICLES TO 8L DEXOS

Customer Pay \$194.95

Job added by Quick Service Tech on Mon Apr 22, 2024 | 1:29 PM

POSTED

General Motors is going to email you our report card. If for any reason you cannot fill it out "Completely Satisfied" Please contact our service management team at 780-435-4000 or service@capitalgmc buick.ca

Labor \$36.65

Parts \$153.30

Sublet Labor \$0.00

Sublet Parts \$0.00

Fees \$10.49

Discounts \$0.00

Tax - GST \$10.02

Deductible \$0.00

Insurance/Warranty \$0.00

Original Repair Order
Mon Apr 22, 2024 | 1:29 PM \$138.01

Invoice Total \$210.46



9751 34th Avenue NW
Edmonton, Alberta T6E5X9
9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Vehicle Health Report

RO# : 0036501 | Tag# : 7128
Check-in: Tue Feb 27, 2024 | 12:21 PM
Promise Time: Tue Feb 27, 2024 | 5:00 PM

Customer
M.A.P. WATER AND
SEWER SERVICES LTD

14303 116 AVE NW
EDMONTON, AB T5M4G2

Pickup-Customer
Same as Customer

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128
114,852 Km In / 114,852
Km Out
In Service: 2022-04-28

Service Advisor
Jamie
6538
(780) 435 - 4000

WS 193 XL



Next Appointment

Please contact the service department to schedule an appointment.



Next Required Maintenance

Recommended Vehicle Maintenance at 120000 kilometers (OEM Recommended)

\$0.00

Services (0)

Inspections (0)

Approved Jobs

POSTED

RECEIVED
FEB 27 2024
MAR 6 400

1. MPVI INSPECTION FORM ONLY

Job added by Quick Service Tech on Tue Feb 27, 2024 | 12:21 PM

Internal Pay \$0.00

2. LOFDEXD LUBE, OIL AND OIL FILTER SERVICE ON DIESEL VEHICLES WITH DEXOS D

Customer Pay \$194.95

Job added by Quick Service Tech on Tue Feb 27, 2024 | 12:21 PM

General Motors is going to email you our report card. If for any reason you cannot fill it out "Completely Satisfied" Please contact our service management team at 780-435-4000 or service@capitalgmcbuick.ca

Labor	\$43.76
Parts	\$146.19
Sublet Labor	\$0.00
Sublet Parts	\$0.00
Fees	\$11.56
Discounts	\$0.00
Tax - GST	\$10.07
Deductible	\$0.00
Insurance/Warranty	\$0.00
Invoice Total	\$211.58

Original Repair Order
Tue Feb 27, 2024 | 12:21 PM \$53.48



9751 34th Avenue NW
Edmonton, Alberta T6E5X9

9751 34th Avenue Edmonton, AB T6E 5X9 (780) 435-4000

Customer
M.A.P. WATER AND
SEWER SERVICES LTD
(780) 777 - 1823

Billing-Customer
Same as Customer

Vehicle
2022 Chevrolet
Silverado 1500
3GCUDEET5NG507128

Service Advisor
Jamie
6538
(780) 435 - 4000

Vehicle Health Report

RO# : 0036501 | Tag# : 7128

Check-in: Tue Feb 27, 2024 | 12:21 PM

Promise Time: Tue Feb 27, 2024 | 5:00 PM

Multi-Point Inspection

Under Vehicle

Other Services

Exhaust system components




OnStar Diagnostics

OnStar Active

Enrolled in Advanced Diagnostics Report

Enrolled in Dealer Maintenance Notification

Service History/Recall Check



Inspection range information

Tread Depth - Left Front Range:

6/32" - 100/32" 0/32" - 3/32" 4/32" - 5/32"

Tread Depth - Right Front Range:

6/32" - 100/32" 0/32" - 3/32" 4/32" - 5/32"

Tread Depth - Left Rear Range:

6/32" - 100/32" 0/32" - 3/32" 4/32" - 5/32"

Tread Depth - Right Rear Range:

6/32" - 100/32" 0/32" - 3/32" 4/32" - 5/32"

Tire Pressure, Condition & Age - Front Tire Pressure Range:

35psi - 100psi 0psi - 30psi 31psi - 34psi

Tire Pressure, Condition & Age - Rear Tire Pressure Range:

35psi - 100psi 0psi - 30psi 31psi - 34psi

Fluid Levels - Diesel Fuel Filter Range:

41% - 100% 0% - 10% 11% - 40%

Inspection Notes

Windshield Condition (Cracks, Chips and Pitting)
windshield cracked





General Motors of Canada Company
500 Wentworth Street W
Oshawa, Ontario L1J 0C5



SAFETY RECALL / RAPPEL DE SÉCURITÉ

N232431050 3GCUDEET5NG507128 14 0003568
M A P WATER AND SEWER SERVICES LTD
14303 116 AVE NW
EDMONTON AB T5M 4G2

Done April 5/24
March 2024
RECEIVED
APR 04 2024
M.A.P.
WS193 John Z

This notice applies to your vehicle, VIN: **3GCUDEET5NG507128**.

Your vehicle is involved in **NON-COMPLIANCE RECALL** N232431050.
Transport Canada Recall # 2024-060

Dear M A P Water And Sewer Services Ltd:

This notice is sent to you in accordance with the requirements of the *Motor Vehicle Safety Act*. This is to inform you that your vehicle may be non-compliant with the requirements of the *Motor Vehicle Safety Regulations* and that the non-compliance could affect the safety of a person.

General Motors has decided that certain 2022 model year Chevrolet Silverado vehicles may not conform to sections (19), (28), and (30)(c) of Canada Motor Vehicle Safety Standard (CMVSS) No. 108, "Lighting Systems and Reflective Devices". As a result, GM is conducting a recall.

I M P O R T A N T

- Your vehicle is involved in GM recall N232431050.
- Schedule an appointment with your General Motors dealer or Authorized Servicer.
- This service will be performed for you at **no charge**.
- Until the recall remedy is completed, drivers can ensure the manual lighting switch (MLS) is in the AUTO position prior to driving.

Why is your vehicle being recalled?

The standard requires daytime running lights (DRLs) to be active if the vehicle is operated at the prescribed speed or have traveled the prescribed distance, unless lower beam headlamps are activated. Lower beam headlamps should automatically reactivate at a prescribed lux value during dark/night conditions. In these vehicles, both the DRLs and lower beam headlamps may not activate under the prescribed conditions when the manual lighting switch is in OFF or PARKING LAMP mode. During that time, the vehicle could be less visible, increasing the risk of a crash.

What will we do?

Your General Motors dealer or Authorized Servicer will update the software in your vehicles' Body Control Module (BCM) to correct the condition. This service will be performed for you at **no charge**. Because of service scheduling requirements, it is likely that your dealer or servicer will need your vehicle longer than the actual service correction time of approximately 35 minutes.

**What should
you do?**

You should contact your General Motors dealer or Authorized Servicer to arrange a service appointment as soon as possible.

If your vehicle is an EV, when scheduling your appointment, confirm with the dealer that they are an EV certified dealer.

Until the recall remedy is completed, drivers can ensure the manual lighting switch (MLS) is in the AUTO position prior to driving.

**Do you have
questions?**

If you have questions or concerns that your dealer is unable to resolve, please contact GM Canada Customer Care at 1-800-263-3777 (English and French service available).

For **Chevrolet EV** vehicle owners, please contact the EV Chevrolet Concierge team at 1-833-EVCHEVY (1-833-382-4389) (English and French service available).

For **GMC HUMMER EV** vehicle owners, please contact the EV HUMMER Concierge team at 1-833-EVHUMMER (1-833-486-6373) (English and French service available).

For **Cadillac LYRIQ** vehicle owners, please contact the EV Cadillac Concierge team at 1-844-EVCADILLAC (1-844-382-2345) (English and French service available).

Hours of operation for the contact numbers listed above: Monday to Friday (8:00am to 9:00pm) & Saturday (8:00am to 5:00pm) ET.

For BrightDrop Zevo vehicle owners, please contact BrightDrop Contact Centre at 1-888-987-4377 (English and French service available).

Hours of operation for BrightDrop Contact Centre: Monday to Friday (8:00am to 8:00pm ET) & on call hours for the weekend.

This letter identifies your vehicle. Presentation of this letter to your dealer will assist their Service personnel in completing the necessary correction to your vehicle in the shortest possible time. You can also check the status of any other possible recall and/or program for your vehicle at <https://experience.gm.ca/en/ownercenter/recalls>.

You may be contacted by a dealer other than the dealer who sold or is currently servicing your vehicle. Please be advised that you may take your vehicle to the General Motors dealership or Authorized Servicer of your choice to have the recall service work completed.

The *Motor Vehicle Safety Regulations* require that if the vehicle's current owner has leased the vehicle, the owner shall send to the lessee a copy of the notice and any subsequent notice within 10 working days after the day on which the notice is received.

We apologize for this inconvenience. However, we are concerned about your safety and continued satisfaction with our products.

Customer Care and Aftersales
General Motors of Canada Company
GM N232431050