

External Visual Inspections (D1281)

Inspection Date : 2026-09-02

003-2

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93

Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Tank

Ser. No.	D1281	Unit Number	B7621
TC Spec.	TC 407	Service Type	Dedicated Service
Date of mfr.	2014-05-00	Cert. date	2014-05-00
VIN	972784	Tank mfr.	Brenner
MDIN	Blr0002722	MAWP	25 psi
Test P.	45 psi	Mfd. head thick	.180 in
Min. head thick	.129 in	Mfd. shell thick	.157 in
Min. shell thick	.129 in	Exposed Surface	538 ft2
Cap.	5500 gallons	Design Temp. Range	-20 F to 150 F
Max. Lading Density	1.5 kg/L	Shell Material	SA240 T316
Head Material	SA240 T316	Weld Material	T316L
Max. Payload	16566 kg	Max. Load Rate	500 gal/m at 25 psi
Max. Unload Rate	500 gal/m at 25 psi	Original Test Date	2014-05-00

External Visual Inspection

Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Manway Pressure	75 psi		

Inspection

Inspect jacketing for dents, digs, scrapes, gouges, perforations, stains, or other defects or signs of damage to the inner vessel or any other condition that might make it unsafe as per 7.2.1(a)

Not Applicable

Inspect the entire area of head and shell for dents, gouges, bulges, corrosion, abrasion, cracks, or signs of leakage or other conditions that might render it unsafe for transport as per 7.2.1(a)

Pass

Inspect the entire length of every weld for cracks, defects or signs of leakage as per 7.2.1(a)

Pass

Ensure devices for tightening manhole covers are operative and covers are leak tight as per 7.2.1(b)

Pass

Check all valves, vents, emergency devices and remote closures for corrosion, distortion, cracks, signs of weakness and loose or missing fasteners as per 7.2.1(c)

Pass

Ensure all required markings are legible including manway, PRV, couplings, valves and specification plate as per 7.2.1(e)

Pass

Inspect supporting structures, pads, bolsters, tie-downs and protective devices for dents, distortion, cracks, signs of weakness and loose or missing fasteners as per 7.2.1(f)

Pass

Ensure accompanying or mounted hoses comply with inspection and marking requirements as per 7.2.10.4 and 7.2.10.6

Pass

Check to ensure voids are unplugged and show no signs of leakage as per 7.2.1.2

Pass

Corroded or abraded areas are thickness tested as per 7.2.1.3

Not Applicable

All pressure relief devices are inspected for corrosion or damage as per 7.2.1.4

Pass

If lading is corrosive to PRV: re-closing pressure relief valves are replaced or tested as per 7.2.1.4(b)

Not Applicable

Gaskets on full opening rear head is inspected and replaced if cut, cracked or split as per 7.2.1.5

Not Applicable

Internal self closing valve and off truck emergency shut down system tested as per 7.2.1.6

Not Applicable

Ensure that all bolts or nuts on any flanged connection or blank flange are in place and properly tightened

Pass

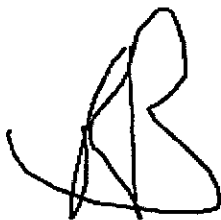
Defects

No defects found.

Tank Disposition

Current Disposition	Passed / No Defects Found
---------------------	---------------------------

Approval



Inspector

Signed by Richard Beeler

Tester

Signed by Richard Beeler

Service provided by **eStandardSolutions**

Leakage Tests (D1281)

003-2

Inspection Date : 2026-09-02

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93

Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Tank

Ser. No.	D1281	Unit Number	B7621
TC Spec.	TC 407	Service Type	Dedicated Service
Date of mfr.	2014-05-00	Cert. date	2014-05-00
VIN	972784	Tank mfr.	Brenner
MDIN	Blr0002722	MAWP	25 psi
Test P.	45 psi	Mfd. head thick	.180 in
Min. head thick	.129 in	Mfd. shell thick	.157 in
Min. shell thick	.129 in	Exposed Surface	538 ft2
Cap.	5500 gallons	Design Temp. Range	-20 F to 150 F
Max. Lading Density	1.5 kg/L	Shell Material	SA240 T316
Head Material	SA240 T316	Weld Material	T316L
Max. Payload	16566 kg	Max. Load Rate	500 gal/m at 25 psi
Max. Unload Rate	500 gal/m at 25 psi	Original Test Date	2014-05-00

Leakage Test

Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Test Medium	Air	No. of Compartments	1

Compartment #	Start (psi)	End (psi)	Hold Time (min)	Capacity
1	20	20	5	20820L

Venting devices hold pressure as required, if removed they are bench tested and hold pressure as required
Not Applicable

Product piping and valves hold pressure without leakage
Pass

Manways and closures inspected for leaks or deformation
Pass

Flanged connections checked for leakage
Pass

Inspect the entire area of the head, shell and welds for leaks or deformation including voids and adjacent compartments
Pass

Test pressure maintained for minimum of 5 minutes
Pass

All leaks are repaired before the tank is marked
Not Applicable

Inspect head shell

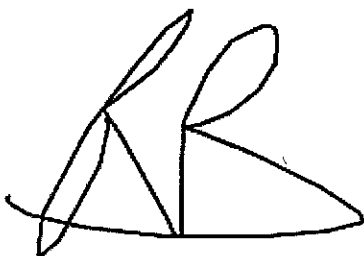
Defects

No defects found.

Tank Disposition

Current Disposition	Passed / No Defects Found
---------------------	---------------------------

Approval



Inspector
Signed by Richard Beeler



Tester
Signed by Richard Beeler

Service provided by **eStandardSolutions**

Hose Inspections (PVT B762101)

003-2

Inspection Date : 2026-09-02

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93

Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Hose Data

Serial / Identification	PVT B762101	HAWP	150 psi
Manufacturer	3"x35' Petroslink	Test Medium	Air
Test Pressure	180 psi	Hold Time	5

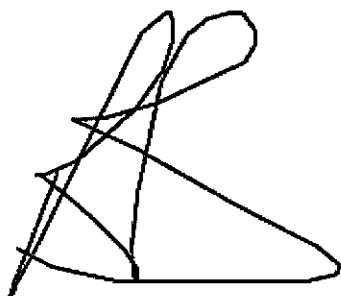
Hose Inspection

Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Inspection			
Damage to the hose cover exposing the reinforcement			
Pass			
Kinked, flattened or permanently deformed wire braid			
Pass			
Soft spots when not under pressure, bulging under pressure, loose outer covering			
Pass			
Damaged, slipping, or excessively worn hose couplings			
Pass			
Loose or missing bolts or fastenings on bolted hose coupling assemblies			
Pass			
Deteriorated legibility or absence of serial number, identification number or HAWP			
Pass			
Holds required pressure without bulging, distortion or leaks for a minimum of 5 minutes			
Pass			

Hose Disposition

Current Disposition
Returned to Service

Approval

A handwritten signature in black ink, appearing to be 'Richard Beeler', written in a cursive style.

Inspector
Signed by Richard Beeler

Service provided by **eStandardSolutions**

Hose Inspections (PVT B762102)

003-2

Inspection Date : 2026-09-02

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93

Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Hose Data

Serial / Identification	PVT B762102	HAWP	150 psi
Manufacturer	3"x21' Low Temperature Pressure Hose	Test Medium	Air
Test Pressure	180 psi	Hold Time	5

Hose Inspection

Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Inspection			
Damage to the hose cover exposing the reinforcement			
Pass			
Kinked, flattened or permanently deformed wire braid			
Pass			
Soft spots when not under pressure, bulging under pressure, loose outer covering			
Pass			
Damaged, slipping, or excessively worn hose couplings			
Pass			
Loose or missing bolts or fastenings on bolted hose coupling assemblies			
Pass			
Deteriorated legibility or absence of serial number, identification number or HAWP			
Pass			
Holds required pressure without bulging, distortion or leaks for a minimum of 5 minutes			
Pass			

Hose Disposition

Current Disposition
Returned to Service

Approval

A handwritten signature in black ink, appearing to be 'RB' with a stylized flourish.

Inspector

Signed by Richard Beeler

Service provided by **eStandard Solutions**

Hose Inspections (PVT B762103)

Inspection Date : 2026-09-02

003-2

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93

Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Hose Data

Serial / Identification	PVT B762103	HAWP	150 psi
Manufacturer	3"x21' Low Temperature Pressure Hose	Test Medium	Air
Test Pressure	180 psi	Hold Time	5

Hose Inspection

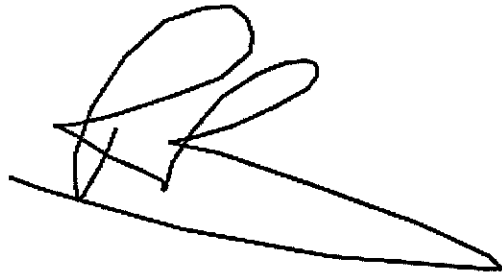
Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Inspection			
Damage to the hose cover exposing the reinforcement			
Pass			
Kinked, flattened or permanently deformed wire braid			
Pass			
Soft spots when not under pressure, bulging under pressure, loose outer covering			
Pass			
Damaged, slipping, or excessively worn hose couplings			
Pass			
Loose or missing bolts or fastenings on bolted hose coupling assemblies			
Pass			
Deteriorated legibility or absence of serial number, identification number or HAWP			
Pass			
Holds required pressure without bulging, distortion or leaks for a minimum of 5 minutes			
Pass			

Hose Disposition

Current Disposition
Returned to Service

Approval

✓

A handwritten signature in black ink, appearing to be 'R. Beeler', written over a horizontal line.

Inspector
Signed by Richard Beeler

Service provided by **eStandardSolutions**

Hose Inspections (PVT B762104)

003-2

Inspection Date : 2026-09-02

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93

Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Hose Data

Serial / Identification	PVT B762104	HAWP	150 psi
Manufacturer	3"x21' New Line	Test Medium	Air
Test Pressure	180 psi	Hold Time	5

Hose Inspection

Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Inspection			
Damage to the hose cover exposing the reinforcement			
Pass			
Kinked, flattened or permanently deformed wire braid			
Pass			
Soft spots when not under pressure, bulging under pressure, loose outer covering			
Pass			
Damaged, slipping, or excessively worn hose couplings			
Pass			
Loose or missing bolts or fastenings on bolted hose coupling assemblies			
Pass			
Deteriorated legibility or absence of serial number, identification number or HAWP			
Pass			
Holds required pressure without bulging, distortion or leaks for a minimum of 5 minutes			
Pass			

Hose Disposition

Current Disposition
Returned to Service

Approval

A stylized handwritten signature consisting of two large, overlapping capital letters 'R' and 'B'.

Inspector
Signed by Richard Beeler

Service provided by **eStandardSolutions**

Hose Inspections (PVT B762105)

003-2

Inspection Date : 2026-09-02

Created By: *Richard Beeler*

Tel: 7802962400

Facility

Atlas Inspections
11806 86A Street
Grande Prairie, AB, T8X0H4
1-780-831-7055

Client

Greg
Performance VAC & TANK Services Ltd.
721071 Range Rd 53 #93
[\[email protected\]](#)
Grande Prairie, AB, T8X0N4
Ph. No. - 780-830-0045

Hose Data

Serial / Identification	PVT B762105	HAWP	150 psi
Manufacturer	2"x18' Petroslink	Test Medium	Air
Test Pressure	180 psi	Hold Time	5

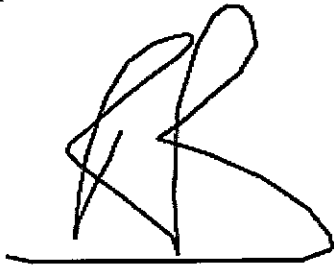
Hose Inspection

Inspection Date	2026-09-02	Inspection Expiry Date	2027-09-30
Inspection			
Damage to the hose cover exposing the reinforcement			
Pass			
Kinked, flattened or permanently deformed wire braid			
Pass			
Soft spots when not under pressure, bulging under pressure, loose outer covering			
Pass			
Damaged, slipping, or excessively worn hose couplings			
Pass			
Loose or missing bolts or fastenings on bolted hose coupling assemblies			
Pass			
Deteriorated legibility or absence of serial number, identification number or HAWP			
Pass			
Holds required pressure without bulging, distortion or leaks for a minimum of 5 minutes			
Pass			

Hose Disposition

Current Disposition
Returned to Service

Approval

A handwritten signature in black ink, appearing to be 'RB', written over a horizontal line.

Inspector
Signed by Richard Beeler

Service provided by **eStandardSolutions**