

204-4



Custom Track Service  
Percent Worn

FINNING INTERNATIONAL INC.

PROVINCIAL RENTALS

Prepared By: Chandelle Goodall

<b>Model</b>	D8RLRC	<b>Inspection Date</b>	31Mar26
<b>Manufacturer</b>	Caterpillar	<b>Next Inspection Date</b>	--
<b>Serial Number</b>	7XM01638	<b>Next Inspection Hours</b>	--
<b>Reference Number</b>	C897XM01638	<b>Underfoot Conditions</b>	
<b>Hour Meter Reading</b>	--	<b>Impact</b>	--
<b>Hours Per Week</b>	--	<b>Abrasion</b>	--
<b>Total Odometer Reading</b>	--	<b>Moisture</b>	--
<b>Forward Odometer</b>	--	<b>Packing</b>	--
<b>Reverse Odometer</b>	--	<b>Bushing Allowable Wear</b>	Greater
<b>Distance Per Week</b>	--	<b>Link Allowable Wear</b>	Greater

Track System	Acceptable Range (mm)		Measurement (mm)		Condition	
	Min	Max	Left	Right	Left	Right
Frame Extension		142.0	82.0	76.0	58%	53%
Link Roller System					38%	36%

Position	Part Number		Status		Date Installed		SMU Installed		Hours on Wear Surface		Measurement (mm)		Percent Worn		
	Component	Left	Right	Left	Right	Left	Right	Left	Right	Left	Right	Left	Right		
<b>Link Assembly</b>	Left: 2726009				Right: 2726009				Pitch: 8.5 In (215.9 Mm)		Sections: 44				
Track Links	8E4513	8E4513	Original	Original	04Mar24	04Mar24	--	--	--	--	42.5 (U)	42.8 (U)	42%	38%	
Bushing (Ext)	6Y3914	6Y3914	Original	Original	04Mar24	04Mar24	--	--	--	--	11.2 (U)	11.4 (U)	52%	50%	
<b>Track Shoes</b>					Left Width: 560mm				Right Width: 560mm						
	7G6448	7G6448	Original	Original	04Mar24	04Mar24	--	--	--	--	89.6 (U)	89.5 (U)	11%	12%	
<b>Idlers</b>															
	2440879	2440879	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	25.5 (D)	26.0 (D)	44%	48%	
<b>Track Rollers</b>															
<b>Front</b>	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	55.4 (U)	56.1 (U)	30%	27%
2	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	56.5 (U)	56.4 (U)	26%	26%
3	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	55.7 (U)	55.5 (U)	29%	29%
4	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	56.1 (U)	56.3 (U)	27%	26%
5	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	55.8 (U)	55.5 (U)	28%	29%
6	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	55.3 (U)	55.6 (U)	30%	29%
7	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	55.2 (U)	55.3 (U)	31%	30%
8	D	2789539	2789539	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	54.7 (U)	54.5 (U)	33%	33%
<b>Sprockets</b>															
		3145462	3145462	Replaced	Replaced	04Mar24	04Mar24	--	--	--	--	226.0 (T)	226.0 (T)	60%	60%

(U) Ultrasonic | (C) Caliper | (D) Depth Gauge | (T) Tape | (E) Estimated

Recommendations

PHOTOS

Pre-Inspect



Pre-Inspect




Pre-Inspect



Pre-Inspect



Pre-Inspect

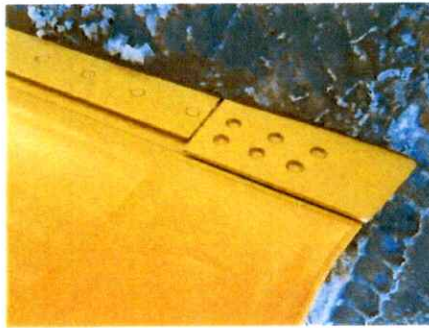

Pre-Inspect



Pre-Inspect



Pre-Inspect



Pre-Inspect

Measurements

Idlers



Left Idlers 1



Right Idlers 1

Sprockets



Left Sprockets 1



Right Sprockets 1