

P.O. Box 650 Grimshaw, AB, T0H 1W0

Unit#

A300

A312

VIN: A30DVI5018

Machine Hours

12032 hrs next service 12247

June 20/23

Description

Parts & Description

Price

Description	Tech	Machine Hours	Parts & Description	Price
Check over of systems and operation and repair deficiencies as necessary. Check all fluids;			(1) 79720 Ram X 20" wiper blades	\$
Engine oil; OK Hydraulic; OK			(2) BT 885/4PG Trans Filters	\$
Trans: Serviced; change oil + filters;			(1) BF1359 SP Fuel Filter	\$
trans fluid extremely dirty no			(1) BF46233 Fuel Filter	\$
cuttings found in Filters. Drop box			(1) PAS310 Outer cabin Air	\$
serviced; fluid extremely dirty, no			(1) 11121365 LH convex mirror -	\$(Value)
cuttings found on magnets. Front			(1) 11196683 HUAC control panel	\$(Value)
diff; OK; new oils in diff +			(1) 9720-11 50Amp ANS/ANI strap	\$
hubs. Drive #1; OK; new oils in			(1) 11113563 HUAC control cable	\$(Value)
diff + hubs. Drive #2; OK; new			(1) 11113564 HUAC control cable	\$
			(1) 11113561 HUAC control cable	\$
			(2) VOE 4789993 Split rim Lock	\$

oils in diff + hubs, drive line; All U-joints greased and pass visual inspection; Inter-axle shaft damaged at weld. due to Roll over, wish bone also damaged due to Roll over + shaft contact. Tires OK; new pressures set to 60 PSI. Frame, cylinders + pins; OK no visible leaks.

2G PARTS AND EQUIPMENT LTD

BOX 290 5714 - 51 ST
 GRIMSHAW, AB T0H 1W0
 (780) 332-2240
 GST 721743292 RT0001

INVOICE: 1-16065

Date: September 27, 2023

Ship To

NEW GEN PROJECTS
 BOX 650
 GRIMSHAW, AB, CANADA T0H 1W0

Bill to:

NEW GEN PROJECTS
 BOX 650
 GRIMSHAW, AB, CANADA T0H 1W0

(780) 332-2054
 admin@newgenprojects.ca

(780) 332-2054
 admin@newgenprojects.ca

CUST ID	PO:			SALES PERSON	SHIP VIA
1213	A312			ADMIN	cwc
VENDOR PLU	DESCRIPTION	QTY	UNIT PRICE	Unit Discount	AMOUNT
	VOLVO A30D BOX HEATER COUPLING	1	2,000.00		2,000.00
Posted					
Thank you for choosing 2G Parts and Equipment Ltd.					

Regular Price: \$2000.00
 Paid by On Account \$2,100.00

SUBTOTAL 2,000.00
 GST 100.00
TOTAL \$2,100.00

TERMS: NET 15th OF MONTH FOLLOWING INVOICE DATE.
 INTEREST WILL BE CHARGED ON ALL OVERDUE ACCOUNTS.
 SIGNATURE ON INVOICE INDEMNIFIES PARTY BILLED-TO.

RECEIVED BY
 PRINT NAME _____

SIGNATURE X _____

P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit# A30D A312
VIN: A30DV15018

Machine Hours 12032 hrs next service 12247

June 20/13

Description	Tech	Parts & Description	Price
Service Fuel system; contamination		(1) Seat air control switch	\$(Value)
found in suction lines and filters,		(2) A312 decals	\$
R/R fuel filters and back flush		(2) NewGen Projects decals	\$
all lines and clean fuel drain back		(1) 201b extinguisher	\$
passage and float balls. Exhaust system			\$
and box heater; OK. Tail gate and			\$
cables; OK: tail gate, swing arms			\$
and cables. Home made and no longer			\$
factory * Air systems; OK minor			\$
look down. Brake systems; Front			\$
Riff; Pads 50% disc: visual inspection; OK		Calipers; visual inspection; OK	\$
Hard lines; OK. Flex lines; cracked and rotten, new lines ordered. Operation; OK			\$

Diff lock system; Bad lines, adapter plates and diaphragms ripped; parts robbed from A311 to repair unit, system function Test; OK Diff Drive #1 Brake system; Pads 50% Disc; visual inspection; OK Calipers; visual inspection; OK Hard lines & some damage to lines (roll over damage) no leaks and still operational. Flex lines & replaced with lines not suitable for





P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit#

A-312

Machine Hours

12433

Sept. 13/23

[illegible]



P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit#

A-312

Machine Hours

12 504hrs

Sept. 29/23

[illegible]



P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit#

A-319

Machine Hours

৩৩৩

1-then

[illegible]



P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit# A-312 Machine Hours 13 229 hrs. Price Apr. 27/24

Description	Tech	Parts & Description	Price
- Eng service.			\$
- Eng Air filters replaced			\$
- Cab Filters replaced			\$
- Trans, hyd, coolant good			\$
- Replaced cab light bulb.			\$
- Wipers work, lights work			\$
- A/C good			\$
			\$
* Needs right rear signal light			\$
			\$
			\$
			\$

NUMBER: 199

WORK ORDER

COMPANY New Gen.

DARCY KURIGA 780-835-8090 dkuriga@yahoo.com

DATE	UNIT	SERIAL	HOURS/KILOMETERS
July 16/24			

UNIT/SERIAL	JOB DESCRIPTION	HOURS
	Loon River	

E 203	- Installed new ECM. Still had code on for turbo sensor. ordered sensor + pig tail. checked out seat cushion.	2
A 312.	changed ignition switch. checked engine oil. added 2 gallons coolant to engine. Note: * It's cracked manifold.	2
M-2102	Drove from PR to Cadott. Checked out Broken track turned out to be Broken pad. changed 2 pads. Note needs 2 more pads.	4
Travel.	Travel from Home to Loon River. and Back.	4
JOB TOTAL		12.

DATE COMPLETED: _____

COMPLETED BY: Darcy Kuriga



P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit#

A3/2

Machine Hours

13573

Aug 22/24

[illegible]

NUMBER: 220

WORK ORDER

COMPANY New Gen.

DARCY KURIGA 780-835-8090 dkuriga@yaoo.com

DATE	UNIT	SERIAL	HOURS/KILOMETERS
Sept 6/24			

UNIT/SERIAL	JOB DESCRIPTION <u>Loan.</u>	HOURS
-------------	------------------------------	-------

A 302	- Checked out Broken Exhaust. - Fixed leaks on tail gate Rem. - Checked out leaking Injector Cylinder	2
C-106.	- Checked out A/C System *Note Needs New Suction Hose. Fitting is Rubbed and want Seal.	3
A-312	Removed Broken Exhaust for Bowl Heater.	2
G102	checked out transmission leaks Steel cooler Line cracked ordered parts.	4
	Travel to Red Earth and Home	4
JOB TOTAL		15

DATE COMPLETED: _____

COMPLETED BY: Darcy Kuriga

P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit #: servicing Date: mar 7 2015

Machine Hours:

Technician Signature: [Signature]

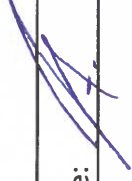
Description

Parts & Description

A-307 Both front shocks blown out need refilled / Replaced / Reseal	lock out tape out put in to A-307-A-304 A-312
A-304 RH side shock blown out needs refilled or Replace / Reseal	
A-302 LH tail gate horn fell off Jordan	on site to fix
All tires look good, not seeing any leaks has 13444 Does 13424	of any kind
A-312 Due for service All lights work not seeing any leaks of any kind	
tires all look good, windows are good	

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: Mar. 8/25	Location: Shop + CNRL 25-007	Signature: 
- Went to Brian's Job		
- Inspected leak on A-302, diff breather was seeping.		
- Found Worn out wishbone bearing. Keith ordered parts + requested machine		
Keeps working.		
- A-307 has a slight trans leak coming from valve bank off Under cab.		
Needs to be addressed when back in shop.		
- Put seat mount radio in rental rack truck HD Northern 30-9		
- Worked on E-203 in shop.		
- Seat on A-312 wasn't airing up		

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: April 23/25	Location: Shop	Signature: Ivan Forsytho
A312 14058	Inspection + Parts list.	
A311 12315	AC-Temp Controls Repair	
	Charge AC system Change Cabin Filters	
	Run + Test.	
A313 12815	Engine Brake valve install	
	Fill Coolant.	



P.O. Box 650, Grimshaw, Alberta T0H 1W0 | P: 780.332.2054

Removed Both Rear Tires to put on A309 Put 2 work tires off A309 on the Rear.

Rock Truck 730E/A30F

Complete Service Done.

Unit # <u>A312</u>		Date: <u>April 23/25</u>	Hours: <u>14052</u>	Signature: <u>Ivan Forsythe</u>
Service Remaining	<u>13923</u>		Exterior Washed	☒
Engine Oil Level	<u>good</u>		Tire Pressures	<u>good</u>
Coolant Level <u>Tube at pump leaking</u>	<u>low</u>		Tire Condition <u>like new</u>	☒
Hyd Oil Level	<u>good</u>		2-Way Radio Functions	<u>yes</u>
Trans Oil Level	<u>good</u>		Antenna	<u>yes</u>
Drop Box Oil Level	<u>good</u>		Lights Working	<u>yes</u>
Washer Fluid <u>works</u>	<u>half</u>		Stock:	
Wiper <u>works</u>	<u>good</u>		Wiper	☒
Mirrors <u>Lt convex Broken</u>	<u>good</u>		Mirrors	☒
Check For Leaks			Check For Leaks	☒
Tail Gate Pins	<u>N/A</u>		Tail Gate Pins	☒
Exhaust Condition <u>Cracked manifold</u>			Exhaust Condition	☒
Grease all Nipples	☒		Grease all Nipples	☒
Cab Clean		Cab Clean	☒	

Comments:

All glass good Doors + opening windows function properly.
Seat Functions as it should
Seat Belt good.

A/C Blows cold. / heater works.

* operators manual damaged.

Back up alarm works.



P.O. Box 650 Grimsshaw, AB. T0H 1W0

Unit #: A312

Date:

Machine Hours: 14052

Technician Signature:

Iron Forge

Description

Parts & Description

Oil Filters	B76 x2	
Oil Filter	B7685 x1	
Fastener cluster bulbs	x10	NOE916327
Fuel Filter	BF46233 x1	
" "	BF1359-SP x1	
TRANS Breather	PA5700 x1	
Trans Filters	BT8851-MPG x2	
Air dryer cartridge	x1	NOE20546795
Air Filter Outer	x1	RS3870
Drop box filter	PA5700 x1	
Fuel tank breather filter	PA5311 x2 +	Hydraulic tank breather.
Hydraulic oil filter	VOE	17438620

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: May 22/25 Location: Sharp

Signature:

[Handwritten Signature]

A312.

Air Compressor install. Trans Water pump
Tube + Seal Replace. Install Exhaust.
manifold + Turbo Bell housing Plug.

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: May 16/25

Location:

Shop

Signature:

[Signature]

A312 14052 Change masterswitch For lockout.
Install Rear Suspension
Service Rear Diff + Hards



P.O. Box 650 Grimshaw, AB. T0H 1W0

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: May 15/25 Location: Shop Signature: [Signature]

A312 14052 Trans oil + Filters Drop Box oil + Filters
Front Diff oil Hydraulic Filters Breather Filters.
Cabin air Filters Clean out HVAC.
Center Diff oil



P.O. Box 650 Grimshaw, AB. T0H 1W0

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: May 14/25 Location: Shop

Signature: [Signature]

A-362 14058 Remove Air Compressor.
Service.

Daily Report

Note: Date, Signature, Unit Numbers and Equipment Hours are all MANDATORY

Date: May 6 / 25 Location: Shop

Signature: [Signature]

A312.

Tear down to Remove Walking Beams
Remove LH Beam change Bushings
Install LH Beam.



P.O. Box 650 Grimshaw, AB. T0H 1W0

Unit #: A312 Date: July 11/25 Machine Hours: 14055 Technician Signature:

Description

Parts & Description

Center Axle LH Side Front side
Brake Caliper swapped out for Rebuilt one.
Bled Brakes + Run + Test Functions
Properly.



P.O. Box 650, Grimshaw, Alberta T0H 1W0 | P: 780.332.2054

Rock Truck 730E/A30F

Unit # A312 Date: July 11/25 Hours: 14055 Signature: Ivan Tasyhe	
Service Remaining	14453
Engine Oil Level	good
Coolant Level	good
Hyd Oil Level	good
Trans Oil Level	good
Drop Box Oil Level	good
Washer Fluid	Full
Wiper	good
Mirrors	good
Check For Leaks	Yes
Tail Gate Pins	N/A
Exhaust Condition	good
Grease all Nipples	Yes
Cab Clean	Yes
Exterior Washed	Yes
Tire Pressures	good
Tire Condition	good
2-Way Radio Functions	Yes
Antenna	Yes
Lights Working	Yes
Stock:	
Wiper	
Mirrors	
Check For Leaks	
Tail Gate Pins	
Exhaust Condition	
Grease all Nipples	
Cab Clean	

Comments:

Repaired RH center Brake caliper + Checked over.
Filled with fuel + sent out.