

Commercial Vehicle Inspection Report

Decal Number: GK18933
Decal Expiry Date: 2026-Feb-28
Inspection Number: 21479364

Inspection Result:

PASS

FACILITY:	CANADIAN TRUCK & TRAILER / S5270	INSP. TYPE:	Complete	INSP. START:	2025-Aug-29 08:37 PM PDT
INSPECTOR:	HILL, SHANE DENNIS / 111435	INSP. CLASS:	Class 3 - Trailer and Semi-Trailer	INSP. COMPLETE:	2025-Aug-29 10:37 PM PDT
WORK ORDER #:	280872	INSP. REASON:	Semi-annual		

VEHICLE JUR:	British Columbia	REGI:	10134638	VIN:	2D9ED3526V1012992
PLATE #:	80612C	UNIT/FLEET#:	78	OWNER/LESSEE NAME:	RELIABLE EQUIPMENT RENTALS, RELIABLE EQUIPMENT RENTALS
LICENCED GVW(kg):	999999	BODY STYLE:	Dump Trailer	ADDRESS:	20499 WESTMINSTER HWY, 20499 WESTMINSTER HWY
VEHICLE YEAR:	1997	ODOMETER:			Richmond, British Columbia
MAKE:	LOAD LINE	HUB ODOMETER:			V6V 1B3, Canada
MODEL:		BRAKE TYPE:	Air		
		FUEL TYPE:			

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Not Applicable
Section 2 - Suspension	Passed
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Not Applicable
Section 5 - Instruments and Auxiliary Equipment	Not Applicable
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Repaired (same day) WELD CROSSMEMBERS CRACKS
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Not Applicable

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles	Type	Size	Slack Adj.	Left	Right	Tire Tread Depth (mm)				Steering
						Outer L	Inner L	inner R	Outer R	
1	Clamp	30	Automatic	44.5	44.5	5	12	9	9	
2	Clamp	30	Automatic	44.5	44.5	5	14	13	13	
3	Clamp	30	Automatic	47.6	47.6	11	11	7	7	

Comment:

Comment:

Air Brake Camshaft Rotation (degrees)

Axles	Left	Right
1	80	85
2	90	60
3	40	70

Comment:

Brake Lining/Pad (mm)

Lining/Pad	Left	Right
Lining (Shoe)	13	12
Lining (Shoe)	11	15
Lining (Shoe)	18	14

Comment:

Rotor Thickness or Drum Inside Diameter (mm)

Rotor/Drum	Left	Right
Drum		
Drum		
Drum		

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

Inspection Comments:

Has this Vehicle been road tested?

No

Road Test Date:


Road Tester:

Inspector: HILL, SHANE DENNIS

Signature:

This Inspection Report was submitted to CVSE on 2025-Aug-29 10:38 PM PDT

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

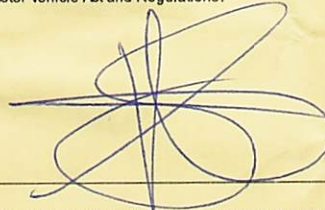

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/VIP at the Commercial Vehicle Safety Enforcement

CVSE014

8/29/2025 10:41:09 PM PDT