



Commercial Vehicle Inspection Report

Decal Number: GP05411
Decal Expiry Date: 2027-Jan-31
Inspection Number: 21852866

506-1
Inspection Result:
PASS

FACILITY: MODERN DIESEL TRUCK REPAIR LTD. / S15400
INSPECTOR: SANDHU, GURPREET / 202678
WORK ORDER #:
INSP. TYPE: Complete
INSP. CLASS: Class 3 - Trailer and Semi-Trailer
INSP. REASON: Semi-annual
INSP. START: 2026-Jul-18 03:10 PM PST
INSP. COMPLETE: 2026-Jul-18 05:55 PM PST

VEHICLE JUR: British Columbia
PLATE #: 17566K
LICENCED GVW(kg): 0
VEHICLE YEAR: 2009
MAKE: CANCADE
MODEL:
REGI: 13813253
UNIT/FLEET#: P102
BODY STYLE: Dump Trailer
ODOMETER:
HUB ODOMETER:
BRAKE TYPE: Air
FUEL TYPE:
VIN: 2C92215E6A1086217
OWNER/LESSEE NAME: ABDOLLAHAZADEH SARDROUDI ELY, .
ADDRESS: 1508-4900 LENNOX LANE
Burnaby, British Columbia
V5H0G9, Canada

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Not Applicable
Section 2 - Suspension	Passed
Section 3 - Brake System	Repaired (same day) XL 1 RIGHT XL 3 LEFT BRAKE DRUM REPLACED
Section 3A - Air Brakes	Passed
Section 3H - Hydraulic Brakes	Not Applicable
Section 4 - Steering	Not Applicable
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Repaired (same day) REPAIR LIGHTS & REPAIR POWER WIRE
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Repaired (same day) XL 3 RIGHT TIRE & RIM REPLACED
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Not Applicable

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles	Type	Size	Slack Adj.	Left	Right
1	Clamp	30	Automatic	39	39
2	Clamp	30	Automatic	38	39
3	Clamp	30	Automatic	39	38

Comment:

Tire Tread Depth (mm)

Outer L	Inner L	Inner R	Outer R	Steering
12	12	11	11	
7	7	10	11	
12	12	15	15	

Comment:

Air Brake Camshaft Rotation (degrees)

Axles	Left	Right
1	62	30
2	68	71
3	30	70

Comment:

Brake Lining/Pad (mm)

Lining/Pad	Left	Right
Lining (Shoe)	16	22
Lining (Shoe)	15	15
Lining (Shoe)	22	15

Comment:

Rotor Thickness or Drum Inside Diameter (mm)

Rotor/Drum	Left	Right
Drum		
Drum		
Drum		

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

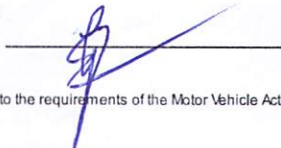
Inspection Comments:

Has this Vehicle been road tested?

No

Road Test Date:

Inspector: SANDHU, GURPREET

Signature: 

Road Tester:

This Inspection Report was submitted to CVSE on 2026-Jul-19 03:28 PM PST

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSCVP at the Commercial Vehicle Safety Enforcement

CVSE0014

7/19/2026 3:51:30 PM PST