

516-1
JW

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2026-468.



VIKING RENTALS

FIELD REPORT

COMPANY	Synchor.	DATE:	Feb 26/26
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu 350 excavator	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Viking yard.	CUSTOMER UNIT #:	
		UNIT HOURS:	8011

Issue Reported

- joystick leak in cab ok
- check hydro oil & coolant → both dark ok
- check blu alarm - seems quiet ok
- dig bucket teeth and frogs worn out (frogs ordered from Wearpro, Jaycee will repair once frogs arrive)

*Edges and hardware will be at Wearpro Fri Mar 6/26

Segment 1:

Segment 2:

Segment 3:

2 hrs → transport @ 150.00 / hrs
bucket to welder & plv.

Segment 4:

ENTERED FFR 2 6 2076

Prior to inspecting make sure all safety locks are in place



OUTGOING/INCOMING INSPECTION SHEET

Customer: Synchor
 Inspector: Aiden
 Equip. Type: Excavator
 Unit #: EX-50
 Hours Out: 7920 Fuel Out: F
 Hours In: 8011 Fuel In: F
 Key: 01 N

Out Date: Jan 30/26
 In Date: Feb 23/26

PRE RENTAL

1 - Check Fluid Levels	<input checked="" type="checkbox"/>	4 - Walk around inspection	<input checked="" type="checkbox"/>
2 - Check Track Tension	<input checked="" type="checkbox"/>	5 - Check Attachments	<input checked="" type="checkbox"/>
3 - Check Codes	<input checked="" type="checkbox"/>	6 - Manual	<input checked="" type="checkbox"/>
		7 - Check and Grease	<input checked="" type="checkbox"/>

RENTAL RETURN

1 - Check Cab Mirrors and Glass	<input checked="" type="checkbox"/>	18 - Visual Inspection (notes on back)	<input checked="" type="checkbox"/>
2 - Check Codes (note below and clear)	<input checked="" type="checkbox"/>	19 - Check Bucket Teeth and Retainers	<input checked="" type="checkbox"/>
3 - Check Wiper Function	<input checked="" type="checkbox"/>	20 - Check Bucket Cutting Edge	<input checked="" type="checkbox"/>
4 - Check Window Latches	<input checked="" type="checkbox"/>	21 - Check Engine air Filter	<input checked="" type="checkbox"/>
5 - Check Safety Locks	<input checked="" type="checkbox"/>	22a - Check Engine oil level	<input checked="" type="checkbox"/>
6 - Check Door Adjustment	<input checked="" type="checkbox"/>	22b - Check Coolant level	<input checked="" type="checkbox"/> rated 02-10
7 - Check Next Service Sticker	<input checked="" type="checkbox"/>	22c - Check Hydraulic oil level	<input checked="" type="checkbox"/>
8 - Check Heater, A/C and cabin filters	<input checked="" type="checkbox"/>	22d - Check DEF level	<input checked="" type="checkbox"/>
9 - Check Horn, Gauges and Seatbelt	<input checked="" type="checkbox"/>	23 - Check/Clean Radiator	<input checked="" type="checkbox"/>
10 - Check Lights	<input checked="" type="checkbox"/>	24 - Check Radiator Brackets and Bolts	<input checked="" type="checkbox"/>
11 - Check Back Up Alarm	<input checked="" type="checkbox"/>	25 - Check Engine Belts	<input checked="" type="checkbox"/>
12 - Check Washer Fluid Level	<input checked="" type="checkbox"/>	26 - Check Hose Condition	<input checked="" type="checkbox"/>
13 - Check Hand Grabs and Steps	<input checked="" type="checkbox"/>	27 - Check for leaks	<input checked="" type="checkbox"/>
14 - Check Blade/Arm/Boom Cylinders	<input checked="" type="checkbox"/>	28 - Check under belly for dents	<input checked="" type="checkbox"/>
15 - Check Coupling Devices and Connectors	<input checked="" type="checkbox"/>	29 - Check Antenna	<input checked="" type="checkbox"/>
16 - Check Thumb / Master cyl pin play	<input checked="" type="checkbox"/>	30 - Check and Grease	<input checked="" type="checkbox"/>
17 - Check Cylinder Guards	<input checked="" type="checkbox"/>	31 - under carriage	<input checked="" type="checkbox"/>

CODES

Code #	Description of Code	Hours

Attachment	Description	Condition
VR- C10	edge 1 con	80% / good
VR- Dig	teeth 1 con	80% / teeth may have damage
VR- Ripper	ripper con 1 tooth	good / 80%

Deficiencies

Hydraulic leak in cab; hydraulic + coolant back; Backup alarm fault
Dig Bucket teeth completely worn thru.

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2026- 231



COMPANY	FARMBOY	DATE:	Nov 6/25
PHONE #		ODOMETER START:	
EMAIL	VR-7389	ODOMETER END:	
EQUIPMENT	KOMATSU PC-350	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	FARMBOY SITE (PIN) Sump	CUSTOMER UNIT #:	
		UNIT HOURS:	7917

Issue Reported	<p>300 HR SERVICE CHANGE HYDRAULIC OIL FILTER REPLACE JOYSTICK</p> <p>SEE INSPECTION AND VERIFY CONCERNS</p>	<p><u>7240</u> 677hrs.</p>
----------------	--	---

Segment 1:	<ul style="list-style-type: none"> - Replace defective joystick after receiving 2 wrong cone - Perform 300 HR Service - Inspect track
Segment 2:	Replace mirror
Segment 3:	
Segment 4:	

START TIME	END TIME	LABOR DESCRIPTION	HOURS
8:00	10:00	Repairs	
9:30	12:30	Inspect	
13:00	14:00	Repairs	
10:30	12:00	Repairs	
11:30	15:00	Service	

PART #	PART DESCRIPTION	Assigned PO	QUANTITY
1748	Oil filter		1
Oil	Engine oil		3.5

VIKING REPRESENTATIVE	<i>Ben</i>	Job Completed?:	<input checked="" type="radio"/> Yes <input type="radio"/> No
-----------------------	------------	-----------------	---

COMPANY REP NAME		FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:

ENTERED DEC 05 2025

Prior to inspecting make sure all safety locks are in place



OUTGOING/INCOMING INSPECTION SHEET

Customer: Fernby
 Inspector: Cole
 Equip. Type: Excavator
 Unit #: Ex-50 350
 Hours Out: 07240 Fuel Out: F
 Hours In: 7917 Fuel In: F
 Key: Y10

Out Date: ~~Friday~~ Thursday 10, 2025
 In Date: Dec 4/25

PRE RENTAL

1 - Check Fluid Levels	✓
2 - Check Track Tension	✓
3 - Check Codes	✓

4 - Walk around inspection	✓
5 - Check Attachments	✓
6 - Manual	N/A
7 - Check and Grease	✓

RENTAL RETURN

1 - Check Cab Mirrors and Glass	X
2 - Check Codes (note below and clear)	✓
3 - Check Wiper Function	✓
4 - Check Window Latches	X
5 - Check Safety Locks	✓
6 - Check Door Adjustment	X
7 - Check Next Service Sticker	X
8 - Check Heater, A/C and cabin filters	✓
9 - Check Horn, Gauges and Seatbelt	X
10 - Check Lights	X
11 - Check Back Up Alarm	X
12 - Check Washer Fluid Level	✓
13 - Check Hand Grabs and Steps	X
14 - Check Blade/Arm/Boom Cylinders	✓
15 - Check Coupling Devices and Connectors	N/A
16 - Check Thumb / Master cyl pin play	N/A
17 - Check Cylinder Guards	N/A

18 - Visual Inspection (notes on back)	X
19 - Check Bucket Teeth and Retainers	✓
20 - Check Bucket Cutting Edge	✓
21 - Check Engine air Filter	X
22a - Check Engine oil level	✓
22b - Check Coolant level	✓
22c - Check Hydraulic oil level	X level good
22d - Check DEF level	N/A
23 - Check/Clean Radiator	✓
24 - Check Radiator Brackets and Bolts	✓
25 - Check Engine Belts	✓
26 - Check Hose Condition	✓
27 - Check for leaks	✓
28 - Check under belly for dents	X
29 - Check Antenna	✓
30 - Check and Grease	✓
31 - under carriage	X

CODES

Code #	Description of Code	Hours

Attachment	Description	Condition
VR-	Dis	
VR- ex 311	edge	70% been flipped
VR-		

Deficiencies

missing mirror glass, missing track, step/pent step; lots of bent pads; air filter play; Hydraulic flush needed; A service needed; ton of paint damage wiper w/egint/stick/burn; possible pins missing/mudge dented; some pins need long

see back



EX-50 - 2018 Komatsu PC350-08 Excavator

Serial# KMTPC191HHWA11395

Engine Serial#

		NAPA
Engine Oil Filter	6742-01-4540	1748
Final Fuel Filter Element	6754-79-6140	3956
Pre Fuel Filter	600-319-3610	3242
Hydraulic Breather	20Y-60-21470	
Hydraulic Oil Filter	207-60-71182	WO4AX321
Engine Air Filter	600-185-6100	
Outer Element	600-185-6110	6770 or 9770
Inner Element	600-185-6120	6771
Cab Fresh Air Filter	17M-911-3530	
Cab Recirc Filter	208-979-7620	

order
order.

Capacities

Engine Oil	35.0L
Gear Oil	36.0L
Hydraulic Oil	188.0L
Coolant	32.0L



Excavator Preventative Maintenance

Equipment Information

WO#: 231 Assoc PO#: _____
 Date: Jan 13 Serial #: _____
 Make: Komatsu Unit #: E75C Hours: 7920
 Model: PC 350 Customer: Fern by
 Service required: 300

300 Hour Service

- | | | |
|--|--|--|
| <input checked="" type="checkbox"/> change engine oil and filter | <input checked="" type="checkbox"/> check swing drive oil level | <input checked="" type="checkbox"/> check hoses and wiring |
| <input checked="" type="checkbox"/> clean air filter | <input checked="" type="checkbox"/> check track sag | <input checked="" type="checkbox"/> check for structural cracks |
| <input checked="" type="checkbox"/> check batteries | <input checked="" type="checkbox"/> check start aid | <input checked="" type="checkbox"/> general operation inspection |
| <input checked="" type="checkbox"/> check hydraulic oil level | <input checked="" type="checkbox"/> check buckets and implements | <input checked="" type="checkbox"/> check boom hardware |
| <input checked="" type="checkbox"/> check coolant level | <input checked="" type="checkbox"/> clean cab filter | <input checked="" type="checkbox"/> drain water from fuel |
| <input checked="" type="checkbox"/> check pump drive oil level | | |

600 Hour Service

- | | | |
|---|---|---|
| <input type="checkbox"/> change fuel filters | <input type="checkbox"/> check belts | <input type="checkbox"/> check for service codes |
| <input type="checkbox"/> check intake hoses | <input type="checkbox"/> check final drive oils | <input type="checkbox"/> check swing bearing grease |
| <input type="checkbox"/> take oil samples if needed | <input type="checkbox"/> grease unit | <input type="checkbox"/> clean cab filters |

1200 Hour Service

- | | | |
|--|--|---|
| <input type="checkbox"/> drain and refill swing gear oil | <input type="checkbox"/> check crankcase vent | <input type="checkbox"/> replace hydraulic pilot filter |
| <input type="checkbox"/> drain and refill splitter box oil | <input type="checkbox"/> test coolant | <input type="checkbox"/> replace hydraulic fill flow filter |
| <input type="checkbox"/> replace air cleaner filter | <input type="checkbox"/> check hydraulic operation | |

2400 Hour Service





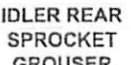


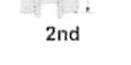
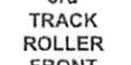

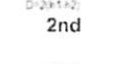
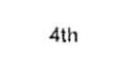
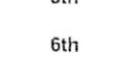
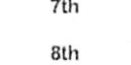

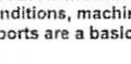


- | | |
|---|---|
| <input type="checkbox"/> drain and refill final drive oil | <input type="checkbox"/> check and lubricate track idlers |
| <input type="checkbox"/> set engine valves | |

4800 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> replace engine crankshaft transmission dampner | <input type="checkbox"/> drain and refill coolant |
| <input type="checkbox"/> replace hydraulic oil and clean suction screen | |

Company 1317921 ALBERTA LTD.
 Inspected By Paul Spence
 Rep Phone:
 Rep Email: pspence@smsequip.com
 Date 2025-12-08

Make/Model KOMATSU PC350LC-8
 Serial # A11395
 Equip #
 SMR 7917.00

Component	Measure	LEFT		Comments	RIGHT		Comments
		Measure	Wear		Measure	Wear	
 PITCH	868.0 (mm)	868.0 (mm)	33.0%		868.0 (mm)	33.0%	
 BUSHING	64.0 (mm)	64.5 (mm)	66.0%		64.5 (mm)	57.0%	
 LINK	115.0 (mm)	114.5 (mm)	18.0%		114.5 (mm)	25.0%	
 IDLER FRONT	25.0 (mm)	25.0 (mm)	51.0%		25.0 (mm)	51.0%	
 IDLER REAR SPROCKET			Good			Good	
 GROUSER	32.5 (mm)	32.0 (mm)	29.0%		32.0 (mm)	33.0%	
 CARRIER ROLLER FRONT	147.5 (mm)	148.0 (mm)	42.0%		148.0 (mm)	38.0%	
 2nd	148.0 (mm)	148.0 (mm)	38.0%		148.0 (mm)	38.0%	
 3rd TRACK ROLLER FRONT	174.0 (mm)	174.5 (mm)	59.0%		174.5 (mm)	55.0%	
 2nd	0.0 (mm)	0.0%	Unmeasurable due to track guard		0.0 (mm)	0.0%	Unmeasurable due to track guard
 3rd	174.5 (mm)	55.0%			174.5 (mm)	55.0%	
 4th	0.0 (mm)	0.0%	Not measurable due to track guard		0.0 (mm)	0.0%	Unmeasurable due to track guard
 5th	174.5 (mm)	55.0%			175.0 (mm)	51.0%	
 6th	0.0 (mm)	0.0%	Unmeasurable due to track guard		0.0 (mm)	0.0%	Unmeasurable due to track guard
 7th	175.0 (mm)	51.0%			175.0 (mm)	51.0%	
 8th	175.0 (mm)	51.0%			175.0 (mm)	51.0%	
 9th							
 10th							

NOTE: All machine undercarriage components measurements were attained following manufacturer's guidelines. Due to environmental conditions, machine cleanliness, human and tooling variances, measurements will have a degree of error beyond SMS control. These reports are a basic overview and not 100% guaranteed.



Trackhoe Packages | Water/Vac Trucks | Loaders | HWDP | Shale Bins | Mud Huts | Fluid Storage | Rig Mats | Surface Rentals | Bulk Mixers

shit
ex. 50 list

- * missing mirror glass
- * track step missing / bent
- lots of track pads bent
- air filter plugged
- Hydraulic flush / filter and breather
- A service needed
- tens of paint counter weight / stick / boom / stickers needed
- possible pins missing / dented
- some pins need longer bolts and double nut
- two cutting edge bolts aren't long enough
- track rail looks a bit stretched
- right joystick needs to be replaced
- boom light out / cab roof light flickering
- door doesn't lock in open pos
- Swing 409 hr over / damper case 409 hr over / H tank breather 179 hr over
- pos switch could be in a better spot
- Horn mic
- Fire extinguisher mic -
- missing screw for window latch
- dip stick nfg for trans pump
- rh idler has a bit of play
- couple bottom rollers starting to cowbell
- top rollers have play
- bottom roller looks like there wearing into track rail
- will back up alarm quiet + possible dirt in alarm

Mailing address: 414, 700 - 8th Avenue SW, Calgary, AB T2P 1H2 | Office: 403-407-2422

Shop address: 9502 - 42nd Avenue, Grande Prairie, AB T8V 5A8

www.gotimeenergy.ca

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2026- 209



COMPANY	Form boy	DATE:	Oct 30/25
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	PL350-08	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	RR 240 Strathmore. Main laydown	CUSTOMER UNIT #:	
		UNIT HOURS:	

Issue Reported	<p>Remove Pilot Valve with joystick assembly on the right side</p> <p style="text-align: right;">Wrong Joystick</p>
----------------	---

Segment 1: Install Ramp Pilot	<p>haul to site</p>
Segment 2:	<p>Replace pilot on R/S tanking</p>
Segment 3: Travel	<p>Bank</p>
Segment 4:	

START TIME	END TIME	LABOR DESCRIPTION	HOURS
1000	1100	Travel	
1100	1400	Replace R/S Pilot controls	
1400	1500	Travel	

PART #	PART DESCRIPTION	Assigned PO	QUANTITY
	Pilot valve		1

VIKING REPRESENTATIVE	Garner Ben	Job Completed?:	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
-----------------------	-----------------------	-----------------	---

COMPANY REP NAME	Carson Mckenzie	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:

Wrong joystick from SMS

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2026-49



COMPANY	Farmboy	DATE:	August 22 2025
PHONE #		ODOMETER START:	169490
EMAIL		ODOMETER END:	169559
EQUIPMENT		TOTAL KM'S:	69
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Field	CUSTOMER UNIT #:	
		UNIT HOURS:	75 20

Issue Reported	Service	<p>rent <u>7240</u> 280</p>
----------------	---------	---------------------------------

Segment 1:Service

- Service book
- Oil & lube
- Grease

Segment 2:

Segment 3:Travel

Segment 4:

START TIME	END TIME	LABOR DESCRIPTION	HOURS
7:00	7:15	travel to site	15 minutes
7:50	9:50	work in segment of	2 hours

PART #	PART DESCRIPTION	Assigned PO	QUANTITY
1748 1748	Engine oil filter		1
	Engine oil 25L		
	Grease 03		

VIKING REPRESENTATIVE	Javier	Job Completed?:	Yes/No
-----------------------	--------	-----------------	--------

COMPANY REP NAME	Carson Mckenzie	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:



**VIKING
RENTALS**

Excavator Preventative Maintenance

Equipment Information

WO#: 2026-44 ASSOC PO#: _____
Date: AUG 22 2025 Serial #: _____
Make: Komatsu Unit #: EX-53 Hours: 7520
Model: PC 35 Customer: Fair Boy
Service required: 600 H

300 Hour Service

- | | | |
|--|--|---|
| <input checked="" type="checkbox"/> change engine oil and filter | <input type="checkbox"/> check swing drive oil level | <input type="checkbox"/> check hoses and wiring |
| <input type="checkbox"/> clean air filter | <input checked="" type="checkbox"/> check track sag | <input checked="" type="checkbox"/> check for structural cracks |
| <input type="checkbox"/> check batteries | <input checked="" type="checkbox"/> check start aid | <input type="checkbox"/> general operation inspection |
| <input checked="" type="checkbox"/> check hydraulic oil level | <input checked="" type="checkbox"/> check buckets and implements | <input checked="" type="checkbox"/> check boom hardware |
| <input checked="" type="checkbox"/> check coolant level | <input type="checkbox"/> clean cab filter | <input type="checkbox"/> drain water from fuel |
| <input checked="" type="checkbox"/> check pump drive oil level | | |

600 Hour Service

- | | | |
|---|--|--|
| <input checked="" type="checkbox"/> change fuel filters | <input checked="" type="checkbox"/> check belts | <input type="checkbox"/> check for service codes |
| <input checked="" type="checkbox"/> check intake hoses | <input checked="" type="checkbox"/> check final drive oils | <input checked="" type="checkbox"/> check swing bearing grease |
| <input type="checkbox"/> take oil samples if needed | <input checked="" type="checkbox"/> grease unit | <input checked="" type="checkbox"/> clean cab filters |

1200 Hour Service

- | | | |
|--|--|---|
| <input type="checkbox"/> drain and refill swing gear oil | <input type="checkbox"/> check crankcase vent | <input type="checkbox"/> replace hydraulic pilot filter |
| <input type="checkbox"/> drain and refill splitter box oil | <input type="checkbox"/> test coolant | <input type="checkbox"/> replace hydraulic fill flow filter |
| <input type="checkbox"/> replace air cleaner filter | <input type="checkbox"/> check hydraulic operation | |

2400 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> drain and refill final drive oil | <input type="checkbox"/> check and lubricate track idlers |
| <input type="checkbox"/> set engine valves | |

4800 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> replace engine crankshaft transmission dampner | <input type="checkbox"/> drain and refill coolant |
| <input type="checkbox"/> replace hydraulic oil and clean suction screen | |



EX-50 - 2018 Komatsu PC350-08 Excavator

Serial# KMTPC191HHWA11395

Engine Serial#

		NAPA
Engine Oil Filter	6742-01-4540	1748
Final Fuel Filter Element	6754-79-6140	3956
Pre Fuel Filter	600-319-3610	3242
Hydraulic Breather	20Y-60-21470	
Hydraulic Oil Filter	207-60-71182	WO4AX321
Engine Air Filter	600-185-6100	
Outer Element	600-185-6110	6770 or 9770
Inner Element	600-185-6120	6771
Cab Fresh Air Filter	17M-911-3530	
Cab Recirc Filter	208-979-7620	

Capacities

Engine Oil	35.0L
Gear Oil	36.0L
Hydraulic Oil	188.0L
Coolant	32.0L

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2026-31



COMPANY	FarmBoy	DATE:	August 15 2025
PHONE #		ODOMETER START:	167786
EMAIL		ODOMETER END:	167707
EQUIPMENT		TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Field	CUSTOMER UNIT #:	
		UNIT HOURS:	1525

162146
168479

Issue Reported	7240
	Diag No Start/Change Fuel Filter/Flip cutting edge

Segment 1: Diag no start
 - due to clogged Fuel Filters you need new ones

Segment 2: Change fuel filter
 - new fuel filter ← no bill

Segment 3: Travel

Segment 4: Flip cutting edge
 - FLIP cutting edge ← bill to flip.

START TIME	END TIME	LABOR DESCRIPTION	HOURS
5:00	5:40	Travel to site	40 minutes
5:40	6:20	Various broken hydraulic hose	40 minutes
6:20	8:20	Travel to Viking yard	2 Hours
4:00	4:50	Work in segment 02	50 minutes
4:50	5:40	Travel to Viking yard	50 minutes
8:30	10:00	Travel to site	1.50 hour
10:40	11:10	Work in segment 02	2.30 hours
1:10	2:00	Travel to Viking yard	50 minutes
4:00	7:00	Work in segment 04	3 Hour

PART #	PART DESCRIPTION	Assigned PO	QUANTITY
3956	Pinne tube filter		01
2242	Roll filter		01

VIKING REPRESENTATIVE	Javier	Job Completed?:	Yes/No
-----------------------	--------	-----------------	--------

COMPANY REP NAME	Carson Mckenzie	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2026-21



COMPANY	Farmboy	DATE:	August 11 2025
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT		TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Field	CUSTOMER UNIT #:	
		UNIT HOURS:	7430

Issue Reported	Replace Leaking Hydraulic line
----------------	--------------------------------

Segment 1: Replace Line
 Install new Hydraulic line built at Shop install cover and confirm line is no longer leaking

Segment 2:

Segment 3: Travel
 1 Hr time to get to site

Segment 4:

START TIME	END TIME	LABOR DESCRIPTION	HOURS
10:30	11:30	Travel	1
11:30	1:00	Replace hose	2.5

PART #	PART DESCRIPTION	Assigned PO	QUANTITY

VIKING REPRESENTATIVE	Javier	Job Completed?:	Yes/No
-----------------------	--------	-----------------	--------

COMPANY REP NAME	Carson Mckenzie	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2025-705



COMPANY	Viking/Farmboy	DATE:	July 3/2025
PHONE #		ODOMETER START:	165515
EMAIL		ODOMETER END:	165694
EQUIPMENT	Komatsu PC350	TOTAL KM'S:	179
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Lyalta	CUSTOMER UNIT #:	
		UNIT HOURS:	7307

Issue Reported	hydraulic leaks and check A/C
----------------	-------------------------------

Segment 1: Travel

Segment 2: Check hydraulic leaks

- Check leaks on oil engine
- Re-tighten oil pan bolts

Segment 3: Check A/C

Segment 4:

START TIME	END TIME	LABOR DESCRIPTION	HOURS
1:00	2:10	travel to site	1 hour
2:10	5:40	work in Section 2.	3.30 hrs
6:40	6:40	travel to site yard	1 hour

PART #	PART DESCRIPTION	Assigned PO	QUANTITY

VIKING REPRESENTATIVE	Javier and Ben	Job Completed?:	Yes/No
-----------------------	----------------	-----------------	--------

COMPANY REP NAME	Conal Child	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2025-521



FIELD PHOTO

COMPANY	Viking/WID	DATE:	Apr 22/2025
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu PC350-8	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Shop	CUSTOMER UNIT #:	
		UNIT HOURS:	7258

Issue Reported	300H service
----------------	--------------

Segment 1: Service	<p>Service took HAD FOR 247H. 2.5H.</p> <ul style="list-style-type: none"> - Check - Grease
Segment 2: Check door cover	<p>FOUND DOOR FOR HYD PUMPS DAMAGED</p> <ul style="list-style-type: none"> - repair - STRAIGHTEN & WELD DOOR. 4H.
Segment 3:	<p>repair panels and hydraulic pump door</p>
Segment 4:	

START TIME	END TIME	LABOR DESCRIPTION	HOURS
9:00	12:20	Work in School	3.20
2:00	4:20	Work in School 2-03	2.20
2:10	4:30	work school 2-03	2.20

PART #	PART DESCRIPTION	Assigned PO	QUANTITY
1743	Grease oil		01
	Grease oil 25.0L		
	Grease		03

VIKING REPRESENTATIVE	Javier	Job Completed?:	Yes/No
-----------------------	--------	-----------------	--------

COMPANY REP NAME	Conal Child	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
DATE OF APPROVAL		INITIAL:	

Notes:

ENTERED APR 21 2025

Prior to inspecting make sure all safety locks are in place



OUTGOING/INCOMING INSPECTION SHEET

Customer: Western Irrigation
 Inspector: Cora
 Equip. Type: Excavator
 Unit #: Ex-50
 Hours Out: 6991 Fuel Out: F
 Hours In: 7238 Fuel In: Full
 Key: Q/N

Out Date: Jan 20, 2025
 In Date: Apr 16/25

PRE RENTAL

1 - Check Fluid Levels	✓
2 - Check Track Tension	✓
3 - Check Codes	✓

4 - Walk around inspection	✓
5 - Check Attachments	✓
6 - Manual	✓

RENTAL RETURN

1 - Check Cab Mirrors and Glass	✓
2 - Check Codes (note below and clear)	✓
3 - Check Wiper Function	✓
4 - Check Window Latches	✓
5 - Check Safety Locks	✓
6 - Check Door Adjustment	✓
7 - Check Next Service Sticker	X
8 - Check Heater, A/C and cabin filters	✓
9 - Check Horn, Gauges and Seatbelt	✓
10 - Check Lights	✓
11 - Check Back Up Alarm	✓
12 - Check Washer Fluid Level	✓
13 - Check Hand Grabs and Steps	✓
14 - Check Blade/Arm/Boom Cylinders	✓
15 - Check Coupling Devices and Connectors	✓
16 - Check Thumb / Master cyl pin play	
17 - Check Cylinder Guards	N/A

18 - Visual Inspection (notes on back)	
19 - Check Bucket Teeth and Retainers	X
20 - Check Bucket Cutting Edge	X
21 - Check Engine air Filter	✓
22a - Check Engine oil level	✓
22b - Check Coolant level	✓
22c - Check Hydraulic oil level	✓
22d - Check DEF level	✓
23 - Check/Clean Radiator	✓
24 - Check Radiator Brackets and Bolts	✓
25 - Check Engine Belts	✓
26 - Check Hose Condition	✓
27 - Check for leaks	✓
28 - Check under belly for dents	
29 - Check Antenna	✓
30 - Check and Grease	

CODES

Code #	Description of Code	Hours

Attachment	Description	Condition
VR-		
VR-		
VR-		

Deficiencies

Due for Service
Cutting edge - showing wear
Door cover fell off
Bucket teeth - showing wear



EX-50 - 2018 Komatsu PC350-08 Excavator

Serial# KMTPC191HHWA11395

Engine Serial#

		NAPA
Engine Oil Filter	6742-01-4540	1748
Final Fuel Filter Element	6754-79-6140	3956
Pre Fuel Filter	600-319-3610	3242
Hydraulic Breather	20Y-60-21470	
Hydraulic Oil Filter	207-60-71182	WO4AX321
Engine Air Filter	600-185-6100	
Outer Element	600-185-6110	6770 or 9770
Inner Element	600-185-6120	6771
Cab Fresh Air Filter	17M-911-3530	
Cab Recirc Filter	208-979-7620	

Capacities

Engine Oil	35.0L
Gear Oil	36.0L
Hydraulic Oil	188.0L
Coolant	32.0L



Excavator Preventative Maintenance

Equipment Information

WO#: 225-521 Assoc PO#: _____
Date: Done 22/225 Serial #: _____
Make: Komatsu Unit #: EX-53 Hours: 7278
Model: PC 253-8 Customer: Viking/Will
Service required: 3004

- | | | |
|--|--|--|
| <input checked="" type="checkbox"/> change engine oil and filter | <input checked="" type="checkbox"/> check swing drive oil level | <input checked="" type="checkbox"/> check hoses and wiring |
| <input checked="" type="checkbox"/> clean air filter | <input checked="" type="checkbox"/> check track sag | <input checked="" type="checkbox"/> check for structural cracks |
| <input checked="" type="checkbox"/> check batteries | <input checked="" type="checkbox"/> check start aid | <input checked="" type="checkbox"/> general operation inspection |
| <input checked="" type="checkbox"/> check hydraulic oil level | <input checked="" type="checkbox"/> check buckets and implements | <input checked="" type="checkbox"/> check boom hardware |
| <input checked="" type="checkbox"/> check coolant level | <input checked="" type="checkbox"/> clean cab filter | <input checked="" type="checkbox"/> drain water from fuel |
| <input checked="" type="checkbox"/> check pump drive oil level | | |

600 Hour Service

- | | | |
|---|---|---|
| <input type="checkbox"/> change fuel filters | <input type="checkbox"/> check belts | <input type="checkbox"/> check for service codes |
| <input type="checkbox"/> check intake hoses | <input type="checkbox"/> check final drive oils | <input type="checkbox"/> check swing bearing grease |
| <input type="checkbox"/> take oil samples if needed | <input type="checkbox"/> grease unit | <input type="checkbox"/> clean cab filters |

1200 Hour Service

- | | | |
|--|--|---|
| <input type="checkbox"/> drain and refill swing gear oil | <input type="checkbox"/> check crankcase vent | <input type="checkbox"/> replace hydraulic pilot filter |
| <input type="checkbox"/> drain and refill splitter box oil | <input type="checkbox"/> test coolant | <input type="checkbox"/> replace hydraulic fill flow filter |
| <input type="checkbox"/> replace air cleaner filter | <input type="checkbox"/> check hydraulic operation | |

2400 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> drain and refill final drive oil | <input type="checkbox"/> check and lubricate track idlers |
| <input type="checkbox"/> set engine valves | |

4800 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> replace engine crankshaft transmission dampner | <input type="checkbox"/> drain and refill coolant |
| <input type="checkbox"/> replace hydraulic oil and clean suction screen | |

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2025-22



COMPANY	Viking Rentals	DATE:	Aug 9/2024
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu PC350-08	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Shop	CUSTOMER UNIT #:	
		UNIT HOURS:	6949

Issue Reported	repairs
----------------	---------

Segment 1: replace bushings in arm, remove pin, remove and replace bushings and reshim, also replace worn hose on coupler

Segment 2: Repair side door, removed damaged grill and installed mesh, painted.

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2025-22



COMPANY	Viking Rentals	DATE:	Aug 9/2024
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu PC350-08	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Shop	CUSTOMER UNIT #:	
		UNIT HOURS:	6949

Issue Reported	repairs
----------------	---------

Segment 1: replace bushings in arm Remove 2 pins & Hitch + 4 bushings
 Clean out Cylinder bores and install new bushings
 Re install hitch & pins + shim arm pin Re attach Quick Coupler
 lines + make new one grease pins & bushings

Segment 2: Repair side door Remove bent grill and weld in new
 Mesh grill & paint yellow + Fix big dent in door

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2024-687



COMPANY	Viking Rentals	DATE:	June 4/2024
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu PC350	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Shop	CUSTOMER UNIT #:	
		UNIT HOURS:	6896


Issue Reported	300H service
----------------	--------------

Segment 1:service unit, see att	
Segment 2:	
Segment 3:	
Segment 4:	

START TIME	END TIME	LABOR DESCRIPTION	HOURS
		Seg 1	2.5H

PART #	PART DESCRIPTION	Assigned PO	QUANTITY
	Grease		1ea
	engine oil		35L
	filters, see att.	2024-961	

VIKING REPRESENTATIVE	Javier	Job Completed?:	<input checked="" type="checkbox"/> Yes/No
-----------------------	--------	-----------------	--

COMPANY REP NAME	Conal Child	FOR OFFICE USE	
COMPANY REP SIGNATURE		BILLABLE?:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
DATE OF APPROVAL	June 10/2024	INITIAL:	

Notes:



**VIKING
RENTALS**

Excavator Preventative Maintenance

Equipment Information

WO#: 2024-687 Assoc PO#: _____
 Date: June 4/2024 Serial #: _____
 Make: Komatsu Unit #: EX-50 Hours: 6896
 Model: PC 350 Customer: _____
 Service required: _____

300 Hour Service

- | | | |
|--|--|--|
| <input checked="" type="checkbox"/> change engine oil and filter | <input type="checkbox"/> check swing drive oil level | <input checked="" type="checkbox"/> check hoses and wiring |
| <input type="checkbox"/> clean air filter | <input checked="" type="checkbox"/> check track sag | <input checked="" type="checkbox"/> check for structural cracks |
| <input checked="" type="checkbox"/> check batteries | <input checked="" type="checkbox"/> check start aid | <input checked="" type="checkbox"/> general operation inspection |
| <input type="checkbox"/> check hydraulic oil level | <input checked="" type="checkbox"/> check buckets and implements | <input type="checkbox"/> check boom hardware |
| <input checked="" type="checkbox"/> check coolant level | <input type="checkbox"/> clean cab filter | <input checked="" type="checkbox"/> drain water from fuel |
| <input checked="" type="checkbox"/> check pump drive oil level | | |

600 Hour Service

- | | | |
|---|---|---|
| <input type="checkbox"/> change fuel filters | <input type="checkbox"/> check belts | <input type="checkbox"/> check for service codes |
| <input type="checkbox"/> check intake hoses | <input type="checkbox"/> check final drive oils | <input type="checkbox"/> check swing bearing grease |
| <input type="checkbox"/> take oil samples if needed | <input type="checkbox"/> grease unit | <input type="checkbox"/> clean cab filters |

1200 Hour Service

- | | | |
|--|--|---|
| <input type="checkbox"/> drain and refill swing gear oil | <input type="checkbox"/> check crankcase vent | <input type="checkbox"/> replace hydraulic pilot filter |
| <input type="checkbox"/> drain and refill splitter box oil | <input type="checkbox"/> test coolant | <input type="checkbox"/> replace hydraulic fill flow filter |
| <input type="checkbox"/> replace air cleaner filter | <input type="checkbox"/> check hydraulic operation | |

2400 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> drain and refill final drive oil | <input type="checkbox"/> check and lubricate track idlers |
| <input type="checkbox"/> set engine valves | |

4800 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> replace engine crankshaft transmission dampner | <input type="checkbox"/> drain and refill coolant |
| <input type="checkbox"/> replace hydraulic oil and clean suction screen | |



EX-50 - 2018 Komatsu PC350-08 Excavator

Serial# KMTPC191HHWA11395

Engine Serial#

		NAPA
Engine Oil Filter	6742-01-4540	1748
Final Fuel Filter Element	6754-79-6140	3956
Pre Fuel Filter	600-319-3610	3242
Hydraulic Breather	20Y-60-21470	
Hydraulic Oil Filter	207-60-71182	WO4AX321
Engine Air Filter	600-185-6100	
Outer Element	600-185-6110	6770 or 9770
Inner Element	600-185-6120	6771
Cab Fresh Air Filter	17M-911-3530	
Cab Recirc Filter	208-979-7620	

Capacities

Engine Oil	35.0L
Gear Oil	36.0L
Hydraulic Oil	188.0L
Coolant	32.0L

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2024-357



COMPANY	Viking Rentals	DATE:	Jan 15/2024
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu SK350	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Shop	CUSTOMER UNIT #:	
		UNIT HOURS:	6710

Issue Reported	No start
----------------	----------

Segment 1: Get unit started for rental in -35°C weather. Batteries were frozen. Replaced batteries and get unit started

Segment 2: install block heater, have not done yet. Will have to do when unit returns

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2024-357



COMPANY	Viking Rentals	DATE:	Jan 15/2024
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu SK350	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	Shop	CUSTOMER UNIT #:	
		UNIT HOURS:	6710.

Issue Reported	No start
----------------	----------

Segment 1: Get unit started for rental in -35°C weather

Replaced Both Batteries ~~and~~ was able to start machine

Segment 2: install block heater

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2024-255



FIELD REPORT

COMPANY	Viking Rentals/Farmboy	DATE:	Nov 23/2023
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT	Komatsu pc-350	TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	strathmore	CUSTOMER UNIT #:	
		UNIT HOURS:	6664

Issue Reported	fuel leak
----------------	-----------

Segment 1: Travel

Segment 2: check leak, found fitting at injection pump leaking, reseal temporarily and test, works good but will have to be repaired properly at shop

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2024-255



FIELD REPORT

COMPANY	Viking Rentals/farmboy	DATE:	Nov 23/2023
PHONE #		ODOMETER START:	101759
EMAIL		ODOMETER END:	102006
EQUIPMENT	Komatsu pc-350	TOTAL KM'S:	247
SERIAL #		VIKING UNIT #:	EX-50
LOCATION	strathmore	CUSTOMER UNIT #:	
		UNIT HOURS:	6664

Issue Reported	fuel leak
----------------	-----------

Segment 1: Travel

Segment 2: check leak

Segment 3:

Segment 4:



Excavator Preventative Maintenance

Equipment Information

WO#: 2024-198 Assoc PO#: _____
Date: Oct 20/2023 Serial #: KATPC191 H14 WA11395
Make: Komatsu PC 350 Unit #: EX-50 Hours: 6508
Model: PC 350 Customer: _____
Service required: 1000 hr.

250 Hour Service

- | | | |
|--|--|--|
| <input checked="" type="checkbox"/> change engine oil and filter | <input checked="" type="checkbox"/> check swing drive oil level | <input checked="" type="checkbox"/> check hoses and wiring |
| <input checked="" type="checkbox"/> clean air filter | <input checked="" type="checkbox"/> check track sag | <input checked="" type="checkbox"/> check for structural cracks |
| <input checked="" type="checkbox"/> check batteries | <input checked="" type="checkbox"/> check start aid | <input checked="" type="checkbox"/> general operation inspection |
| <input checked="" type="checkbox"/> check hydraulic oil level | <input checked="" type="checkbox"/> check buckets and implements | <input checked="" type="checkbox"/> check boom hardware |
| <input checked="" type="checkbox"/> check coolant level | <input type="checkbox"/> clean cab filter | <input type="checkbox"/> drain water from fuel |
| <input checked="" type="checkbox"/> check pump drive oil level | | |

500 Hour Service

- | | | |
|--|--|--|
| <input type="checkbox"/> change fuel filters | <input checked="" type="checkbox"/> check belts | <input checked="" type="checkbox"/> check for service codes |
| <input checked="" type="checkbox"/> check intake hoses | <input checked="" type="checkbox"/> check final drive oils | <input checked="" type="checkbox"/> check swing bearing grease |
| <input checked="" type="checkbox"/> take oil samples if needed | <input checked="" type="checkbox"/> grease unit | <input checked="" type="checkbox"/> clean cab filters |

1000 Hour Service

- | | | |
|---|---|--|
| <input checked="" type="checkbox"/> drain and refill swing gear oil | <input checked="" type="checkbox"/> check crankcase vent | <input type="checkbox"/> replace hydraulic pivot filter |
| <input checked="" type="checkbox"/> drain and refill splitter box oil | <input type="checkbox"/> test coolant | <input checked="" type="checkbox"/> replace hydraulic fill flow filter |
| <input checked="" type="checkbox"/> replace air cleaner filter | <input checked="" type="checkbox"/> check hydraulic operation | |

2000 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> drain and refill final drive oil | <input type="checkbox"/> check and lubricate track idlers |
| <input type="checkbox"/> set engine valves | |

4000 Hour Service

- | | |
|---|---|
| <input type="checkbox"/> replace engine crankshaft transmission dampner | <input type="checkbox"/> drain and refill coolant |
| <input type="checkbox"/> replace hydraulic oil and clean suction screen | |

ENTERED NOV 10 2023

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

2023-150



COMPANY	viking rentals/farmboy	DATE:	July 17/23
PHONE #		ODOMETER START:	197 189
EMAIL		ODOMETER END:	197 200 439
EQUIPMENT	PC 350 LC	TOTAL KM'S:	1000 250
SERIAL #	HWA 11395	VIKING UNIT #:	ex-50
LOCATION	NW of Rockyford, AB.	CUSTOMER UNIT #:	
		UNIT HOURS:	6047

Issue Reported	<p style="text-align: center;">hydraulic leak and power point for two way radio</p>
----------------	---

Segment 1: travel to site check Hyd leak and power point for two way radio install, travel from Site

Segment 2: found Hyd Cap Pressure bypass / ~~head~~ Dissassemble Cap and reassemble / Need New Cap ordered and installed

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

WO#2023- 150



COMPANY	Farm boy / VIKING RENTALS	DATE:	July 21 / 23
PHONE #		ODOMETER START:	197920
EMAIL		ODOMETER END:	198197
EQUIPMENT	PC 350 LC	TOTAL KM'S:	277kms
SERIAL #	HWA 11395	VIKING UNIT #:	EX 50
LOCATION	NW of Rockyford, AB	CUSTOMER UNIT #:	
		UNIT HOURS:	6064

Issue Reported	<ul style="list-style-type: none"> - oil leak @ hydraulic tank - No power to 24v receptacle
----------------	---

Segment 1: travel to site, install Hyd Cap, travel from site

P/U parts @ SMS equipment in Calgary

Segment 2: tried to install power point with found spacer (would not work)

Segment 3:

Segment 4:

Viking Rentals

64190 - 393 Loop East

Okotoks, AB

T1S 0L1

403-995-3398

wo# 2023-121



COMPANY	viking	DATE:	june 29/23
PHONE #		ODOMETER START:	
EMAIL		ODOMETER END:	
EQUIPMENT		TOTAL KM'S:	
SERIAL #		VIKING UNIT #:	
LOCATION	shop	CUSTOMER UNIT #:	ex50
		UNIT HOURS:	

Issue Reported	repairs to be able to rent
----------------	----------------------------

seg 1 replace fuel injector

seg 2 cut off corks

seg 3 remove thumb

seg 4 other repairs paint, replace mirror check over
CUTTING EDGE.

ENTERED JUL 07 2023

Viking Rentals

64190 - 393 Loop East
 Okotoks, AB
 T1S 0L1
 403-995-3398



VO# 2023-83

COMPañÍA	VIKING	FECHA:	June 15-2022
TELÉFONO #		INICIO DEL	
CORREO ELECTRÓNICO		ODÓMETRO: EXTREMO DEL	
EQUIPO	KOMATSU PC-350	ODÓMETRO:	
SERIAL #	KntPC19 H11WA 11395	TOTAL KM'S:	
UBICACIÓN	SHOP	UNIDAD VIKINGA #:	EX50
		UNIDAD DE CLIENTE #:	
		HORARIO DE LA UNIDAD:	5991

TRABAJO DESCRIPCIÓN	.. Check over
---------------------	---------------

HORA DE COMIENZO	HORA DE FINALIZACIÓN	DESCRIPCION LABORAL	HORAS
1:00	4:30	Detect engine failure - ON GINE with number one injector Probleem	4.3/ hour
		cleaning the codes	
		Re-ticking turning nuts	
		cleaning the engine	

PARTE #	DESCRIPCION DE LA PIEZA	CANTIDAD

REPRESENTANTE VIKINGO	Javier	FECHA DE FINALIZACIÓN:	NO
-----------------------	--------	------------------------	----

NOMBRE DEL REPRESENTANTE DE LA EMPRESA	Conor Chiu	PARA USO EN LA OFICINA
FIRMA DEL REPRESENTANTE DE LA EMPRESA	<i>Conor Chiu</i>	¿FACTURABLE?: <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
FECHA DE APROBACIÓN	July 6/23	INICIAL:

ENTERED JUL 07 2023



VIKING RENTALS

Rental Damage Sheet

Unit #: EX-50

Type: Kobelco 350

Customer: Fish Creek

Date: 2023-06-07

	Part Damaged	Parts Required	Ordered	Labour Hours	Employee
1	Mirror Broken (Stephen confirming with customer on replacement)	Y	Y	5.4	
2	Side Panel Dented (Pre-Existing)				
3	Cleanout Bucket Edge Needs to be Replaced	Y	Y		
4	Arm Hit from Thumb	Y	N		
5					
6					
7					
8					
9					
10					
11					
12					