

Commercial Vehicle Inspection Report

Decal Number: GC69066
Decal Expiry Date: 2025-Oct-31
Inspection Number: 21106782

W03-3
Inspection Result:
PASS

FACILITY: M&S TRAILER REPAIR / S14440
INSPECTOR: LYNN, JAMES / 301132
WORK ORDER #: 3331

INSP. TYPE: Complete
INSP. CLASS: Class 3 - Trailer and Semi-Trailer
INSP. REASON: Annual

INSP. START: 2024-Oct-08 12:30 PM PDT
INSP. COMPLETE: 2024-Oct-15 08:20 AM PDT

VEHICLE JUR: Alberta
PLATE #: 4CZ665

REGI:
UNIT/FLEET#: 53V156
VIN: 1JUV532D7CL623926

LICENCED GVW(kg): 0
VEHICLE YEAR: 2012
MAKE: Wabash
MODEL: dvcvhpc

BODY STYLE: Semi Trailer
ODOMETER:
HUB ODOMETER: 46305 KM
BRAKE TYPE: Air
FUEL TYPE: Not Applicable

OWNER/LESSEE NAME: Overland West Freight Lines Ltd, Overland West Freight Lines Ltd
ADDRESS: 300-10362 King George Hwy
Surrey, British Columbia
V3T 2W5, Canada

Vehicle Identification (VIN)		
Section 1 - Power Train	Passed	
Section 2 - Suspension	Not Applicable	
Section 3 - Brake System	Passed	
Section 3A - Air Brakes	Repaired (same day)	Replaced piggy back at LR. Replaced cam, cam bushing and brake linings at RR.
Section 3H - Hydraulic Brakes	Passed	
Section 4 - Steering	Not Applicable	
Section 5 - Instruments and Auxiliary Equipment	Not Applicable	
Section 6 - Lamps	Passed	
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Passed	
Section 9A - Tires	Repaired (same day)	Repaired/welded cracks on lower rails on both sides. Straightened cross-members at rear. Fish plated lower rail at left front.
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Passed	
Section 11 - Other Vehicle Components	Passed	

Air Brake Chamber Type, Size and Push Rod Stroke (mm)						Tire Tread Depth (mm)				
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	30L	Automatic	34.9	38.1	10	9	9	9	
2	Clamp	30L	Automatic	34.9	34.9	10	11	10	10	
Comment:						Comment:				

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	79	54	Lining (Shoe)	15.9	17.5	Drum		
2	71	90	Lining (Shoe)	14.3	12.7	Drum		
Comment:			Comment:			Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.		

Inspection Comments:

Has this Vehicle been road tested?


No

Road Test Date

Road Tester:

Inspector: LYNN, JAMES

Signature:

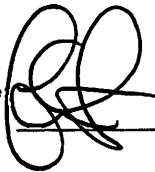

This Inspection Report was submitted to CVSE on 2024-Oct-15 08:21 AMPDT

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSCVIP at the Commercial Vehicle Safety Enforcement

CVSE0014

10/15/2024 8:21:11 AMPDT

RG