


WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

C24-1
MAY

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

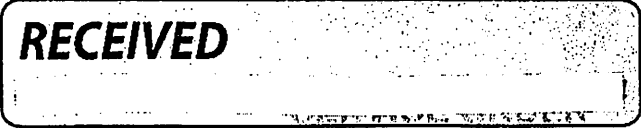

SO#

Printed 04/04/2024 11:21:12 AM

CUSTOMER COPY

User 573 Page 1

Customer No
 Attn: ACCOUNTS PAYABLE
 EMSCO HOLDINGS LP.
 1810 INDUSTRIAL DRIVE
 RM OF SHERWOOD, SK S4K 0A6

Home Bus
 Cell Today
 Email
 Type
 Term 1

Advisor Shay G **Promised** 03/19/2024 6:30 PM **Tag#**
Shop WF **Opened** 03/19/2024 7:50 AM **Location**
Priority **Cashiered** 03/22/2024 9:08 AM **PO #**

License	Odom In	Odom Out	In Service Date	Stock No
	205455	205545		
Year Make	Model	Model Number	Colour	
2018 FORD	SUPER DUTY F-550 DRW	X5H	BLACK	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
1FD0X5HT6JEB86019				
Engine	6.7L 4V OHV POWER STROKE V8			

Request	Description	Job	CSR	Status
161	CHECK AND ADVISE ON CHATTER ON DECEL WHEN USING EXHAUST BRAKE- BELIEVES EXHAUST LEAK, DRIVER SIDE IF MANIFOLDS LEAKING WOULD LIKE WORK QUOTED FOR BOTH SIDES	1	SHAY	Original

Labour	Description	Type	Amount
161	CHECK AND ADVISE - EXHAUST LEAK, DRIVER SIDE BELIEVE, WOULD LIKE WORK QUOTED FOR BOTH SIDES	CD	3,807.50

Part	Description	Shp	Bin	Type	Retail	Price	Amount
FC3Z 9430 B	MANIFOLD ASY - EXHAU	1	G2	CR16			
FC3Z 9448 A	GASKET	2	G2	CR16			
W715713 S431	STUD	14	M4	CR16			
W701706 S430	NUT - HEX. - FLANGED	18	M3	CR16			
BC3Z 6N640 A	GASKET	2	F1D	CR16			
FC3Z 8287 A	CLAMP	1	G1D	CR16			
BC3Z 8287 A	CLAMP	2	G1D	CR16			
W716425 S900	STUD	6	M4	CR16			
W711402 S900	NUT	6	M4	CR16			
W714639 S439	BOLT	4	M4	CR16			
BC3Z 6587 A	GASKET	1	F3	CR16			
BC3Z 9439 C	GASKET - INTAKE MANI	2	G1D	CR16			
BC3Z 9439 A	GASKET - INTAKE MANI	1	G1D	CR16			
BC3Z 9439 B	GASKET - INTAKE MANI	1	G1D	CR16			
CVC 13 G	ANTI-FREEZE	2	J2	CR16			
CG 817	GASKET	1	B1D	CR16			
W717172 S900	STUD	4	M4	CR16			
BC3Z 8527 N	RING - SEALING	1	G1D	CR16			
WPT 1069	WIRE ASY	1	C1D	CR16			
Technician	1122 -				Parts Total		
Cause	broken bolts in exhaust manifold				Labour Total		
					Request Sub-total		

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.


PRIVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001

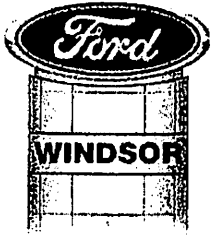

WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

SO#

**SERVICE ORDER
 CUSTOMER COPY**

111

Printed 04/04/2024 11:21:12 AM

User 573 Page 2

Customer No Attn: ACCOUNTS PAYABLE EMSCO HOLDINGS LP. 1810 INDUSTRIAL DRIVE RM OF SHERWOOD, SK S4K 0A6 Home Bus Cell ? Today Email Type Term	Advisor Shay G Promised 03/19/2024 6:30 PM Tag# Shop WF Opened 03/19/2024 7:50 AM Location Priority Cashiered 03/22/2024 9:08 AM PO #
	License Odom In Odom Out In Service Date Stock No 205455 205545 Year Make Model Model Number Colour 2018 FORD SUPER DUTY F-550 DRW X5H BLACK Vehicle ID No Selling Dealer Extended Warranty Delivery Date 1FD0X5HT6JEB86019 Engine 6.7L 4V OHV POWER STROKE V8

Correction confirmed cust concern. replaced right exhaust manifold, removed left one and remove broken off bolts, removed turbo, installed egr cooler delete, installed new connector for turbo due to very brittle and broken upon removal. Installed new studs on both manifolds, reassembled and retested and all is good at present time as per est.

Request	Description	Job	CSR	Status
99P	WINDSOR FORD SAFETY & RELIABILITY INSPECTION	2	SHAY	Original

Labour	Description	Type	Amount
99P	WINDSOR FORD SAFETY & RELIABILITY INSPECTION	C	0.00

Technician	1122 -
Cause	a
Correction	a

Request	Description	Job	CSR	Status
888	CUSTOMER INFORMATION/CONTACT#	3	SHAY	Original

CUSTOMER'S PREFERRED METHOD OF CONTACT:
 TEXT _____ CALL _____ EMAIL _____

ENGINE HOURS _____

Would you like your used parts returned Yes / No (not applicable if warranty)

Labour	Description	Type	Amount
888	CUSTOMER INFORMATION/CONTACT#	CQL	0.00

CUSTOMER'S PREFERRED METHOD OF CONTACT:
 TEXT _____ CALL _____ EMAIL _____

ENGINE HOURS _____

Would you like your used parts returned Yes / No (not applicable if warranty)

Technician 999 -

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001



WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

SO#

**SERVICE ORDER
 CUSTOMER COPY**

Printed 04/04/2024 11:21:12 AM

User 573 Page 3

Customer No Attn: ACCOUNTS PAYABLE EMSCO HOLDINGS LP. 1810 INDUSTRIAL DRIVE RM OF SHERWOOD, SK S4K 0A8 Home Cell Email Bus Today Type Term	Advisor Shay G Shop WF Priority	Promised 03/19/2024 6:30 PM Opened 03/19/2024 7:50 AM Cashiered 03/22/2024 9:08 AM	Tag# Location PO #
	License 205455 Year Make 2018 FORD Vehicle ID No 1FDOX5HT6JEB86019 Engine 6.7L 4V OHV POWER STROKE V8	Odom In 205455 Odom Out 205545 Model SUPER DUTY F-550 DRW X5H Selling Dealer	In Service Date Model Number X5H Extended Warranty

Request	Description	Job	CSR	Status
190	CHECK AND ADVISE - BLOCK HEATER KEEPS TRIPPING BREAKER	4	SHAY	Original
Labour	Description		Type	Amount
190	CHECK AND ADVISE - BLOCK HEATER KEEPS TRIPPING BREAKER		CD	
Technician	1122 -	Labour Total		
Cause	NPF	Request Sub-total		
Correction	Inspected block heater cord and element and both are passing. checked for short to ground and all is working normally at present time. plugged into a gfi and it works normally.			

Request	Description	Job	CSR	Status
161	CHANGE CRANK CASE VENT FILTER	5	SHAY	Original
Labour	Description		Type	Amount
161	CHANGE CRANK CASE VENT FILTER		CD	
Part	Description	Shp	Bin	Type
GC4Z 6A785 D	SEPARATOR ASY - OIL	1	F2	CR16
Technician	1122 -	Parts Total		
Cause	requested	Labour Total		
Correction	replaced crank case filter assembly as requested, as per est.	Request Sub-total		

Request	Description	Job	CSR	Status
202	CHECK FOR WEAK WASHER FLUID PRESSURE- DRIVER INSTALLED FITTING ON D/S HOSE - SINCE THEN PRESSURE HAS BEEN WEAK UNSURE IF PUMP OR ISSUE WITH FITTING	6	SHAY	Original
Labour	Description		Type	Amount
202	check dn advise - washer nozzles dont appear to be giving full pressure, fitting on driver side was leaking and driver did change it and thats when pressure issue started		C	
Technician	1122 -	Labour Total		
Cause	plastic stuck into hose	Request Sub-total		
Correction	Inspected for w/w not spraying properly. confirmed cust concern, further testing and inspection found plastic debris in the line. blew out lines and re tested and all is working normally at present time.			

Request	Description	Job	CSR	Status
161	CHEC ADN ADVISE ON CEL LIGHT	7	SHAY	Original

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-665-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001



WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

SO#

**SERVICE ORDER
 CUSTOMER COPY**

Printed 04/04/2024 11:21:12 AM

User 573 Page 4

Customer No
 Attn: ACCOUNTS PAYABLE
 EMSCO HOLDINGS LP.
 1810 INDUSTRIAL DRIVE
 RM OF SHERWOOD, SK S4K 0A6

Home Cell Email

Bus Today

Type Term

Advisor Shay G	Promised 03/19/2024 6:30 PM	Tag#
Shop WF	Opened 03/19/2024 7:50 AM	Location
Priority	Cashiered 03/22/2024 9:08 AM	PO #

License	Odom In 205455	Odom Out 205545	In Service Date	Stock No
Year 2018	Make FORD	Model SUPER DUTY F-550 DRW X5H	Model Number	Colour BLACK
Vehicle ID No 1FD0X5HT6JEB86019	Selling Dealer	Extended Warranty	Delivery Date	
Engine 6.7L 4V OHV POWER STROKE V8				

Labour	Description	Type	Amount
161	CHEC ADN ADVISE ON CEL LIGHT	CD	
Technician	1122 -		
Cause	code U0074, U0106.		
Correction	Inspected for cel on. checked for codes and had U0074, U0106. Unit has programed to a 2017 model year. cleared codes and tried to reduplicate codes and could not. performed a glow plug module test and it passes. would like to update glow plug module but it will wipe out the tuner. may have something to do with the programing.		
		Labour Total	
		Request Sub-total	

Request	Description	Job	CSR	Status
170	CHECK ADN ADVISE INTERMITTANT HARSH DOWNSHIFT - BELIEVS POSSIBLE TORQUE LOCKING UP	8	SHAY	Original
Labour	Description	Type	Amount	
170	CHECK ADN ADVISE INTERMITTANT HARSH DOWNSHIFT - BELIEVS POSSIBLE TORQUE LOCKING UP	CD	0.00	
Technician	1122 -			
Cause	ROAD TEST ADN COULD NOT DUPLICATE			

Labour
 Parts
 Supplies
 Env Fee
 Sub-Total
 GST
Total Invoice

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001

LD Contracting Ltd.

PO Box 948
 Warman, SK S0K 4S0
 Email: l.d.contracting@sasktel.net
 PH (306) 229-7798 Fax (306) 668-8482

Date	Invoice #
2025-06-05	

Invoice To
BMSCO Heavy Equipment 523 Cory Cres S Saskatoon, SK S7K 3J7 Canada



ALL WHEELS MUST BE RETORQUED WITHIN 100KM

LICENCE#	PURCHASE ORDER#	ODOMETER	PST EXEMPT#
		153893KM	

Item	Description	Hours/Quantity	Rate	Amount
	UNIT# EM303 SERIAL# 8F407839			
SGI FLAT RATE	GOVERNMENT INSPECTION TRUCK			
LABOUR	REPLACE DRAG LINK AND TIE ROD	2.5		
LABOUR	REPAIR ABS WIRING AND RECALIBRATE	1.75		
LABOUR	REPAIR DOOR WEATHER STRIPPING	0.25		
LABOUR	REPAIR WINDSHIELD WASHERS	0.25		
LABOUR	REPLACE PASSENGER LOWER KING PIN GREASE NIPPLE AND GREASE FRONT END	0.25		
LABOUR TIREM...	REMOVE AND REPLACE TIRES, SEND FOR REPLACEMENT. MEDIUM TRUCK TIRE CHANGEOVER *SUBLET*	2		
DECAL	SGI DECAL A208741	1		
M177	TIRE STEER LH 144/142L 14-G 11R22.5	2		
1236710	DRAG LINK	1		
880083	OUTER TIE ROD END	1		
NPN100Z	BALANCE BEAD	2		
RECMT	TIRE RECYCLING FEE	2		
00163	GREASE NIPPLE	1		
832350	BUTT CONNECTOR	2		
RE12	FREE ALL 11OZ AEROSOL	0.25		
313	BRAKE KLEEN - BHC INC	1		
30709	GREASE	1		
15215	WINDSHIELD WASHER FLUID 4L JUG	1		

Sales tax total

Subtotal

Balance Due

GST/HST No. 844975839RT0001

LD Contracting Ltd.

PO Box 948
 Warman, SK S0K 4S0
 Email: l.d.contracting@sasktel.net
 PH (306) 229-7798 Fax (306) 668-8482

Date	Invoice #
2025-06-05	

Invoice To
EMSCO Heavy Equipment 523 Cory Cres S Saskatoon, SK S7K 3J7 Canada

ALL WHEELS MUST BE RETORQUED WITHIN 100KM

LICENCE#	PURCHASE ORDER#	ODOMETER	PST EXEMPT#
3		153893KM	

Item	Description	Hours/Quantity	Rate	Amount
FR8 SS	FREIGHT S&H SHOP SUPPLIES GST on sales PST (SK) on sales			

Balance due is in Canadian funds
 E-Transfer payable to l.d.contracting@sasktel.net
 All credit card payments will incur a 3% surcharge
 Please make all cheques payable to LD Contracting Ltd
 Total due within 30 days. Overdue accounts subject to a service charge of 2% per month.

SERVICE WITH YOUR SAFETY IN MIND. THANK YOU FOR YOUR BUSINESS!

GST/HST No. 844975839RT0001

Sales tax total
Subtotal
Balance Due

Superior Diesel Services Ltd
 620 - 46TH STREET EAST
 SASKATOON SK S7K 0W9
 +13062444010
 info@superiordieselservices.ca
 superiordieselservices.ca
 GST/HST Registration No.:
 781604327rt0001
 PST SK Registration No.: 2610707



INVOICE

BILL TO

Emsco Heavy Equipment

INVOICE # :

DATE 19-11-2025

DUE DATE 19-11-2025

TERMS Due on receipt

ACTIVITY	QTY	RATE	TAX	AMOUNT
2018 F550 SERVICE TRK VIN# JEB86019				
Light Duty 5 REMOVE HEADLIGHTS & ADJUSTED PROPER SO HIGH LOW BEAMS WORK AS THEY SHOULD REPLACE BROKEN REAR WHEEL STUD & WHEEL SEAL - CUSTOMER SUPPLIED PARTS	3.50		GST/PST SK	
Light Duty 7 INSTALL DCR INJECTION PUMP CONVERSION KIT REPAIR WATER IN FUEL LIGHT REPLACE BOTH FUEL FILTERS TEST DRIVE WASH UNIT	10		GST/PST SK	
PF46174KIT FUEL FILTER KIT	1		GST/PST SK	
Parts BT130 TENSIONER	1		GST/PST SK	
Parts DCR INJECTION PUMP CONVERSION KIT	1		GST/PST SK	
FREIGHT FREIGHT EMERGENCY OVERNIGHT	1		GST/PST SK	
shop supplies	1		GST/PST SK	

SERVICE COMPLETED @ 260,124KM
 TECH=K.M/R.M
 INVO=J.S