



LIGHT VEHICLE SERVICING

Date:	<i>08.12.24</i>	VIN:	<i>MR0HZ22G603510772</i>
Unit Number:	<i>LR107</i>	Mechanic:	<i>AMANDA</i>
Rego Number:	<i>1GA2DH</i>	Mechanic:	
Service Type:	<i>10,000</i>	Serviceman:	
Kilometres:	<i>403,381</i>	Operator:	
Hours:		Spotter:	

INSPECTION SCHEDULE

EVERY 10,000 SERVICE

The following inspections require having the engine running or machine moving. Use of an operator and spotter may be required.

IN CAB

No.	ACTION	CHECKS	S	US	N/A	Initial
1	Inspect	Door latches & seals	<i>X</i>			<i>AH</i>
2	Check	Operation of window winders & door handles	<i>X</i>			<i>AH</i>
3	Inspect	Seat belt for damage, fraying & anchor bolt security	<i>X</i>			<i>AH</i>
4	Check	Seat for correct operation, excessive movement, cover & cushion condition	<i>X</i>			<i>AH</i>
5	Check	Operation of ignition & security of key, instrument cluster, warning alarms, warning indicator lights & horn	<i>X</i>			<i>AH</i>
6	Check	Windscreen & other glass in the cab for chips or cracks	<i>X</i>			<i>AH</i>
7	Check	Wipers & Washers	<i>X</i>			<i>AH</i>
8	Check	Park lights, headlights, spot lights, indicators, brake lights, internal cab light, reverse camera & rotating beacon	<i>X</i>			<i>AH</i>
9	Check	Operation of AM / FM radio & UHF radio	<i>X</i>			<i>AH</i>
10	Check	Rear view mirrors & brackets for condition & operation	<i>X</i>			<i>AH</i>
11	Check	Operation of steering wheel (lock to lock), security of the column adjustor	<i>X</i>			<i>AH</i>
12	Check	Operation of air conditioner & heater	<i>X</i>			<i>AH</i>
13	Check	Clutch pedal free play operation / adjustment	<i>X</i>			<i>AH</i>
14	Check	Pedal rubbers are on & in good condition	<i>X</i>			<i>AH</i>
15	Check	For breakdown triangles, condition & complete set			<i>X</i>	<i>AH</i>
16	Check	For the wheel brace & jack	<i>X</i>			<i>AH</i>
17	Check	For a first aid kit, in date & complete	<i>X</i>			<i>AH</i>
18	Check	Operation of E-Stops			<i>X</i>	<i>AH</i>
19	Check	Fire extinguisher for safety ties, gauge in green, rotate a couple of times & tap bottom to release sediment	<i>X</i>	<i>X</i>		<i>AH</i>

RUNNING CHECKS

No.	ACTION	CHECKS	S	US	N/A	Initial
20	Check	For excessive exhaust smoke or abnormal noises / vibrations	<i>X</i>			<i>AH</i>
21	Test	The operation of all gears, ease of selection, ease of selection between 2WD & 4 x 4 High & low range	<i>X</i>			<i>AH</i>
22	Test	Operation of automatic transmission kick down, lock-up & neutral inhibitor			<i>X</i>	<i>AH</i>
23	Test	Service brake operation / adjustment	<i>X</i>			<i>AH</i>
24	Test	Park brake operation (test on a 10° slope)	<i>X</i>			<i>AH</i>

25	Test	For brake & park brake drag	X			AH
26	Test	Cruise control	X			AH
27	Test	Lane Assist & Front / Rear Traffic Alert systems			X	AH
28	Check	The general driving characteristics of vehicle	X			AH
29	Check	Using a scan tool, check for faults		X		AH
30	Check	DPF Status & conduct a manual burn if required	X			AH

FRAME & BODY

Park on level ground, Isolate generator, Fit body prop, Relieve all pressures, Start from front right hand side and work

No.	ACTION	CHECKS	S	US	N/A	Initial
31	Check	Cab mounts, bonnet release cable, operation of bonnet tilt struts / locking mechanism	X			AH
32	Check	For external body damage	X			AH
33	Check	Mudguards, mudflaps for condition & security	X			AH
34	Check	For metal fatigue in chassis rails, cross members, tow hitch frame & tow ball	X			AH
35	Inspect	Electrical harnesses / junction boxes for chaffing & dust sealing	X			AH
36	Inspect	Exhaust mufflers, piping & mounts for leaks & security	X			AH
37	Check	Hazard warning / component location Decals			X	AH
38	Inspect	All grease lines for damage / security & grease penetration	X			AH

UNDER BONNET / ENGINE BAY

No.	ACTION	CHECKS	S	US	N/A	Initial
39	Check / Clean	Check battery isolator, battery box, mountings, terminals, cables & electrolyte levels	X			AH
40	Inspect	Exhaust manifolds / covers, bolts, turbo, piping for any leaks & security	X			AH
41	Inspect / Tighten	Air induction boxes / hoses / piping / fittings for damage & presence of dusting	X			AH
42	Inspect	Fuel pump / pipes / hoses / clamps, for leakage & movement	X			AH
43	Inspect	Engine for oil leaks & damaged hoses	X			AH
44	Inspect	Engine mounts for wear & security	X			AH
45	Check	Water pump "tell tail" for leakage or blockage	X			AH
46	Inspect	Alternator pulley, mountings, bearings & idler pulleys	X			AH
47	Inspect	Air Conditioner compressor pulley, mountings, hose connections for leakage & movement	X			AH
48	Inspect	Fan, alternator, air conditioner belts for condition & tension	X			AH
49	Inspect	Fan blades for cracks, wear, damage & security	X			AH
50	Check	Radiator mountings, coolant leakage & air flow through radiator	X			AH
51	Inspect	Coolant / heater hoses / clamps for condition, leaks & tightness	X			AH
52	Inspect	Power steering reservoir, pump, hoses for leakage	X			AH
53	Inspect	Power steering box for oil leaks, excessive movement, security of steering	X			AH
54	Inspect	Steering column universal joints, slip joint & mountings	X			AH
55	Inspect	Electrical harnesses / connections for damage & security	X			AH
56	Inspect	Engine bay is free of combustible materials i.e. leaves, sticks & rags for prevention of fire hazards	X			AH

POWER TRAIN & AXLES

Jack up all axles to check wheel bearings, steering linkages & kingpins

No.	ACTION	CHECKS	S	US	N/A	Initial
57	Inspect	Wheel rims for damage, cracks missing or loose wheel nuts	X			AH
58	Check	Front wheel bearings adjust or replace if necessary	X			AH
59	Check	Rear wheel bearings adjust or replace if necessary	X			AH
60	Inspect	Both front & rear drive shafts	X			AH
61	Inspect	All brake linings, pads for thickness & adjustment, adjust if required	X			AH
62	Check	Operation / wear of brake callipers	X			AH

63	Inspect	For movement in both upper & lower ball joints, shocky tower security, steering linkages & ball joints						X			AH	
64	Inspect	All shackle pins, bushes, shock absorbers, U bolts, wear plates for wear, movement& tension						X			AH	
65	Inspect	Universal joints, slip joints, centre bearings for movement & rubber						X			AH	
66	Inspect	Torque rod arms, pins, bushes, mounting bolts for wear & tension						X			AH	
67	Inspect	Gearbox / Transmission for oil leaks, mounts & lubrication of pivot points						X			AH	
68		Differentials for oil leaks, excessive movement in input & output shafts						X			AH	
	Inspect	Tyres for damage, tread depth & pressure					SPARE					AH
69	Depth	LHSF:	12	mm	LHSR:	9	mm	15	mm	X		AH
		RHSF:	10	mm	RHSR:	9	mm		mm			
	Damage	LHSF:	Nil		LHSR:	Nil				X		AH
		RHSF:	Nil		RHSR:	Nil						
70	Pressure	RHSF:	34	psi	RHSR:	34	psi		psi	X		AH
		LHSF:	34	psi	LHSR:	34	psi		psi			
71	Rotate	Tyres, including spare							X		AH	

30,000 km Service

Check / Change & Adjust

No.	ACTION	CHECKS						S	US	N/A	Initial
72	Measure	Brake drums or Rotors									
		RHSF:		mm	RHSR:		mm				
		LHSF:		mm	RHSR:		mm				
73	Measure	Brake linings or pads									
		RHSF:		mm	RHSR:		mm				
		LHSF:		mm	LHSR:		mm				
74	Inspect	For worn, damaged or broken brake actuators / leaking wheel cylinders,									

100,000 km Service

75		Cylinder 1		Cylinder 2		Cylinder 3		Cylinder 4					
	Intake												
	Exhaust												
		Cylinder 5		Cylinder 6		Cylinder 8		Cylinder 8					
	Intake												
	Exhaust												
76	Check	Wheel Bearings Check /Change & Re-pack with grease											
		LHSF:		LHSR:		RHSF:		RHSR:					
77	Check	Glow Plugs for power & conduct a continuity test on each plug											
78	Check	Using a Coolant Test Strip & compare to chart, change if necessary											
79	Replace	Replace Timing Belt											

LUBRICATION SCHEDULE

15,000 km

80	Change	Engine Oil:		X			
81	Change Filters	Engine Oil (Cut/Inspect):		X	Fuel / Water Seperator:		X
82	Check / Top up	Gearbox / Transmission:		X	Transfer Case:		X
		Front Diff:		X	Rear Diff:		X
		Power Steering Fluid:		X	Coolant:		X
		Brake / Clutch Fluid:		X	Windscreen Washer Fluid:		X

30,000 km Service

83	Change Filters	High Pressure Fuel Filter:			Air Cleaner:		
84	Inspect Air Intake	Signs of Dusting Y /N:					
85	Inspect , Clean /	Engine:			Front Diff:		

[illegible]

Name of Mechanic / Supervisor

Andrews Autos TA Weightm

Factory 3 / 30 Michael Street
 Pakenham VIC 3810
 ABN 33 557 172 616
 Tel: 03 5941 7450 Fax: 03 5941 7452
 Email: info@aapakenham.com.au
 Website: www.andrewsautos.com.au

ANDREWS AUTOS

PH: 5941 7450

WWW.ANDREWSAUTOS.COM.AU




Tax Invoice

Inv. No.	35,379	Date	17/8/22	Order No.	-	Sales ID	-
Client Details Linct Group 2 / 4 Purton Road Pakenham Vic 3175				Vehicle Details Registration: 1GA2DH Odo: 343455 Make/Model: TOYOTA HI-LUX Type: 4WD Year: 2010 VIN#: MR0HZ22G603510772 Next service: LOG BOOK SERVICE- large 4WD Due: 17/2/23 Kms: 353455			
Account	11896	Home	-	Work	-	Mobile	0407777477

Services, Parts & Labour**Mechanical**

Qty	Description	Unit Price	Total (Ex)	Tax	Total (Inc)
1	LOG BOOK SERVICE- large 4WD	\$200.00	\$200.00	\$20.00 GST	\$220.00
1	Sundries- Inc' Small Quantities Grease, Top Up Fluids, W' screen washer additive ,Sealants, Hardware.	\$16.36	\$16.36	\$1.64 GST	\$18.00
1	Epa Levy , Waste Disposal Inc. Hazardous Waste.	\$6.36	\$6.36	\$0.64 GST	\$7.00
1	Engine Oil Flush Treatment.	\$20.00	\$20.00	\$2.00 GST	\$22.00
7	PRO 15 PLUS 15W-50	\$13.25	\$92.73	\$9.27 GST	\$102.00
1	Oil Filter	\$20.00	\$20.00	\$2.00 GST	\$22.00
1	Sump Plug Washer	\$4.55	\$4.55	\$0.45 GST	\$5.00
1	Air Filter	\$58.18	\$58.18	\$5.82 GST	\$64.00
1	FILTER - CABIN AIR MICROSHIELD	\$40.00	\$40.00	\$4.00 GST	\$44.00
1	Wheel Alignment	\$68.18	\$68.18	\$6.82 GST	\$75.00
1	FUEL FILTER REPLACEMENT- DIESEL	\$50.00	\$50.00	\$5.00 GST	\$55.00
1	Fuel Filter Cartridge	\$35.45	\$35.45	\$3.55 GST	\$39.00
1	SHOCK ABSORBER REPLACEMENT	\$254.55	\$254.55	\$25.45 GST	\$280.00
2	SHOCK S-S-GAS MAGNUM 009	\$255.46	\$510.91	\$51.09 GST	\$562.00
1	BC VALVE CAP -BLACK	\$1.00	\$1.00	\$0.10 GST	\$1.10
1	PUNCTURE REPAIR	\$40.91	\$40.91	\$4.09 GST	\$45.00
2	Wheel Balance	\$11.37	\$22.73	\$2.27 GST	\$25.00
1	DIFF OIL REPLACEMENT & TRANSFER CASE OIL REPLACEMENT	\$72.73	\$72.73	\$7.27 GST	\$80.00
4	OIL-TRANSGEAR 75W90 20L	\$15.00	\$60.00	\$6.00 GST	\$66.00
5	OIL-GEAR OIL 80W90 60L	\$10.73	\$53.64	\$5.36 GST	\$59.00
			\$1,628.28	\$162.82	\$1,791.10

Work Done

CARRIED OUT VEHICLE LOG BOOK SERVICE - replacing parts as listed. Checks include tyres condition and pressures, raising the vehicle on the hoist and checking underbody exhaust system and mounting, steering and suspension, pipework, brakes, drive shafts and joints, all fluid levels and their condition and underbonnet checks of all fluid levels and their condition, drive belts, wiper/washer operation, lighting, battery and charge and other checks specific to the kms. Road tested vehicle on completion of all works to ensure customer satisfaction.
 Missed one full service.
 On about 343,000kms

Replaced oil and oil filter
 Replaced sump plug washer

Vehicle Report

Approx Brake Lining Thickness - (3mm is low but still ok)
 Front 4 mm, Rear 5 mm

During repairs to this vehicle, these items were noted
 Reported Fault Codes

IM: Immediate
 EA: Early attention
 N: Next service
 O: Monitor/Observation

O: L/H No plate lamp not working - needs lamp
 O: Front tyres badly scoloped now on rear

SCANNED

24130

ENTERED	
Date 18/8	By MA

9999

Replaced Air Filter and Cabin filter
Wheels rotated and balanced

DIFFs' OIL REPLACEMENT and transfer case Drained And
Then Refilled The Diff With New Gear Oil.

DIESEL FUEL FILTER REPLACEMENT entailed removing
any attached hardware, remove then replace filter ensuring
leak proof seal and bleeding system on completion.

SHOCK ABSORBER REPLACEMENT Front - Raised
Vehicle, Remove Spring Load From Shock Absorber Prior To
Removal And Replacement Of Shock Absorber.

PUNCTURE REPAIR-

Financial Summary

Total (Ex. Tax)	\$1,628.28	Terms	Cash on delivery
Tax Total	\$162.82	Paid	\$0.00
Total (Inc. Tax)	\$1,791.10	Balance	\$1,791.10

Andrews Autos
Business Account

BSB 083 547 Acc No 747698419


Our goods and services come with guarantees that cannot be excluded under the Australian Consumer Law. For major failures with the service, you are entitled: 1. to cancel your service contract with us; and 2. to a refund for the unused portion, or to compensation for its reduced value. You are also entitled to choose a refund or replacement for major failures with goods. If a failure with the goods or a service does not amount to a major failure, you are entitled to have the failure rectified in a reasonable time. If this is not done, you are entitled to a refund for the goods and to cancel the contract for the service and obtain a refund of any unused portion. You are also entitled to be compensated for any other reasonably foreseeable loss or damage from a failure in the goods or service. For details visit repcoservice.com

LR107

Andrews Autos TA Weightman Auto

9999

Factory 3 / 30 Michael Street
 Pakenham VIC 3810
 ABN 33 557 172 616
 Tel: 03 5941 7450 Fax: 03 5941 7452
 Email: info@aapakenham.com.au
 Website: www.andrewsautos.com.au
 RTA No. AU47170

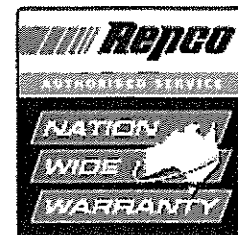**Tax Invoice**

Inv. No.	36,917	Date	27/3/23	Order No.	-	Sales ID	-
Client Details Linct Group 2 / 4 Purton Road Pakenham Vic 3175				Vehicle Details Registration: 1GA2DH Odo: 354496 Make/Model: TOYOTA HI-LUX Type: 4WD Year: 2010 VIN#: MR0HZ22G603510772 Next service: SCHEDULED SERVICE - LARGER Due: 27/9/23 Kms: 364496			
Account	11896	Home	-	Work	-	Mobile	0418140661

Services, Parts & Labour**Mechanical**

Qty	Description	Unit Price	Total (Ex)	Tax	Total (Inc)
1	LOG BOOK SERVICE- large 4WD	\$200.00	\$200.00	\$20.00	\$220.00
1	Sundries- Inc` Small Quantities Grease, Top Up Fluids, W`screen washer additive ,Sealants, Hardware.	\$16.36	\$16.36	\$1.64	\$18.00
1	Epa Levy , Waste Disposal Inc. Hazardous Waste.	\$6.36	\$6.36	\$0.64	\$7.00
1	Engine Oil Flush Treatment.	\$20.00	\$20.00	\$2.00	\$22.00
7	OIL-HPR DSL 10 10W40 ENVRBOX 20L	\$13.51	\$94.55	\$9.45	\$104.00
1	Oil Filter	\$20.91	\$20.91	\$2.09	\$23.00
1	Sump Plug Washer	\$4.55	\$4.55	\$0.45	\$5.00
1	Air Filter	\$62.73	\$62.73	\$6.27	\$69.00
1	FILTER - CABIN AIR MICROSHIELD	\$40.00	\$40.00	\$4.00	\$44.00
1	WIPER BLADE REPLACEMENT x2	\$5.45	\$5.45	\$0.55	\$6.00
2	Wiper Inserts 6mm 22inch	\$6.00	\$12.00	\$1.20	\$13.20
1	BRAKE PAD REPLACEMENT- front	\$63.64	\$63.64	\$6.36	\$70.00
1	Front Brake Pads 4wd	\$107.27	\$107.27	\$10.73	\$118.00
1	BRAKE DISCS REPLACEMENT - front	\$65.45	\$65.45	\$6.55	\$72.00
2	Brake disc rotor	\$135.46	\$270.91	\$27.09	\$298.00
1	BRAKE FLUID FLUSH	\$54.55	\$54.55	\$5.45	\$60.00
1	BRAKE / CLUTCH FLUID	\$35.45	\$35.45	\$3.55	\$39.00
			\$1,080.18	\$108.02	\$1,188.20

Work Done

CARRIED OUT VEHICLE LOG BOOK SERVICE - replacing parts as listed. Checks include tyres condition and pressures, raising the vehicle on the hoist and checking underbody exhaust system and mounting, steering and suspension, pipework, brakes, drive shafts and joints, all fluid levels and their condition and underbonnet checks of all fluid levels and their condition, drive belts, wiper/washer operation, lighting, battery and charge and other checks specific to the kms. Road tested vehicle on completion of all works to ensure customer satisfaction.

Replaced oil and oil filter.
 Replaced sump plug washer.
 Replaced air and cabin filter.

REPLACED WIPER BLADES ensuring correct location in

Vehicle Report

Approx Brake Lining Thickness - (3mm is low but still ok)
Front NEW Rear 4.5 mm

During repairs to this vehicle, these items were noted
 Reported Fault Codes


IM: Immediate
 EA: Early attention
 N: Next service
 O: Monitor/Observation

O: Rear shocks sweaty.
 O: Turbo weeping.
 O: All tyres scoloped on edges. (Spare LHR).

SCANNED

Andrews Autos TA Weightman Auto

Factory 3 / 30 Michael Street
Pakenham VIC 3810
ABN 33 557 172 616
Tel: 03 5941 7450 Fax: 03 5941 7452
Email: info@aapakenham.com.au
Website: www.andrewsautos.com.au
RTA No. AU47170

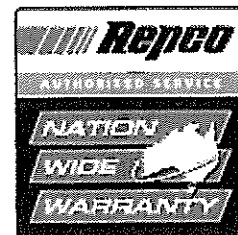

Tax Invoice

Inv. No.	36,917	Date	27/3/23	Order No.	-	Sales ID	-
----------	--------	------	---------	-----------	---	----------	---

REPLACED WIPER BLADES ensuring correct location in arms to ensure full contact with windscreen.

BRAKE PADS REPLACEMENT Removed wheels and disassembled callipers to ensure proper operation of calliper slides and reassembled then road tested.

BRAKE DISC REPLACEMENT required raising vehicle and removing wheels and calliper assemblies, removing and replacing disc then reassembly and test on completion.

BRAKE FLUID FLUSH Drained the fluid from the master cylinder. Cleaned the cap & reservoir. Refilled with fluid, then raised the vehicle and pressure bled the new fluid through the system, Removed any air and refilled the chamber. Rechecked operation.

Financial Summary			
Total (Ex. Tax)	\$1,080.18	Terms	Cash on delivery
Tax Total	\$108.02	Paid	\$0.00
Total (Inc. Tax)	\$1,188.20	Balance	\$1,188.20

Andrews Autos
Business Account

BSB 083 547 Acc No 747698419

Our goods and services come with guarantees that cannot be excluded under the Australian Consumer Law. For major failures with the service, you are entitled: 1. to cancel your service contract with us; and 2. to a refund for the unused portion, or to compensation for its reduced value. You are also entitled to choose a refund or replacement for major failures with goods. If a failure with the goods or a service does not amount to a major failure, you are entitled to have the failure rectified in a reasonable time. If this is not done, you are entitled to a refund for the goods and to cancel the contract for the service and obtain a refund of any unused portion. You are also entitled to be compensated for any other reasonably foreseeable loss or damage from a failure in the goods or service. For details visit repcoservice.com

Mechanical Job Card

Internal Repairs Job Card

Submitted at 11:15 AM, 22nd Mar, 2024

Created by **Jake Van Puyenbroek** at **11:14 AM, 22nd Mar, 2024** from **Mobile**

V.1 submitted by **Jake Van Puyenbroek** at **11:15 AM, 22nd Mar, 2024** from **Mobile**

Result ID / version

#45710 / V.1

Form ID

#176

Form Result Details

Q1. Time & Date

12:14 PM, 22nd Mar, 2024

Q2. Additional Information

Driver complaint to Steve hand brake N/W

Q3. Asset

LR107 - Hilux DC - FV - 1GA2DH

Q4. Km's or Hours

376000

Q5. Description of Repairs or Maintenance Completed

Adjusted brakes and handbrake cable

Q6. Time Required to Complete

1

Q7. Sign Off

5 v p