

Roth Truck & Trailer 1000110643 ON LTD.

290 Hamilton Rd.

New Hamburg, On. N3A 1A2

Phone: 519-804-2031 Fax: 000- -

INVOICE**5459**

HST#747847804RT0001

Invoice from History

Printed Date: 01/12/2026

Work Completed: 05/02/2025

	2004 Freightliner - M2 Series - M2-106 - Caterpillar C-7 ADEM A4/ACEI
	Lic # : AW 50749 Odometer In : 2060350
	Unit # : 2
	VIN # : 1FVHCYDC3 4HN11825

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
GREASE DYNALIFE 220 #2		0.50	8.41	4.21	ANNUAL SAFETY INSPECTION 3 AXLE TRUCK.	6.50	715.00
1082317					COMPLETED ANNUAL INSPECTION CHECKLIST OF TRUCK INCLUDING RECORDING ALL TIRES AND BRAKES MEASUREMENTS. RECORDED ANY DEFECTS. ADJUSTED ALL BRAKES AND TORQUED WHEELS TO 475 FT LBS.		
KENDALL SUPER DXA 15W40 CK4 SYNTHETIC BLEND		25.00	5.89	147.25	REPLACE WIND SHIELD		539.00
15W40					REMOVE BROKEN WIND SHIELD AND REPLACE WITH NEW ONE		
AIR FILTER		1.00	92.96	92.96	PM-B HIGHWAY TRUCK	1.50	150.00
LUBLAF3233					REPLACE ENGINE OIL AND FILTER. REPLACE FUEL FILTERS. GREASE CHASSIS AND DRIVE LINE. ADJUST BRAKES. COMPLETE VEHICLE MULTI POINT CHECKLIST.		
FUEL FILTER		1.00	21.46	21.46	REPLACE CABIN AIR FILTER AND ENGINE AIR FILTER. FOUND BOTH NEEDING REPLACED ON PM INSPECTION.	0.30	34.50
WIX33626					STEERING BOX BOLTS LOOSE	0.30	34.50
FUEL FILTER		1.00	40.84	40.84	TIGHTENED ALL STEERING BOX HARDWARE THAT WAS LOOSE SECURING OT FRAMERAIL.		
WIX33411					REPAIR WIRING, MARKER LIGHTS OUT. REPAIRED LIGHTS OUT.	0.30	34.50
OIL FILTER		1.00	21.28	21.28	RH STEER AIR BRAKE HOSE KINKED AND RUBBING	0.30	34.50
WIX57791					RE ROUTED AND CORRECTED.		
DELO EXT LIFE PREMIX COOLANT		2.00	15.39	30.78	CAB SHOCK IS LOOSE	0.20	23.00
CHO227811J							
CABIN FILTER FREIGHTLINER		1.00	22.39	22.39			
WIX49082							
BUTT CONNECTOR Size: 10-12 GAUGE		4.00	0.25	1.00			
2500-CS							
HEAT SHRINK 3/16 BLACK		2.00	2.86	5.72			
775.0316							
LED RED 2 INCH		2.00	13.64	27.28			
TRU3050							
GROM CLOSED BACK 2 INCH		2.00	4.20	8.40			
TRU30702							
LED 2.5" AMBER		2.00	13.34	26.68			
TRU1050A							
PIGTAIL		1.00	3.09	3.09			
GRL67050							
MIRROR CONVEX NON HEATED		1.00	75.66	75.66			
A22-59713-000							

Email Address: service@rothtrucktrailer.ca

Roth Truck & Trailer 1000110643 ON LTD.

290 Hamilton Rd.

New Hamburg, On. N3A 1A2

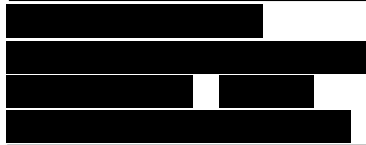
Phone: 519-804-2031 Fax: 000- -

INVOICE**5459**

HST#747847804RT0001

Invoice from History

Printed Date: 01/12/2026

Work Completed: 05/02/2025

2004 Freightliner - M2 Series - M2-106 - Caterpillar C-7 ADEM A4/ACE

Lic # : AW 50749

Odometer In : 2060350

Unit # : 2

VIN # : 1FVHCYDC3 4HN11825

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
------------------	----------	-----	------	-----	-------------------	-------	-----

Org. Estimate	2,366.22	Revisions	0.00	Current Estimate	2,366.22
---------------	----------	-----------	------	------------------	----------

[Payments - MasterCard - \$2,366.22]

Labor:	1,026.00
Parts:	529.00
Sublet:	539.00
SubTotal:	2,094.00
Tax:	272.22
Total:	2,366.22
Bal Due:	\$0.00

Vehicle Received: 5/2/2025

Customer Number : 11

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. **IF ANY WHEELS WHERE REMOVED FOR REPAIR, VEHICLE MUST RETURN FOR WHEEL RE-TORQUE WITHIN 200 KM OF MILEAGE ON INVOICE. OTHERWISE WE WILL NOT BE HELD RESPONSIBLE FOR ANY FAILURES RELATED TO WHEELS AND HOW THEY ARE SECURED TO THE VEHICLE.

Signature _____ Date _____

Email Address: service@rothtrucktrailer.ca