

206-1



Commercial Vehicle Inspection Report

Decal Number: GK05474
Decal Expiry Date: 2026-Mar-31
Inspection Number: 21485178

Inspection Result:
PASS

FACILITY:	CHARLIES TRUCK REPAIR LTD / S2486	INSP. TYPE:	Complete	INSP. START:	2025-Sep-04 10:00 AM MST
INSPECTOR:	FELL, MARK DALE / 201512	INSP. CLASS:	Class 2 - Heavy Vehicle with LGVW 5501 kg or more	INSP. COMPLETE:	2025-Sep-04 01:05 PM MST
WORK ORDER #:		INSP. REASON:	Semi-annual		

VEHICLE JUR:	British Columbia	REGI:	07481781	VIN:	2NKDL69X9NM928023
PLATE #:	PB1132	UNIT/FLEET#:	24	OWNER/LESSEE NAME:	AL BUMSTEAD WATER SERVICE, LTD
LICENCED GVW(kg):	25000	BODY STYLE:	Tank	ADDRESS:	BOX 342
VEHICLE YEAR:	1992	ODOMETER:	129427 KM		Fort Nelson, British Columbia
MAKE:	KENWORTH	HUB ODOMETER:			V0C1R0, Canada
MODEL:		BRAKE TYPE:	Air		
		FUEL TYPE:			

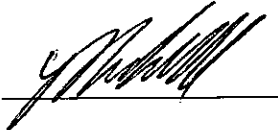
Vehicle Identification (VIN)	Passed	
Section 1 - Power Train	Passed	
Section 2 - Suspension	Passed	
Section 3 - Brake System	Passed	
Section 3A - Air Brakes	Passed	
Section 3H - Hydraulic Brakes	Not Applicable	
Section 4 - Steering	Passed	
Section 5 - Instruments and Auxiliary Equipment	Passed	
Section 6 - Lamps	Repaired (same day)	REPLACED RH REAR OUTER BRAKE/SIG/TAIL LIGHT
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Passed	
Section 9A - Tires	Passed	
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Not Applicable	
Section 11 - Other Vehicle Components	Not Applicable	

Air Brake Chamber Type, Size and Push Rod Stroke (mm)						Tire Tread Depth (mm)				
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	20	Automatic	30	30	18			18	✓
2	Clamp	30	Automatic	30	30	24	24	24	24	
3	Clamp	30	Automatic	30	30	20	20	20	19	
Comment:						Comment:				

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)			
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right	
1	51	48	Lining (Shoe)	11	11	Drum			
2	46	48	Lining (Shoe)	18	19	Drum			
3	59	63	Lining (Shoe)	14	15	Drum			
Comment:			Comment:			Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.			

Inspection Comments:

Has this Vehicle been road tested? No Road Test Date: Road Tester:

Inspector: FELL, MARK DALE Signature: 

This Inspection Report was submitted to CVSE on 2025-Sep-04 01:06 PM MST
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.